ILE1B, ILE1F, ILE1R

Lexium Integrated Drive Product manual V2.00, 09.2008





Important information

This manual is part of the product.

Carefully read this manual and observe all instructions.

Keep this manual for future reference.

Hand this manual and all other pertinent product documentation over to all users of the product.

Carefully read and observe all safety instructions and the chapter "Before you begin - safety information".

Some products are not available in all countries.

For information on the availability of products, please consult the catalog.

Subject to technical modifications without notice.

All details provided are technical data which do not constitute warranted qualities.

Most of the product designations are registered trademarks of their respective owners, even if this is not explicitly indicated.

Table of Contents

	Importa	nnt information	. 2
	Table o	f Contents	. 3
	Writing	conventions and symbols	. 7
1	Introdu	ction	. 9
	1.1	About this manual	. 9
	1.2	Unit overview	. 9
	1.3 1.3.1 1.3.2	Components and interfaces	11
	1.4	Name plate	13
	1.5	Type code	14
	1.6	Documentation and literature references	15
	1.7	Declaration of conformity	16
	1.8	TÜV certificate for functional safety	17
2	Before	you begin - safety information	19
	2.1	Qualification of personnel	19
	2.2	Intended use	19
	2.3	Hazard categories	20
	2.4	Basic information	21
	2.5	Functional safety	22
	2.6	Standards and terminology	23
3	Technic	cal Data	25
	3.1	Certifications	25
	3.2	Ambient conditions	25
	3.3 3.3.1 3.3.2 3.3.3	Mechanical data	27 28
	3.4 3.4.1 3.4.2 3.4.3 3.4.4 3.4.5	Electrical Data	32 32 33 33
	3.5	Conditions for UL 508C	34

4	Basics		35
	4.1	Functional safety	35
5	Engine	ering	37
	5.1 5.1.1	1 117	37 37
	5.2	Ground design	39
	5.3 5.3.1 5.3.2 5.3.3 5.3.4	Definitions	40 40 40 41 43
	5.4	Monitoring functions	44
6	Installa	tion	45
	6.1	Electromagnetic compatibility, EMC	46
	6.2	Mechanical installation	47
	6.3 6.3.1 6.3.2 6.3.3 6.3.4 6.3.5 6.3.6 6.3.7 6.3.8 6.3.9 6.3.10	Wiring examples Overview of all connections Connection via cable entry Connection with industrial connectors Connection of VDC supply voltage PROFIBUS DP connection CAN connection RS485 connection 24V signal interface connection	49 50 51 52 56 56 63 66 71
	6.4 6.4.1 6.4.2 6.4.3 6.4.4	Accessory "Insert kit, 3x I/O"	73 73 73 73
	6.5	Checking wiring	74

7	Commis	ssioning	75
	7.1	Preparing for commissioning	76
	7.2 7.2.1 7.2.2 7.2.3 7.2.4 7.2.5	Running commissioning	77 78 82 83
	7.3 7.3.1	Lexium CT commissioning software Firmware update via fieldbus	
8	Operati	on	89
	8.1 8.1.1 8.1.2 8.1.3 8.1.4 8.1.5 8.1.6 8.1.7	Basics	89 90 92 93 96 98
	8.2 8.2.1 8.2.2 8.2.3 8.2.4	Operating mode JogOperating mode Profile velocity	104 105
	8.3 8.3.1 8.3.2 8.3.3 8.3.4 8.3.5	Motion profile	115 115 116 118
9	Diagnos	stics and troubleshooting	123
	9.1 9.1.1 9.1.2 9.1.3 9.1.4 9.1.5 9.1.6	Diagnostics via commissioning software Diagnostics via fieldbus Operation state and error indication Reset error message Error classes and error response	129 129 130

0198441113568, V2.00, 09.2008

10 Parame	ters137
10.1	Representation of parameters
10.2	Overview Parameters
10.3 10.3.1 10.3.2 10.3.3 10.3.4 10.3.5 10.3.6 10.3.7 10.3.8 10.3.9 10.3.10 10.3.11 10.3.12 10.3.13 10.3.14 10.3.15	Parameter groups
	ories and spare parts155
11.1	Accessories
11.2	Gearboxes
	, maintenance and disposal
12.1	Service address
12.2 12.2.1	Maintenance
12.3	Replacing units
12.4	Shipping, storage, disposal
13 Glossaı	ry163
13.1 13.1.1 13.1.2 13.1.3 13.1.4 13.1.5 13.1.6 13.1.7 13.1.8 13.1.9	Units and conversion tables 163 Length 163 Mass 163 Force 163 Power 163 Rotation 164 Torque 164 Moment of inertia 164 Temperature 164 Conductor cross section 164 Terms and Abbreviations 165
14 Index .	

Writing conventions and symbols

Work steps

If work steps must be performed consecutively, this sequence of steps is represented as follows:

- Special prerequisites for the following work steps
- Step 1
- Specific response to this work step
- ▶ Step 2

If a response to a work step is indicated, this allows you to verify that the work step has been performed correctly.

Unless otherwise stated, the individual steps must be performed in the specified sequence.

Bulleted lists

The items in bulleted lists are sorted alphanumerically or by priority. Bulleted lists are structured as follows:

- · Item 1 of bulleted list
- Item 2 of bulleted list
 - Subitem for 2
 - Subitem for 2
- · Item 3 of bulleted list

Making work easier

Information on making work easier is highlighted by this symbol:



Sections highlighted this way provide supplementary information on making work easier.

Parameters

Parameters are shown as follows:

Gruppe.Name Index:Subindex

SI units

SI units are the original values. Converted units are shown in brackets behind the original value; they may be rounded.

Example:

Minimum conductor cross section: 1.5 mm² (AWG 14)

1 Introduction

1.1 About this manual

This manual is valid for all ILE1B, ILE1F, ILE1R standard products. This chapter lists the type code for this product. The type code can be used to identify whether your product is a standard product or a customized model.

1.2 Unit overview

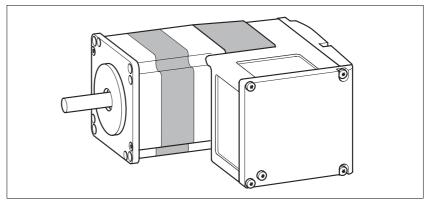


Figure 1.1 Device overview

The "Lexium Integrated Drive" consists of a brushless DC motor with integrated gearbox and integrated electronics. The product integrates interfaces, control electronics and the power stage.

Reference value supply

The "Lexium Integrated Drive" moves the motor according to the commands recieved by a fieldbus master, e.g. a PLC or a PC.

Safety function

The integrated safety function STO (IEC 61800-5-2) meets the requirements of Safety Integrity Level SIL2. The safety function allows for a category 0 stop as per EN 60204-1 without external power contactors. It is not necessary to interrupt the supply voltage. This reduces the system costs and the response times.

The STO safety function is available as of device revision RS10 (see nameplate).



Using the library considerably facilitates controlling the device. The library is available for download from the Internet.

http://www.schneider-electric.com

1.3 Components and interfaces

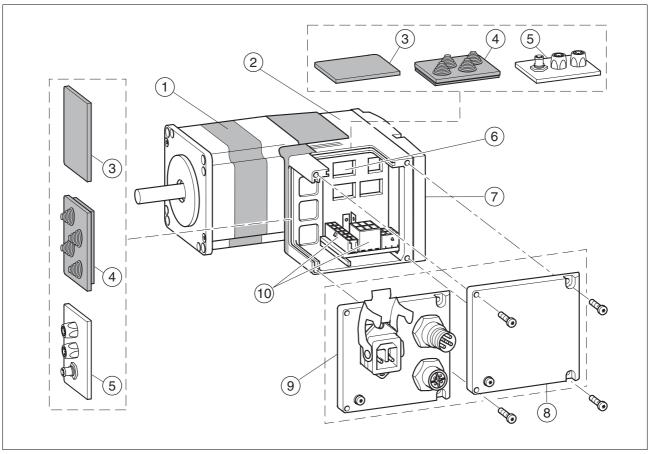


Figure 1.2 Components and interfaces

- (1) Brushless DC motor
- (2) Electronics housing
- (3) Insert for sealing (accessory)
- (4) Insert with cable entry (accessory)
- (5) I/O insert with industrial connector (accessory)
- (6) Switches for settings
- (7) Cover of electronics housing, must not be removed
- (8) Cover of connector housing, to be removed for installation
- (9) Cover with industrial connector for Vdc supply voltage and IN/OUT fieldbus connection (optional)
- (10) Electrical interfaces

1.3.1 Components

Motor

The motor is a brushless direct current motor with permanent magnet excitation with an internal resolution of 12 increments per revolution. The motor has a high detent torque, therefore a brake is not required for most applications.

Gearbox

The motor can be operated with a spur wheel gear.

The following gear ratios are available:

- Three-stage, 18:1 (160:9)
- Three-stage 38:1 (75:2)
- Four-stage 54:1 (490:9)
- Four-stage 115:1 (3675:32)

The motor can also be operated with a worm gear with hollow shaft.

The following gear ratios are available:

- Two-stage 24:1 (525:22)
- Three-stage 54:1 (1715:32)
- Three-stage 92:1 (735:5)
- Three-stage 115:1 (3675:32)

Encoder

The drive system operates with a BLDC encoder. Three Hall sensors capture the actual position of the rotor with 12 increments per second and monitor the commutation status of the motor.

The actual position is converted to a 32 bit absolute value by a position counter. When the drive is switched off, the commutation status and absolute value are saved in the internal data memory.

For the correct motor position to be available again after the motor is switched on, the motor must not be turned when it is off.

Electronics

The electronic system comprises control electronics and power stage. They have a common power supply and are not galvanically isolated.

The drive can be parameterized and controlled via the fieldbus interface.

4 digital 24V signals are also available. Each of them can be used as an input or output.

1.3.2 Interfaces

Standard available interfaces:

Supply voltage VDC

The supply voltage \mathtt{VDC} supplies the control electronics and the power stage.



The ground connections of all interfaces are galvanically connected. For more information see chapter 5.2 "Ground design". This chapter also provides information on protection against reverse polarity.

Fieldbus interface

Functions:

- Profibus DP connection
- CAN bus connection
- RS485 bus connection

The fieldbus interface is used for parameterizing and controlling the drive. The fieldbus interface allows the drive to be integrated into a fieldbus network and controlled by a master such as a PLC.

The drive can be commissioned via any of the above interfaces. This requires, for example, a PC with a suitable fieldbus converter (e.g. USB-CAN). The commissioning software is available for PCs; it supports the various fieldbus versions.

The firmware can be updated via any of the interfaces.

24 V signal interface

4 digital 24V signals are available. Each of them can be used as an input or outputs.

The 24V signals are available to the master controller. However, it is also possible to parameterize special functions such as connection of limit switches.

1.4 Name plate

The nameplate contains the following data:


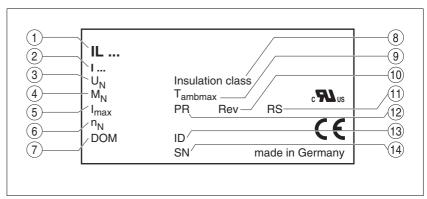


Figure 1.3 Nameplate

- (1) Type code
- (2) Type code (old designation)
- (3) Nominal voltage
- (4) Nominal torque
- (5) Maximum input current
- (6) Nominal speed
- (7) Date of manufacture
- (8) Thermal class
- (9) Maximum ambient air temperature
- (10) Software revision
- (11) Hardware revision
- (12) Firmware number
- (13) Material number
- (14) Serial Number

1.5 Type code

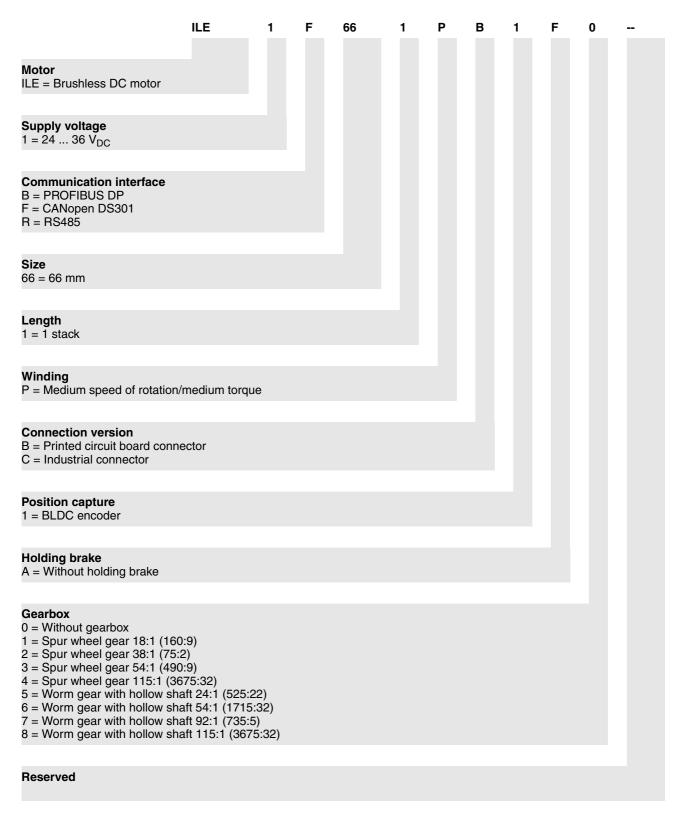

Customized product

In the case of a customized product, position 9 is an "S". Positions 10 ... 13 are the number of the customized product.

Example: IL ••••• S1234--

1.6 Documentation and literature references

The following manuals belong to this product:

- **Product manual**, describes the technical data, installation, commissioning and all operating modes and functions.
- Fieldbus manual, description required to integrate the product into a fieldbus.

Source product manuals

The current product manuals are available for download from the Internet.

http://www.schneider-electric.com

Source EPLAN Macros

For easier engineering, macro files and product master data are available for download from the Internet at:

http://www.schneider-electric.com

Additional literature

We recommend the following literature for more in-depth information:

- Ellis, George: Control System Design Guide. Academic Press
- Kuo, Benjamin; Golnaraghi, Farid: Automatic Control Systems. John Wiley & Sons

1.7 **Declaration of conformity**



SCHNEIDER ELECTRIC MOTION DEUTSCHLAND GmbH & Co. KG Breslauer Str. 7 D-77933 Lahr

EC DECLARATION OF CONFORMITY YEAR 2008

 □ according to EC Directive Machinery 98/37/EC according to EC Directive EMC 2004/108/EC
according to EC Directive Low Voltage 2006/95/EC

We declare that the products listed below meet the requirements of the mentioned EC Directives with respect to design, construction and version distributed by us. This declaration becomes invalid with any modification on the products not authorized by us.

Designation:	Motors with integrated	d control alactronics
Designation.	Will michale	

Type: ILA, ILE, ILS

Product number: 0x6600xxxxxxx, 0x6610xxxxxxx, 0x66206xxxxxx, 0x66307xxxxxx

0x6640xxxxxxx, 0x66606xxxxxx, 0x66707xxxxxx

land the let

EN ISO 13849-1:2006, Performance Level "d" (category 3) **Applied** EN 61800-3:2004, second environment

harmonized EN 62061:2005, SILcl 2 standards, EN 61508:2001, SIL 2 especially:

Applied UL 508C national standards

and technical specifications, especially:

Product documentation

Schneider Electric Motion Deutschland GmbH & Co. KG

Company stamp: Postfach 11 80 · D-77901 Lahr

Breslauer Str. 7 · D-77933 Lahr

Date/ Signature: 10 July 2008

Name/ Department: Wolfgang Brandstätter/Development

1.8 TÜV certificate for functional safety



2 Before you begin - safety information

2.1 Qualification of personnel

Only appropriately trained persons who are familiar with and understand the contents of this manual and all other pertinent product documentation are authorized to work on and with this product. In addition, these persons must have received safety training to recognize and avoid hazards involved. These persons must have sufficient technical training, knowledge and experience and be able to foresee and detect potential hazards that may be caused by using the product, by changing the settings and by the mechanical, electrical and electronic equipment of the entire system in which the product is used.

All persons working on and with the product must be fully familiar with all applicable standards, directives, and accident prevention regulations when performing such work.

2.2 Intended use

This product is a motor with an integrated drive and intended for industrial use according to this manual.

The product may only be used in compliance with all applicable safety regulations and directives, the specified requirements and the technical data.

Prior to using the product, you must perform a risk assessment in view of the planned application. Based on the results, the appropriate safety measures must be implemented.

Since the product is used as a component in an entire system, you must ensure the safety of persons by means of the design of this entire system (e.g. machine design).

Operate the product only with the specified cables and accessories. Use only genuine accessories and spare parts.

The product must NEVER be operated in explosive atmospheres (hazardous locations, Ex areas).

Any use other than the use explicitly permitted is prohibited and can result in hazards.

Electrical equipment should be installed, operated, serviced, and maintained only by qualified personnel.

2.3 Hazard categories

Safety instructions to the user are highlighted by safety alert symbols in the manual. In addition, labels with symbols and/or instructions are attached to the product that alert you to potential hazards.

Depending on the seriousness of the hazard, the safety instructions are divided into 4 hazard categories.

A DANGER

DANGER indicates an imminently hazardous situation, which, if not avoided, **will result** in death or serious injury.

A WARNING

WARNING indicates a potentially hazardous situation, which, if not avoided, **can result** in death, serious injury, or equipment damage.

A CAUTION

CAUTION indicates a potentially hazardous situation, which, if not avoided, **can result** in injury or equipment damage.

CAUTION

CAUTION used without the safety alert symbol, is used to address practices not related to personal injury (e.g. **can result** in equipment damage).

2.4 Basic information

A DANGER

UNINTENDED CONSEQUENCES OF EQUIPMENT OPERATION

When the system is started, the drives are usually out of the operator's view and cannot be visually monitored.

 Only start the system if there are no persons in the hazardous area.

Failure to follow these instructions will result in death or serious injury.

A WARNING

UNEXPECTED MOVEMENT

Drives may perform unexpected movements because of incorrect wiring, incorrect settings, incorrect data or other errors.

Interference (EMC) may cause unpredictable responses in the system.

- Carefully install the wiring in accordance with the EMC requirements.
- Switch off the voltage at the inputs STO_A (PWRR_A) and STO_B
 (PWRR_B) to avoid an unexpected restart of the motor before
 switching on and configuring the drive system.
- Do NOT operate the drive system with unknown settings or data.
- · Perform a comprehensive commissioning test.

Failure to follow these instructions can result in death or serious injury.

A WARNING

LOSS OF CONTROL

- The designer of any control scheme must consider the potential failure modes of control paths and, for certain critical functions, provide a means to achieve a safe state during and after a path failure. Examples of critical control functions are EMERGENCY STOP, overtravel stop, power outage and restart.
- Separate or redundant control paths must be provided for critical functions.
- System control paths may include communication links. Consideration must be given to the implication of unanticipated transmission delays or failures of the link.
- Observe the accident prevention regulations and local safety guidelines. ¹⁾
- Each implementation of the product must be individually and thoroughly tested for proper operation before being placed into service.

Failure to follow these instructions can result in death or serious injury.

 For USA: Additional information, refer to NEMA ICS 1.1 (latest edition), Safety Guidelines for the Application, Installation, and Maintenance of Solid State Control and to NEMA ICS 7.1 (latest edition), Safety Standards for Construction and Guide for Selection, Installation for Construction and Operation of Adjustable-Speed Drive Systems.

A CAUTION

UNEXPECTED BEHAVIOR AND DESTRUCTION OF SYSTEM COMPONENTS

When you work on the wiring and when you unplug or plug in connectors, this may cause unexpected behavior and destruction of system components.

• Switch the power supply off before working on the wiring.

Failure to follow these instructions can result in injury or equipment damage.

2.5 Functional safety

Using the safety functions integrated in this product requires careful planning. For more information see chapter 5.3 "Safety function STO ("Safe Torque Off")" on page 40.

2.6 Standards and terminology

Technical terms, terminology and the corresponding descriptions in this manual are intended to use the terms or definitions of the pertinent standards.

In the area of drive systems, this includes, but is not limited to, terms such as "safety function", "safe state", "fault", "fault reset", "failure", "error", "error message", "warning", "warning message", "alarm", etc.

Among others, these standards include:

- IEC 61800 series: "Adjustable speed electrical power drive systems"
- IEC 61800-7 series: "Adjustable speed electrical power drive systems Part 7-1: Generic interface and use of profiles for power drive systems Interface definition"
- IEC 61158 series: "Industrial communication networks Fieldbus specifications"
- IEC 61784 series: "Industrial communication networks Profiles"
- IEC 61508 series: "Functional safety of electrical/electronic/programmable electronic safety-related systems"

Also see the glossary at the end of this manual.

3 Technical Data

This chapter contains information on the ambient conditions and on the mechanical and electrical properties of the device family and the accessories.

3.1 Certifications

Product certifications:

Certified by	Assigned number	Validity
TÜV Nord	SAS-1728/08	2013-01-09
UL	File E 153659	

Certified safety function

This product has the following certified safety function:

Safety function STO "Safe Torque Off" (IEC 61800-5-2)

3.2 Ambient conditions

Ambient temperature during operation

The maximum permissible ambient temperature during operation depends on the distance between the devices and the required power. Observe the pertinent instructions in the chapter Installation.

Operating temperature 1) 2)	[°C]	0 50
Operating temperature with current reduction of 2% per Kelvin 1)	[°C]	50 65

- 1) Limit values with flanged motor (steel plate 300x300x10 mm)
- 2) If the product is to be used in compliance with UL 508C, note the information provided in chapter 3.5 "Conditions for UL 508C".

Ambient conditions transportation and storage

The environment during transport and storage must be dry and free from dust. The maximum vibration and shock load must be within the specified limits.

Temperature	[°C]	-25 +/0
Max. temperature of power stage ¹⁾	[°C]	105
Max. temperature of motor ²⁾	[°C]	110

- 1) Can be read via parameter
- 2) Measured on the surface

Relative humidity

Temperature

The following relative humidity is permissible during operation:

Relative humidity (non-condens-	[%]	15 85	
ing)			

0198441113568, V2.00, 09.2008

Installation altitude	The installation altitude is defined as height above sea level.		
	Installation altitude	[m] ≤1000	
Vibration and shock	Vibartion, sinusoidal	As per IEC/EN 60068-2-6 0.15 mm (from 10 Hz 60 Hz) 20 m/s ² (from 10 Hz 500 Hz)	
	Shock, semi-sinusoidal	As per IEC/EN 60068-2-27: 150 m/s ² (11 ms)	
EMC	Emission	IEC/EN 61800-3: Class C2 EN 61000-6-4 EN 55022: Class A	
	Noise immunity	IEC/EN 61800-3: Second environment	

3.3 Mechanical data

3.3.1 Degree of protection

IP degree of protection

The product has the following IP degree of protection as per EN 60529.

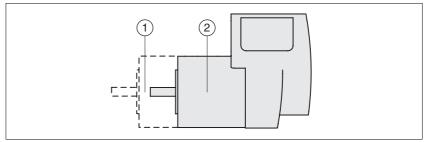


Figure 3.1 IP degree of protection

Item		Degree of protection
1	Shaft bushing	IP41
	Shaft bushing with GBX gear (accessory)	IP54
2	Housing, except shaft bushing	IP54

The total degree of protection is determined by the component with the lowest degree of protection.

Overview of IP degrees of protection

First digit Protection against intrusion of objects		Second digit Protection against intrusion of water		
1	External objects >50 mm	1	Vertically falling dripping water	
2	External objects >12 mm	2	Dripping water falling at an angle (75 $^{\circ}$ 90 $^{\circ}$)	
3	External objects >2.5 mm	3	Spraying water	
4	External objects >1 mm	4	Splashing water	
5	Dust-protected	5	Water jets	
6	Dust-tight	6	Heavy sea	
		7	Immersion	
		8	Submersion	

Degree of protection if STO is used

You must ensure that conductive substances cannot get into the product (pollution degree 2). If you use the safety function and conductive substances get into the product, the safety function may become inoperative.

3.3.2 Mounting position

Mounting position

The following mounting positions are defined and approved as per EN 60034-7:

- IM B5 drive shaft horizontal
- IM V1 drive shaft vertical, shaft end down
- IM V3 drive shaft vertical, shaft end up

3.3.3 Dimensions

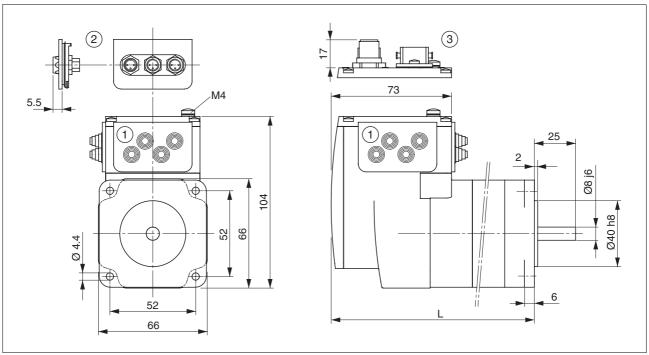


Figure 3.2 Dimensions

- (1) Insert with cable entry (accessory)
- (2) Insert kit (accessory)
- (3) Industrial connector (option)

Total length L

ILE••661		P•1A0	
L	[mm]	122	

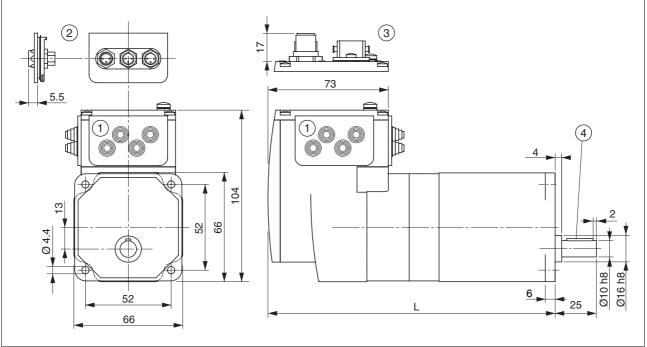


Figure 3.3 Dimensions

- Insert with cable entry (accessory) (1)
- (2) Insert kit (accessory)
- (3) (4) Industrial connector (option)
- Parallel key

Total length L

ILE••661	P•1A1	P•1A2	P•1A3	P•1A4
L	[mm] 174	174	174	174

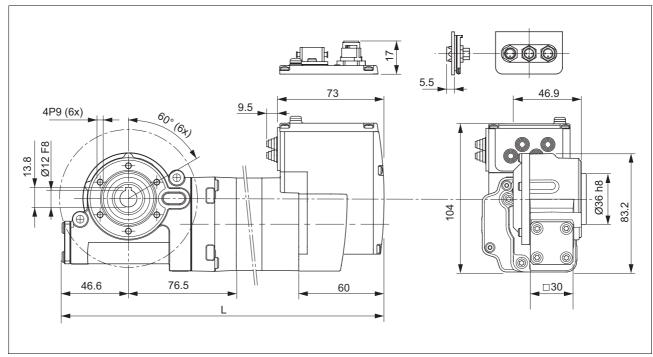


Figure 3.4 Dimensions

- (1) Insert with cable entry (accessory)
- (2) Insert kit (accessory)
- (3) Industrial connector (option)

Total length L

ILE••661		P•1A6	P•1A7	P•1A8	
L	[mm]	229	229	229	

3.4 **Electrical Data**

Overview of printed circuit board connectors

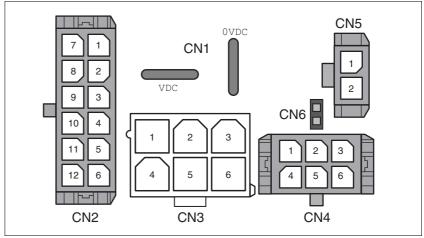


Figure 3.5 Overview of printed circuit board connectors

3.4.1 Supply Voltage VDC at CN1

		ILE1•66•
Nominal voltage	[V _{dc}]	24 / 36
Limit values	[V _{dc}]	18 40
Ripple at nominal voltage	[V _{pp}]	≤3.6
Max. continuous current input ¹⁾ Winding type P	[A]	5.5
Peak input current Winding type P	[A]	7
Fuse to be connected upstream ²⁾	[A]	≤16

¹⁾ The actual power requirement is often significantly lower, because the maximum possible motor torque is usually not required for operation of a system.

2) See chapter 5.1.1 "Supply voltage"

Inrush current current

Charging current for capacitor C=1500 µF

3.4.2 Fieldbus at CN2

CAN bus signals

The CAN bus signals comply with the ISO 11898 standard and are not galvanically isolated.

Transmission rate	[kBaud] 50 / 100 / 125 / 250 / 500 / 800 / 1000
Transmission protocol	CANopen as per DS301

Profibus signals

The Profibus signals comply with the RS485 standard and are galvanically isolated.

Transmission rate	[kBaud] 9.6 / 19.2 / 45.45 / 93.75 / 187.5 / 500 / 1500 / 3000 / 6000 / 12000
Transmission protocol	Profibus DP V0

3.4.3 Fieldbus at CN3

RS485 signals

The RS485 signals conform to the RS485 standard and are not galvanically isolated.

Transmission rate	[kBaud] 9.6 / 19.2 / 38.4
Transmission protocol	Manufacturer-specific protocol

3.4.4 24V signals to CN4

Signal inputs

The signal inputs are galvanically connected to ${\tt OVDC}$ and not protected against reverse polarity.

Logic 0 (U _{low})	[V]	-3 +4.5
Logic 1 (U _{high})	[V]	+15 +30
Input current (typical at 24V)	[mA]	2
Debounce time IO0 IO3	[ms]	0.1
Debounce time IO2 and IO3 1)	[ms]	0.01

¹⁾ When the function "Fast Position Capture is used"

Signal outputs

The signal outputs are galvanically connected to $\mathtt{0VDC}$ and short-circuit protected.

Nominal voltage	[V]	24
Voltage range	[V]	23 25
Maximum current (total)	[mA]	200
Maximum current per output	[mA]	100
Suitable for inductive loads	[mH]	1000

3.4.5 STO safety function at CN5 and CN6

The signal inputs are galvanically connected to OVDC.

[V]	-3 +4.5
[V]	+15 +30
[mA]	≤10
[mA]	≤3
[ms]	1
[s]	≥1
[ms]	<50
[ms]	<1
	[V] [mA] [mS] [s]

Data for maintenance plan and safety calculations

Use the following data of the STO safety function for your maintenance plan and the safety calculations:

Lifetime (IEC 61508)		20 years
SFF (IEC 61508) Safe Failure Fraction	[%]	66
HFT (IEC 61508) Hardware Fault Tolerance Type A subsystem		1
Safety integrity level IEC 61508 IEC 62061		SIL2 SILCL2
PFH (IEC 61508) Probability of Dangerous Hardware Failure per Hour	[1/h]	1.84*10 ⁻⁹
PL (ISO 13849-1) Performance Level		d (Category 3)
MTTF _d (EN 13849-1) Mean Time to Dangerous Failure		4566 years
DC (EN 13849-1) Diagnostic Coverage	[%]	90

3.5 Conditions for UL 508C

If the product is used to comply with UL 508C, the following conditions must be met:

Ambient temperature during operation

Surrounding air temperature		0 +50
Surrounding air temperature with current reduction of 2% per Kelvin		50 65

Pollution degree

Use in an environment with pollution degree 2.

Power supply

Use only power supply units that are approved for overvoltage category

Wiring

Use only 60/75 °C copper conductors.

4 Basics

4.1 Functional safety

Automation and safety engineering are two areas that were completely separated in the past but recently have become more and more integrated. Engineering and installation of complex automation solutions are greatly simplified by integrated safety functions.

Usually, the safety engineering requirements depend on the application. The level of the requirements results from the risk and the hazard potential arising from the specific application.

Working with IEC 61508

IEC 61508 standard

The standard IEC 61508 "Functional safety of electrical/electronic/programmable electronic safety-related systems" covers the safety-related function. It is not only one single component but the entire function chain (e.g. from the sensor through the logical processing unit to the actuator) that is considered as one single unit. This function chain must meet the requirements of the specific safety integrity level as a whole. Systems and components that can be used in various applications for safety tasks with comparable risk levels can be developed on this basis.

SIL, Safety Integrity Level

The standard IEC 61508 defines 4 safety integrity levels (SIL) for safety functions. SIL1 is the lowest level and SIL4 is the highest level. A hazard and risk analysis serves as a basis for determining the required safety integrity level. This is used to decide whether the relevant function chain is to be considered as a safety function and which hazard potential it must cover.

PFH, Probability of a dangerous hardware failure per hour To maintain the safety function, the IEC 61508 standard requires various levels of measures for avoiding and controlling faults, depending on the required SIL. All components of a safety function must be subjected to a probability assessment to evaluate the effectiveness of the measures implemented for controlling faults. This assessment determines the PFH (probability of a dangerous failure per hour) for a safety system. This is the probability per hour that a safety system fails in a hazardous manner and the safety function cannot be correctly executed. Depending on the SIL, the PFH must not exceed certain values for the entire safety system. The individual PFH values of a function chain are added; the total PFH value must not exceed the maximum value specified in the standard.

SIL	PFH at high demand or continuous demand
4	≥10 ⁻⁹ <10 ⁻⁸
3	≥10 ⁻⁸ <10 ⁻⁷
2	≥10 ⁻⁷ <10 ⁻⁶
1	≥10 ⁻⁶ <10 ⁻⁵

HFT and SFF

Depending on the SIL for the safety system, the IEC 61508 standard requires a specific hardware fault tolerance HFT in connection with a specific proportion of safe failures SFF (safe failure fraction). The hardware fault tolerance is the ability of a system to execute the required safety function in spite of the presence of one or more hardware faults. The SFF of a system is defined as the ratio of the rate of safe failures to the total failure rate of the system. According to IEC 61508, the maximum achievable SIL of a system is partly determined by the hardware fault tolerance HFT and the safe failure fraction SFF of the system.

SFF	HFT type A subsystem		HFT type B subsystem			
	0	1	2	0	1	2
< 60%	SIL1	SIL2	SIL3		SIL1	SIL2
60% <90%	SIL2	SIL3	SIL4	SIL1	SIL2	SIL3
90% < 99%	SIL3	SIL4	SIL4	SIL2	SIL3	SIL4
≥99%	SIL3	SIL4	SIL4	SIL3	SIL4	SIL4

Fault avoidance measures

Systematic errors in the specifications, in the hardware and the software, usage faults and maintenance faults of the safety system must be avoided to the maximum degree possible. To meet these requirements, IEC 61508 specifies a number of measures for fault avoidance that must be implemented depending on the required SIL. These measures for fault avoidance must cover the entire life cycle of the safety system, i.e. from design to decommissioning of the system.

5 Engineering

This chapter contains information on the application of the product that is vital in the design phase.

5.1 External power supply units

DANGER

ELECTRIC SHOCK CAUSED BY INCORRECT POWER SUPPLY UNIT

The VDC and +24VDC supply voltages are connected with many exposed signal connections in the drive system.

- Use a power supply unit that meets the PELV (Protective Extra Low Voltage) requirements.
- Connect the negative output of the power supply unit to PE (ground).

Failure to follow these instructions will result in death or serious injury.

5.1.1 Supply voltage

General

The power supply unit must be rated for the power requirements of the drive. The input current can be found in the technical data.

The actual power requirements are often significantly lower because the maximum possible motor torque is usually not required for normal operation of a system.

When designing the system, note that the input current of the drive is higher during the motor acceleration phase than during constant movement.

Protection against reverse polarity

In the case of reverse polarity, the supply voltage is short-circuited. The drive is continuous short circuit-proof up to a short-circuit current of a maximum of 15 A. If the power is supplied by a transformer power supply unit, several hundred amperes may flow for a short period of time in the event of reverse polarity; the drive is rated for this and will not be damaged.

Fuse: a circuit-breaker (16 A, trip characteristic B) or a blade fuse (FKS, max. 15 A) or a fuse (5 mm x 20 mm, 10 A slow-blow).

Regeneration condition

Note the following for drives with large external mass moments of inertia or for highly dynamic applications:

Motors return regeneration energy during deceleration. The DC bus can store a limited amount of energy in the capacitors. Connecting additional capacitors to the DC bus increases the amount of energy that can be stored.

If the capacity of the capacitors is exceeded, the excess energy must be discharged via internal or external braking resistors. If the energy is not discharged, an overvoltage monitor will shut off the power stage.

Overvoltages can be limited by adding a braking resistor with a corresponding braking resistor controller. This converts the regenerated energy to heat energy during deceleration.

Braking resistor controllers can be found in chapter 11 "Accessories and spare parts". See the product manual for a description of the braking resistor controller.

A CAUTION

LOSS OF CONTROL DUE TO REGENERATION CONDITION

Regeneration conditions resulting from braking or external driving forces may increase the \mathtt{VDC} supply voltage to an unexpected level. Components not rated for this voltage may be destroyed or cause misoperation.

- Verify that all VDC consumers are rated for the voltage occurring during regeneration conditions (for example limit switches).
- Use only power supply units that will not be damaged by regeneration conditions.
- Use a braking resistor controller, if necessary.

Failure to follow these instructions can result in injury or equipment damage.

24V signal power supply

A constant 24V signal power supply is available for the sensor system.

It must not be connected in parallel with the 24V signal power supply of a different drive.

5.2 Ground design

The ground connections of all interfaces are galvanically connected, including the ground for the VDC supply voltage.

The module interfaces with galvanic isolation such as Profibus are exceptions to this.

The following points must be considered when you wire the drives in a system:

- The voltage drop in the VDC power supply lines must be kept as low as possible (less than 1 V). At higher ground potential differences between different drives, the communication / control signals may be affected.
- If the distance between the system components is greater, it is recommended to use decentralized power supply units close to the individual drives to supply the VDC voltage. However, the ground connections of the individual power supply units must be connected with the largest possible conductor cross section.
- The internal 24V signal power supply must not be connected in parallel with the internal 24V signal power supply of a different drive.
- If the master controller (e.g. PLC, IPC etc.) does not have galvanically isolated outputs for the drives, you must verify that the current of the VDC supply voltage has no path back to the power supply unit via the master controller. Therefore, the master controller ground may be connected to the VDC supply voltage ground at a single point only. This is usually the case in the control cabinet. The ground contacts of the various signal connectors in the drive are therefore not connected; there is already a connection via the VDC supply voltage ground.
- If the controller has a galvanically isolated interface for communication with the drives, the ground of this interface must be connected to the signal ground of the first drive. This ground may be connected to a single drive only to avoid ground loops. This also applies to a galvanically isolated CAN connection.

Equipotential bonding conductors

Potential differences can result in excessive currents on the cable shields. Use equipotential bonding conductors to reduce currents on the cable shields.

The equipotential bonding conductor must be rated for the maximum current flowing. Practical experience has shown that the following conductor cross sections can be used:

- 16 mm² (AWG 4) for equipotential bonding conductors up to a length of 200 m
- 20 mm² (AWG 4) for equipotential bonding conductors with a length of more than 200 m

5.3 Safety function STO ("Safe Torque Off")

See page 35 for information on using the IEC 61508 standard..

5.3.1 **Definitions**

Safety function STO (IEC 61800-5-The safety function STO ("Safe Torque Off", "Safe Torque Off") shuts off 2)

the motor torque safely. It is not necessary to interrupt the supply volt-

age. There is no monitoring for standstill.

"Power Removal" The STO safety function ("Safe Torque Off") is also known as "Power

Removal".

Category 0 stop (EN 60204-1) Stopping by immediate removal of power to the machine actuators (i.e.

an uncontrolled stop).

Category 1 stop (EN 60204-1) Controlled stop with power available to the machine actuators to achieve

the stop. Power is not interrupted until the stop is achieved.

5.3.2 **Function**

The STO safety function integrated into the product can be used to implement an "EMERGENCY STOP" (EN 60204-1) for category 0 stops. With an additional, approved EMERGENCY STOP module, it is also possible to implement category 1 stops.

Function principle

The STO safety function is triggered via 2 redundant inputs. The circuits of the two inputs must be separate so that there are always two channels.

The switching process must be simultaneous for both inputs (skew <1s). The power stage is disabled and an error message is generated. The motor can no longer generate torque and coasts down without braking. A restart is possible after resetting the error message with a "Fault Reset".

The power stage is disabled and an error message is generated if only one of the two inputs is switched off or if the skew is too great. This error message can only be reset by switching off the product.

5.3.3 Requirements for using the safety function

A WARNING

LOSS OF SAFETY FUNCTION

Incorrect usage may cause a hazard due to the loss of the safety function.

Observe the requirements for using the safety function.

Failure to follow these instructions can result in death or serious injury.

Category 0 stop

During a category 0 stop, the motor coasts down in an uncontrolled way. If access to the machine coasting down involves a hazard (results of the hazard and risk analysis), you must take appropriate measures.

Category 1 stop

A controlled stop must be triggered with a category 1 stop. The controlled stop is not monitored by the drive system; in the case of a power outage or an error, the stop may not be performed correctly. Final shutoff of the motor is achieved by switching off the two inputs of the STO safety function. The shutoff is usually controlled by a standard EMERGENCY STOP module with a safe time delay.

Behavior of holding brake

Triggering the STO safety function means that the delay time for motors with holding brake is not effective. The motor cannot generate holding torque to bridge the time to application of the holding brake. Especially in the case of vertical axes it is important to verify whether additional measures are required to avoid lowering of the load.

Vertical axes, external forces

If external forces act on the motor (vertical axis) and an unwanted movement, for example caused by gravity, could cause a hazard, the motor must not be operated without additional measures for fall protection, corresponding to the required safety.

Unintended restart

Note that a master controller must not trigger an unintended restart after restoration of power (e.g. after a power outage).

Degree of protection if STO is used

You must ensure that conductive substances cannot get into the product (pollution degree 2). If you use the safety function and conductive substances get into the product, the safety function may become inoperative.

Protected cable installation

If short circuits or cross circuits can be expected in connection with the two signals of the STO safety function and if they are not detected by upstream devices, protected cable installation is required.

In the case of an unprotected cable installation, the two signals of the STO safety function may be connected to external voltage if a cable is damaged. If the two signals are connected to external voltage, the STO safety function is no longer operative.

Protected cable installation possibilities:

- Use separate cables for two signals. Any additional wires in these cables may only carry voltages according to PELV.
- Use a shielded cable. The grounded shield is designed to dissipate the external voltage in the case of damages and to trip the fuse in this way.
- Use a separately grounded shield. If there are other wires in the cable, the two signals must be isolated from these wires by a grounded, separate shield.

Data for maintenance plan and safety calculations

Use the following data of the STO safety function for your maintenance plan and the safety calculations:

Lifetime (IEC 61508)		20 years
SFF (IEC 61508) Safe Failure Fraction	[%]	66
HFT (IEC 61508) Hardware Fault Tolerance Type A subsystem		1
Safety integrity level IEC 61508 IEC 62061		SIL2 SILCL2
PFH (IEC 61508) Probability of Dangerous Hardware Failure per Hour	[1/h]	1.84*10 ⁻⁹
PL (ISO 13849-1) Performance Level		d (Category 3)
MTTF _d (EN 13849-1) Mean Time to Dangerous Failure		4566 years
DC (EN 13849-1) Diagnostic Coverage	[%]	90

Hazard and risk analysis

As a system manufacturer you must conduct a hazard and risk analysis of the entire system. The results must be taken into account in the application of the STO safety function.

The type of circuit resulting from the analysis may differ from the following application examples. Additional safety components may be required. The results of the hazard and risk analysis always have priority.

5.3.4 Application examples STO

Example of category 0 stop Application without EMERGENCY STOP module, category 0 stop.

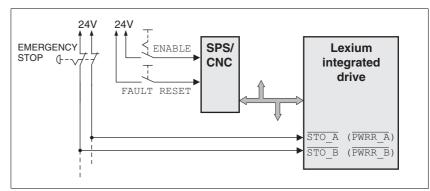


Figure 5.1 Example of category 0 stop

Please note:

 When the EMERGENCY STOP switch is tripped, this initiates a category 0 stop

Example of category 1 stop
Application with EMERGENCY STOP module, category 1 stop.

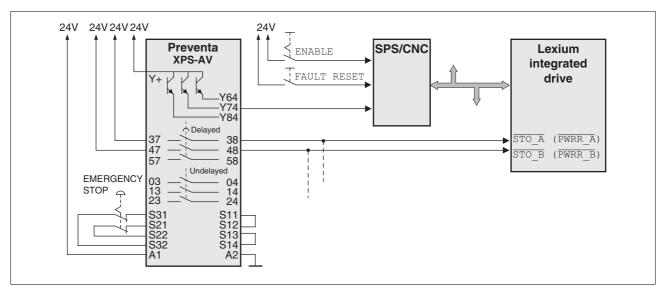


Figure 5.2 Example of category 1 stop

Please note:

- The master controller must immediately trigger a controlled stop, e.g. via the "Quick Stop" function.
- The inputs STO_A (PWRR_A) and STO_B (PWRR_B) must be switched off with a time delay. The delay is set at the EMERGENCY STOP safety module. If the motor has not yet stopped when the delay time has elapsed, it coasts down in an uncontrolled way (uncontrolled stop).
- The specified minimum current and the permissible maximum current of the relay must be observed if the relay outputs of the EMER-GENCY STOP module are used.

5.4 Monitoring functions

The monitoring functions in the product can help to guard the system and reduce the risks involved in a system misoperation. These monitoring functions may not be used to protect persons.

The following monitoring functions are available:

Monitoring	Task	
Blocking error	Error message if, in spite of maximum current, the motor shaft does not move for the time set with this parameter.	
Data link	Error response if the link becomes inoperative	
Limit switch signals	Monitors for permissible range of travel	
I ² t limitation	Power limitation in event of overloading	
Tracking error	Monitors for difference between actual motor position and reference position	
STOP switch signal	Stops motor with "Quick Stop"	
Overvoltage and undervoltage	Monitors for overvoltage and undervoltage of the supply voltage	
Motor overload	Monitors for excessively high current in the motor phases	
Overtemperature	Monitors the device for overtemperature	

6 Installation

A WARNING

LOSS OF CONTROL

- The designer of any control scheme must consider the potential failure modes of control paths and, for certain critical functions, provide a means to achieve a safe state during and after a path failure. Examples of critical control functions are EMERGENCY STOP, overtravel stop, power outage and restart.
- Separate or redundant control paths must be provided for critical functions.
- System control paths may include communication links. Consideration must be given to the implication of unanticipated transmission delays or failures of the link.
- Observe the accident prevention regulations and local safety guidelines. ¹⁾
- Each implementation of the product must be individually and thoroughly tested for proper operation before being placed into service.

Failure to follow these instructions can result in death or serious injury.

 For USA: Additional information, refer to NEMA ICS 1.1 (latest edition), Safety Guidelines for the Application, Installation, and Maintenance of Solid State Control and to NEMA ICS 7.1 (latest edition), Safety Standards for Construction and Guide for Selection, Installation for Construction and Operation of Adjustable-Speed Drive Systems.

A CAUTION

RISK OF INJURY WHEN REMOVING CIRCUIT BOARD PLUGS

- When removing them note that the connectors must be unlocked.
 - Supply voltage VDC:
 Unlock by pulling at the plug housing
 - Miscellaneous:
 Unlock by pressing the locking lever
- Always hold the plug to remove it (not the cable).

Failure to follow these instructions can result in injury or equipment damage.



The chapter Engineering contains basic information that you should know before starting the installation.

6.1 Electromagnetic compatibility, EMC

A WARNING

SIGNAL AND DEVICE INTERFERENCE

Signal interference can cause unexpected responses of device.

- Install the wiring in accordance with the EMC requirements.
- · Verify compliance with the EMC requirements.

Failure to follow these instructions can result in death, serious injury or equipment damage.

This drive system meets the EMC requirements according to the standard IEC 61800-3, if the described measures are implemented during installation. If it is operated outside this scope, note the following:

A WARNING

HIGH-FREQUENCY INTERFERENCE

In a domestic environment this product may cause high-frequency interference that may require action to suppress interference.

EMC measures	Effect
Keep cables as short as possible. Do not install unnecessary cable loops, use short cables from the star point in the control cabinet to the external ground connection.	Reduces capacitive and inductive interference.
Ground the product via the motor flange or with a ground strap to the ground connection at the cover of the connector housing.	Reduces emissions, increases immunity.
Ground shields of digital signal wires at both ends by connecting them to a large surface or via conductive connector housings.	Reduces interference affecting the signal wires, reduces emissions
Connect large surface areas of cable shields, use cable clamps and ground straps	Reduces emissions.

The following cables must be shielded:

- · Fieldbus cable
- STO safety function, see the requirements in chapter 5.3.3 "Requirements for using the safety function".

The following cables do not need to be shielded:

- Supply voltage VDC
- 24 V signal interface

Equipotential bonding conductors

Potential differences can result in excessive currents on the cable shields. Use equipotential bonding conductors to reduce currents on the cable shields.

The equipotential bonding conductor must be rated for the maximum current flowing. Practical experience has shown that the following conductor cross sections can be used:

- 16 mm² (AWG 4) for equipotential bonding conductors up to a length of 200 m
- 20 mm² (AWG 4) for equipotential bonding conductors with a length of more than 200 m

6.2 Mechanical installation

A CAUTION

HOT SURFACES

Depending on the operation, the surface may heat up to more than 100°C (212°F).

- Do not allow contact with the hot surfaces.
- Do not allow flammable or heat-sensitive parts in the immediate vicinity.
- Consider the measures for heat dissipation described.
- · Check the temperature during test runs.

Failure to follow these instructions can result in injury or equipment damage.

A CAUTION

MOTOR DAMAGE AND LOSS OF CONTROL

Shock or strong pressure applied to the motor shaft may destroy the motor.

- Protect the motor shaft during handling and transportation.
- Avoid shocks to the motor shaft during mounting.
- Do not press parts onto the shaft. Mount parts to the shaft by glueing, clamping, shrink-fitting or screwing.

Failure to follow these instructions can result in injury or equipment damage.

A WARNING

MOTOR WITHOUT BRAKING EFFECT

If power outage and faults cause the power stage to be switched off, the motor is no longer stopped by the brake and may increase its speed even more until it reaches a mechanical stop.

- · Verify the mechanical situation.
- If necessary, use a cushioned mechanical stop or a suitable brake.

Failure to follow these instructions can result in death, serious injury or equipment damage.



To install a drive in locations difficult to access, it may be useful to carry out the electrical installation first and then install the fully wired drive.

Heat dissipation

The motor may become very hot, e.g. in the case of incorrect arrangement of multiple motor. The surface temperature of the motor must not exceed 110 °C during continuous operation.

- Verify that the maximum temperature is not exceeded.
- Verify that there is sufficient heat dissipation, e.g. by means of good ventilation or heat dissipation via the motor flange.

Mounting

The motor is designed to be mounted using four M5 screws. The motor flange must be mounted on a flat surface to avoid mechanical tension from being transmitted to the housing.

Painted surfaces have an insulating effect. During mounting verify that the motor flange is mounted in such a way as to allow for good conductivity (electrical and thermal).

Mounting distances

No minimum clearances are required for installation. However, note that the motor can become very hot.

Observe the bending radii of the cables used.

Ambient conditions

Observe the permissible ambient conditions.

6.3 Electrical installation

A WARNING

UNEXPECTED BEHAVIOR CAUSED BY FOREIGN OBJECTS

Foreign objects, deposits or humidity can cause unexpected behavior.

- Keep foreign objects from getting into the product.
- Do not remove the cover of the electronics housing. Only remove the connector housing cover.
- Verify correct seat of seals and cable entries.

Failure to follow these instructions can result in death, serious injury or equipment damage.

A WARNING

LOSS OF SAFETY FUNCTION CAUSED BY FOREIGN OBJECTS

Conductive foreign objects, dust or liquids may cause the STO safety function to become inoperative.

You may not use the STO safety function unless you have protected the system against contamination by conductive substances.

Failure to follow these instructions can result in death or serious injury.

A CAUTION

DAMAGE TO SYSTEM COMPONENTS AND LOSS OF CONTROL

Interruptions of the negative connection of the controller supply voltage can cause excessively high voltages at the signal connections.

- Do not interrupt the negative connection between the power supply unit and load with a fuse or switch.
- Verify correct connection before switching on.
- Do not connect the controller supply voltage or change its wiring while the is supply voltage present.

Failure to follow these instructions can result in injury or equipment damage.



The chapter Engineering contains basic information that you should know before starting the installation.

The drive is equipped with parameter switches in the connector housing. Set the parameter switches before connecting the cables, because after connection they are difficult to access.

6.3.1 Wiring examples

The following figure shows a typical wiring example. The limit switches and the reference switch are supplied via the internal 24V signal power supply.

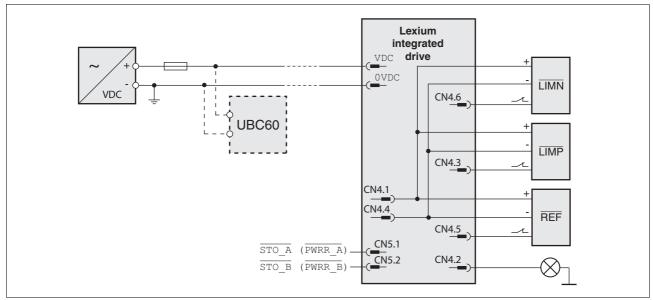


Figure 6.1 Wiring example

The UBC60 braking resistor controller is available as an accessory, see chapter 11 "Accessories and spare parts".

6.3.2 Overview of all connections

Overview of printed circuit board connectors

The following figure shows the pin assignment of the interfaces with the connector housing cover open.

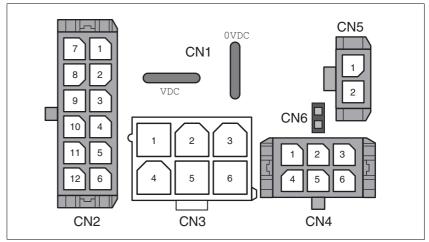


Figure 6.2 Overview of all connections

Connection	Assignment
CN1	Supply voltage VDC
CN2	Interface for PROFIBUS DP
CN3	Interface for CAN or RS485
CN4	24 V signal interface
CN5	Interface for STO safety function
CN6	Jumper for disabling STO safety function

The drive can be connected via cable entries or industrial connectors.

For connection via cable entries see page 52.

For connection via industrial connectors see page 56.

6.3.3 Connection via cable entry

The cable specifications and pin assignments can be found in the chapters that describe the connections.

Preparing and fastening cables

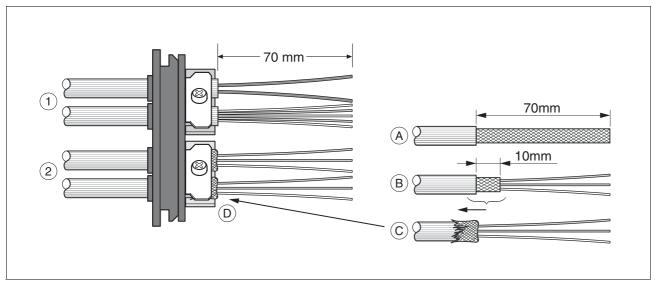


Figure 6.3 Fastening the cable in the cable entry

- (1) Unshielded cable
- (2) Shielded cable
- ▶ Trim the cable bushings to fit the cable.

NOTE: The specified degree of protection IP54 can only be achieved with properly trimmed cable bushings.

- ► (A) Strip the jacket of all cables; length 70 mm.
- ▶ (B) Shorten the shield to a rest of 10 mm.
- ▶ (C) Slide the shield braiding back over the cable jacket.
- ▶ (D) Loosen the strain relief.
- ▶ Push the cables though the strain relief.
- ▶ Glue EMC shielding foil around the shield.
- Pull the cable back to the strain relief.
- Fasten the strain relief.

Mounting connectors

The table below lists the parts and data required for assembly. Connector housings and crimp contacts are included in the accessories kit. See also chapter 11 "Accessories and spare parts".



Only use the special tool listed in the Accessories chapter to release single crimp contacts from the connector housing.

Connection	Conductor cross section of the crimp contact [mm²]	Stripping length [mm]	Manufacturer's crimp contact no.	Crimping tool	Connector manufacturer	Connector type
CN1	0.75 1.5 (AWG 18 16) 2.5 4.0 (AWG 12)	5 65 6	160773-6 341001-6	654174-1	Tyco Electronics	Positive Lock 1-926 522-1
CN2	0.14 0.6 (AWG 24 20)	2.5 3.0	43030-0007	69008-0982	Molex	Micro-Fit 3.0 43025-1200
CN3	0.25 1.0 (AWG 24 18)	3.0 3.5	39-00-0060	69008-0724	Molex	Mini-Fit Jr. 39-01-2065
CN4	0.14 0.6 (AWG 24 20)	2.5 3.0	43030-0007	69008-0982	Molex	Micro-Fit 3.0 43025-0600
CN5	0.14 0.6 (AWG 24 20)	2.5 3.0	43030-0007	69008-0982	Molex	Micro-Fit 3.0 43645-0200

Prepare the cable for connection as follows:

- ▶ Strip the ends of the cable.
- ▶ Attach cable lugs and crimp contacts. Verify that you have the correct crimp contacts and the matching crimping tool.
- ▶ Slide the cable lugs and crimp contacts straight into the connector until they snap in place.

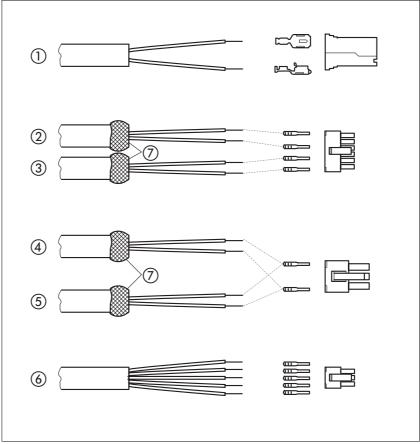


Figure 6.4 Connectors, cable lugs and crimp contacts

- (1) Supply voltage VDC
- (2) Fieldbus IN for PROFIBUS DP
- (3) Fieldbus OUT for PROFIBUS DP
- (4) Fieldbus IN for CAN or RS485
- (5) Fieldbus OUT for CAN or RS485
- (6) 24 V signal interface
- (7) Shield wire with EMC shield foil

Mounting the cable entry

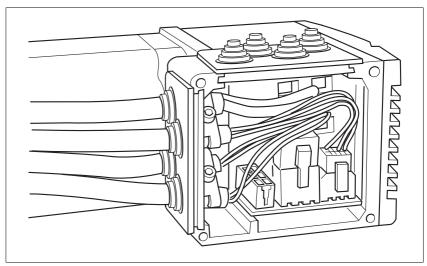


Figure 6.5 Inserting the cable entries

▶ Unscrew the connector housing cover.

NOTE: Shipping locks made of cardboard must not be used for operating the drive. Replace all shipping locks by cable entries or signal inserts.

► First adjust the parameter switches as these are difficult to access once the cables are connected.

 
For a description of the parameter switches, see the chapters describing the connections.

► Connect the plug of the assembled cable to the matching socket. The plugs cannot be turned out of position and must click into place when being plugged in.

Only pull the connector housing (not the cable).

▶ Plug the cable entry in one of the two cutouts provided. The side to be used for the cable entry depends on the space available in your system.

NOTE: The pointed corners of the cable entry must point in the direction of the connector housing cover. Degree of protection IP54 is not reached if the cable entry is mounted the other way round.



- ► Close the cutout that is not used with a sealing insert for cutouts.
- ► Finally, screw the connector housing cover back into place. If screws are lost use M3x12 only.

6.3.4 Connection with industrial connectors

Interface	Connector used
Supply voltage VDC	Hirschmann STASEI 200
Fieldbus PROFIBUS DP in/out	Circular connector M12, 5 poles, B-coded
Fieldbus CAN in/out	Circular connector M12 , 5 poles, A-coded
24V signal inputs and outputs	Circular connector M8, 3 poles
Safety function STO "Safe Torque Off" (IEC/EN 61800- 5-2)	Circular connector M8, 4 poles

Because the requirements are different depending on the system configuration, pre-assembled cables specially designed for Ethernet field-bus connections can be procured from various suppliers.

Information on pre-assembled cables, connector kits and recommended suppliers can be found in chapter 11 "Accessories and spare parts".

6.3.5 Connection of VDC supply voltage

DANGER

ELECTRIC SHOCK CAUSED BY INCORRECT POWER SUPPLY UNIT

The VDC and +24VDC supply voltages are connected with many exposed signal connections in the drive system.

- Use a power supply unit that meets the PELV (Protective Extra Low Voltage) requirements.
- Connect the negative output of the power supply unit to PE (ground).

Failure to follow these instructions will result in death or serious injury.

A CAUTION

LOSS OF CONTROL DUE TO REGENERATION CONDITION

Regeneration conditions resulting from braking or external driving forces may increase the \mathtt{VDC} supply voltage to an unexpected level. Components not rated for this voltage may be destroyed or cause misoperation.

- Verify that all VDC consumers are rated for the voltage occurring during regeneration conditions (for example limit switches).
- Use only power supply units that will not be damaged by regeneration conditions.
- Use a braking resistor controller, if necessary.

Failure to follow these instructions can result in injury or equipment damage.

CAUTION

DAMAGE TO CONTACTS

The connection for the controller supply voltage at the product does not have an inrush current limitation. If the voltage is switched on by means of switching of contacts, damage to the contacts or contact welding may result.

- Use a power supply unit that limits the peak value of the output current to a value permissible for the contact.
- Switch the power input of the power supply unit instead of the output voltage.

Failure to follow these instructions can result in equipment damage.

A CAUTION

DAMAGE TO SYSTEM COMPONENTS AND LOSS OF CONTROL

Interruptions of the negative connection of the controller supply voltage can cause excessively high voltages at the signal connections.

- Do not interrupt the negative connection between the power supply unit and load with a fuse or switch.
- Verify correct connection before switching on.
- Do not connect the controller supply voltage or change its wiring while the is supply voltage present.

Failure to follow these instructions can result in injury or equipment damage.

Cable specifications and terminal

Two different crimp contacts are available for different conductor cross sections, see chapter 6.3.3 "Connection via cable entry".

Minimum conductor cross section	[mm ²]	0.75 (AWG 18)
Maximum connection cross section	[mm ²]	4.0 (AWG 12)
Stripping length	[mm]	5 65 6

Crimp contact 1607736-6 Minimum connection cross section Maximum connection cross section	[mm ²]	0.75 (AWG 18) 1.5 (AWG 16)
Crimp contact 341001-6 Minimum connection cross section Maximum connection cross section	[mm ²]	2.5 (AWG 12) 4.0 (AWG 12)

Unshielded cables may be used for the \mathtt{VDC} supply voltage. Twisted pair is not required.

- Use pre-assembled cables to reduce the risk of wiring errors.
- Verify that wiring, cables and connected interfaces meet the PELV requirements.

Connecting the cables

- ▶ Note the specified technical data.
- ▶ Note the information provided in chapters 5.1 "External power supply units" and 5.2 "Ground design".
- ▶ Install fuses for the power supply cable accordance with the selected conductor cross section / wire gauge (note the inrush currents).

Pin assignment printed circuit board connector

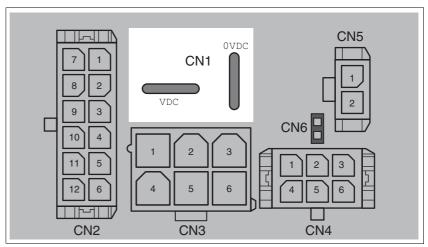


Figure 6.6 Pin assignment supply voltage

Signal	Meaning	Number ¹⁾
VDC	Supply voltage	1
OVDC	Reference potential to VDC	2

¹⁾ Information relates to pre-assembled cables

You can crimp together two wires to supply multiple drives via one DC bus. Two different crimp contacts are available for different conductor cross sections, see chapter 6.3.3 "Connection via cable entry".

Pin assignment industrial connector

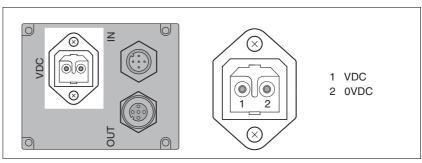


Figure 6.7 Pin assignment supply voltage

Pin	Signal	Meaning	Number ¹⁾
1	VDC	Supply voltage	1
2	OVDC	Reference potential to VDC	2

¹⁾ Information relates to pre-assembled cables

6.3.6 PROFIBUS DP connection

Function

The PROFIBUS DP interface allows you to network the product as a slave in a Profibus network.

The drive system receives data and commands from a master bus device. Status information such as operating state and processing state is sent to the master as acknowledgement.

The fieldbus manual for the product provides detailed description on fieldbus networking.

Cable specifications and terminal

- Shielded cable
- Twisted-pair cables
- · Grounding of the shield at both ends

Maximum cable length	[m]	See next table
Minimum conductor cross section	[mm ²]	0.34 (AWG 24)
Maximum connection cross section	[mm ²]	0.6 (AWG 20)
Stripping length	[mm]	2.5 3.0

The maximum cable length depends on the baud rate and the signal propagation delay. The higher the baud rate, the shorter the bus cable needs to be.

Baud rate [kBaud]	Max. cable length [m]
9.6	1200
19.2	1200
45.45	1200
93.75	1200
187.5	1000
500	400
1500	200
3000	100
6000	100
12000	100

- ▶ Use equipotential bonding conductors, see page 47.
- ▶ Use pre-assembled cables to reduce the risk of wiring errors.
- Verify that wiring, cables and connected interfaces meet the PELV requirements.

Terminating resistor

Both ends of the entire bus system must be terminated with a terminating resistor.

The terminating resistor is already integrated and can be activated at the end of the network with a switch.

The diagram below shows the integrated terminating resistor.

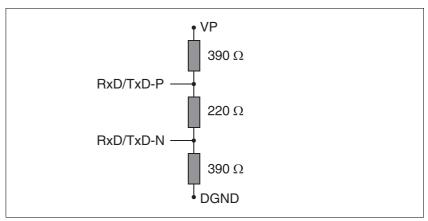


Figure 6.8 Terminating resistor

Setting address and baud rate

Every device on the network is identified by a unique, adjustable node address. Slaves on a Profibus network may have addresses in the range from 3 to 126. Addresses 0 to 2 are reserved for master devices.

The baud rate is detected automatically.

Factory settings:

• Address: 126

Terminating resistor: OFF

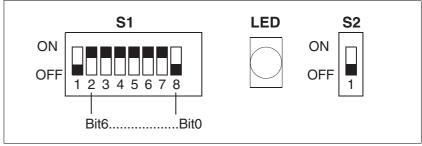


Figure 6.9 Parameter switch

Switch setting S1:	S1.2	S1.3	S1.4	S1.5	S1.6	S1.7	S1.8
Address bit:	6	5	4	3	2	1	0
Fieldbus address 126 (default)	1	1	1	1	1	1	0
Fieldbus address 25 (example)	0	0	1	1	0	0	1

Switch setting S2:	S2.1
Terminating resistor on	ON
Terminating resistor off	OFF

LED	Communication indicator
LED on	Communication OK
LED off	No communication

Reserved parameter switches are provided for future extensions and must be set to OFF.

NOTE: Each device must have its own unique node address, which may only be assigned once in the network.

Pin assignment printed circuit board connector

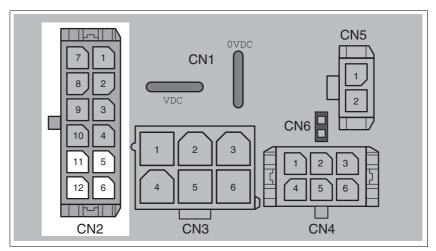


Figure 6.10 Pin assignment of Profibus fieldbus interface

Pin	Signal	Meaning (Color ¹⁾)	SUB-D 1)
12	RxD/TxD-N	Profibus interface (green) IN	8
11	RxD/TxD-P	Profibus interface (red) IN	3
6	RxD/TxD-N	Profibus interface (green) OUT	8
5	RxD/TxD-P	Profibus interface (red) OUT	3

¹⁾ Information refers to pre-assembled cables

Pin assignment industrial connector

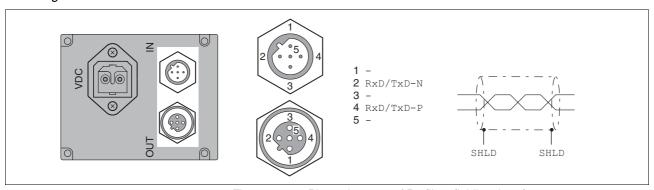


Figure 6.11 Pin assignment of Profibus fieldbus interface

Pin	Signal	Meaning
2	RxD/TxD-N	Profibus interface
4	RxD/TxD-P	Profibus interface
5		Internally connected to housing

The shield of the cable (SHLD) must be connected to the connector housing.

6.3.7 CAN connection

Function

The CAN interface allows you to network the product as a slave in a CANopen network as per DS301.

The drive system receives data and commands from a master bus device. Status information such as operating state and processing state is sent to the master as acknowledgement.

The fieldbus manual for the product provides detailed description on fieldbus networking.

Cable specifications and terminal

- Shielded cable
- Twisted-pair cables
- · Grounding of the shield at both ends

Maximum cable length	[m]	See next table
Minimum conductor cross section	[mm ²]	0.25 (AWG 22)
Maximum connection cross section	[mm ²]	1.0 (AWG 18)
Stripping length	[mm]	3.0 3.5

The maximum cable length depends on the number of network devices, the baud rate and the signal propagation delay. The higher the baud rate, the shorter the bus cable needs to be.

Baud rate [kBaud]	Max. cable length [m]
1000	25
800	80
500	100
250	250
100	600
50	1000

- ▶ Use equipotential bonding conductors, see page 47.
- ▶ Use pre-assembled cables to reduce the risk of wiring errors.
- Verify that wiring, cables and connected interfaces meet the PELV requirements.

Terminating resistor

Both ends of the entire bus system must be terminated with a terminating resistor.

The terminating resistor is already integrated and can be activated at the end of the network with a switch.

Fieldbus	Terminating resistor	
CAN-Bus	120 Ω between CAN_H and CAN_L	

Setting address and baud rate

Every device on the network is identified by a unique, adjustable node address.

Factory settings:

• Address: 127

• Baud rate: 125 kBaud

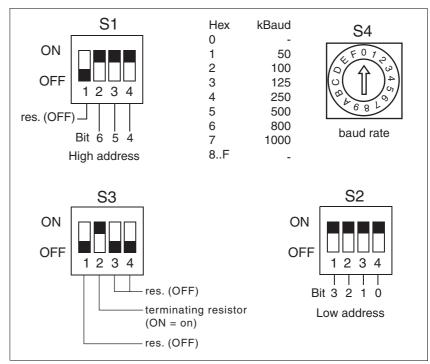


Figure 6.12 Parameter switch

Switch settings S1 and S2:	S1.2	S1.3	S1.4	S2.1	S2.2	S2.3	S2.4
Address bit:	6	5	4	3	2	1	0
Fieldbus address 127 (default)	1	1	1	1	1	1	1
Fieldbus address 25 (example)	0	0	1	1	0	0	1

Switch setting S4	Baud rate (Kbaud)	
1	50	
2	100	
3	125	
4	250	
5	500	
6	800	
7	1000	

Reserved parameter switches are provided for future extensions and must be set to OFF.

NOTE: Each device must have its own unique node address, which may only be assigned once in the network.

Pin assignment printed circuit board connector

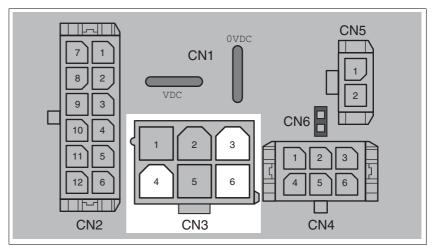


Figure 6.13 Pin assignment of CAN fieldbus interface

Pin	Signal	Meaning	SUB-D 1)
3	CAN_H	CAN interface	7
6	CAN_L	CAN interface	2
4	CAN_0V	Internally connected to CN1.0VDC	3

¹⁾ Information relates to pre-assembled cables

Pin assignment industrial connector

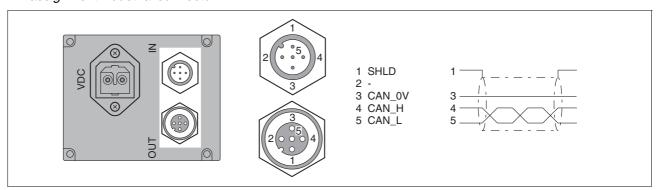


Figure 6.14 Pin assignment of CAN fieldbus interface

Pin	Signal	Meaning
1	SHLD	Shield connection
2	-	internally bridged from IN to OUT
3	CAN_0V	Internally connected to CN1.0VDC
4	CAN_H	CAN interface
5	CAN_L	CAN interface

6.3.8 RS485 connection

Function

The drive system is commissioned via the RS485 interface and the commissioning software.

In addition, the RS485 interface allows you to network the product as a slave in an RS485 network.

The fieldbus manual for the product provides detailed description on fieldbus networking.

Cable specifications and terminal

- · Shielded cable
- Twisted-pair cables
- Grounding of the shield at both ends

Maximum cable length	[m]	400
Minimum conductor cross section	[mm ²]	0.25 (AWG 22)
Maximum connection cross section	[mm ²]	1.0 (AWG 18)
Stripping length	[mm]	3.0 3.5

- ▶ Use equipotential bonding conductors, see page 47.
- ▶ Use pre-assembled cables to reduce the risk of wiring errors.
- Verify that wiring, cables and connected interfaces meet the PELV requirements.

Terminating resistor

Both ends of the entire bus system must be terminated with a terminating resistor.

The terminating resistor is already integrated and can be activated at the end of the network with a switch.

Fieldbus	Terminating resistor	
RS485 bus	120 Ω between +RS485 and -RS485	

Setting address and baud rate

Each device on the network is identified by a unique, adjustable node address.

Factory settings:

Address: 1

Baud rate: 9600

Data format: 7 bits
 Even parity
 1 stop bit

In the case of devices with CAN or Profibus fieldbus interfaces, the address and the baud rate of the RS485 interface are set via the commissioning software.

In the case of devices without CAN or Profibus fieldbus interfaces, the address and the baud rate of the RS485 interface are set via parameter switches.

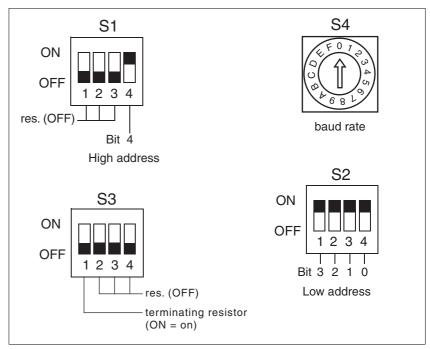


Figure 6.15 Parameter switch

Switch settings S1 and S2:	S1.4	S2.1	S2.2	S2.3	S2.4
Address bit:	4	3	2	1	0
Address 1 (Default)	0	0	0	0	1
Address 25 (example)	1	1	0	0	1

Switch setting S4	Baud rate (Kbaud)	Format
0	9600	7-E-1
1	19200	7-E-1
2	38400	7-E-1
3	-	-
4	9600	7-N-1
5	19200	7-N-1
6	38400	7-N-1
7	-	-
8	9600	8-E-1
9	19200	8-E-1
A	38400	8-E-1
В	-	-
С	9600	8-N-1
D	19200	8-N-1
E	38400	8-N-1
F	-	-

Reserved parameter switches are provided for future extensions and must be set to OFF.

NOTE: Each device must have its own unique node address, which may only be assigned once in the network.

Pin assignment printed circuit board connector

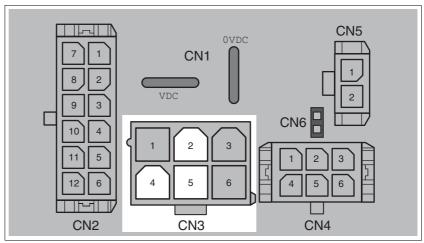


Figure 6.16 Pin assignment RS485

Pin	Signal	Meaning	SUB-D 1)
2	+RS485	RS485 interface	7
5	-RS485	RS485 interface	2
4	RS485_0V	Internally connected to CN1.0VDC	3

¹⁾ Information relates to pre-assembled cables

Pin assignment industrial connector

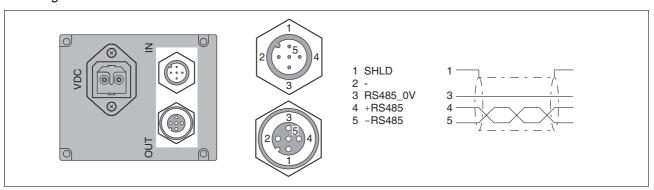


Figure 6.17 Pin assignment of the RS485 fieldbus interface

Pin	Signal	Meaning	
1	SHLD	Shield connection	
2	-	Not assigned	
3	RS485_0V	Internally connected to CN1.0VDC	
4	+RS485	RS485 interface	
5	-RS485	RS485 interface	

6.3.9 24V signal interface connection

24V signal power supply

The 24V signal power supply provided for constant supply of the sensor system.

It must not be connected in parallel with the 24V signal power supply of a different drive.

Cable specifications and terminal

Minimum conductor cross section	[mm ²]	0.2 (AWG 24)
Maximum connection cross section	[mm ²]	0.6 (AWG 20)
Stripping length	[mm]	2.5 3.0

- ▶ Use pre-assembled cables to reduce the risk of wiring errors.
- Verify that wiring, cables and connected interfaces meet the PELV requirements.

parameterization

The 24V signals can be configured with the parameters IO.IO0_def, 34:1 to IO.IO3_def, 34:4 as either input or output. Specific functions can also be assigned.

Function	Possible for signal	Remarks
Positive limit switch	IO0	Logic level can be configured
Negative limit switch	IO1	Logic level can be configured
STOP switch	IO03	Logic level can be configured
Reference switch	IO03	For reference movement to REF, level can be configured
Freely usable	IO03	Free access via fieldbus
Programmable	IO03	see chapter 8.3.4 "Programmable inputs and outputs"



The external monitoring signals $\overline{\text{LIMP}}$, $\overline{\text{LIMN}}$, $\overline{\text{REF}}$ and STOP are enabled with the parameter Settings.SignEnabl, 28:13.

Use active 0 monitoring signals if possible, because they are failsafe. Evaluation for active 0 or 1 is set with the parameter Settings.SignLevel, 28:14.

For more information see chapter 7 "Commissioning".

Pin assignment printed circuit board connector

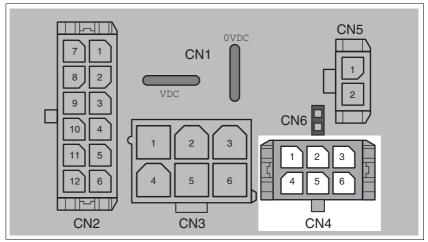


Figure 6.18 Pin assignment of the 24V signal interface

Pin	Signal	Meaning	I/O
1	+24VDC_OUT	The 24V signal supply may be used to supply the sensor system (e.g. limit switches)	0
2	102	Freely usable input / output	I/O
3	100	Freely usable input / output	I/O
4	0VDC	Internally connected to CN1.0VDC	
5	103	Freely usable input / output	I/O
6	101	Freely usable input / output	I/O

6.3.10 Connection of STO safety function

A WARNING

LOSS OF SAFETY FUNCTION

Incorrect usage may cause a hazard due to the loss of the safety function.

• Observe the requirements for using the safety function.

Failure to follow these instructions can result in death or serious injury.

Requirements

For information and requirements relating to the STO safety function, see chapter 5.3 "Safety function STO ("Safe Torque Off")".

Cable specifications and terminal

 Shielded cable corresponding to the requirements for protected layout of wires

Minimum conductor cross section	[mm ²]	0.34 (AWG 20)
Maximum connection cross section	[mm ²]	0.6 (AWG 20)
Stripping length	[mm]	2.5 3.0

- Use equipotential bonding conductors, see page 47.
- ▶ Use pre-assembled cables to reduce the risk of wiring errors.
- Verify that wiring, cables and connected interfaces meet the PELV requirements.

The cable available as an accessory is a special cable that is only available with a connector. The shield of the cable is connected to the grounded housing of the drive via the metal connector. It is sufficient to connect one end of the cable to the grounded housing.

Pin assignment printed circuit board connector


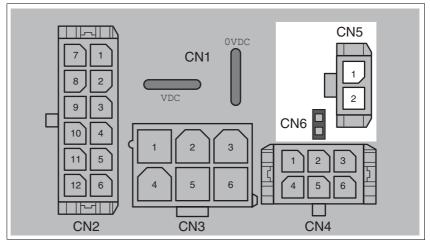


Figure 6.19 Pin assignment of safety function

Pin	Signal	Meaning
CN5.1	STO_A (PWRR_A)	Safety function STO "Safe Torque Off" (IEC/EN 61800-5-2)
CN5.2	STO_B (PWRR_B)	Safety function STO "Safe Torque Off" (IEC/EN 61800-5-2)
CN6		Jumper plugged in: STO disabled Jumper removed: STO enabled

NOTE: Jumper CN5 cannot be plugged in as long as jumper CN6 is still plugged in (mechanical lock).

Connecting the safety function

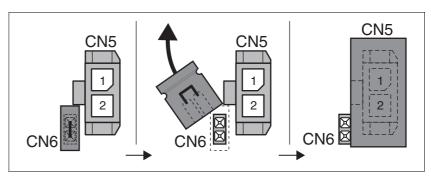

- ► Remove jumper CN6.
- Connect the connector to CN5.

6.4 Connection accessories

6.4.1 Accessory "Insert kit, 3x I/O"

The accessory makes the signals 100, 101 and 103 available outside of the device via industrial connectors.

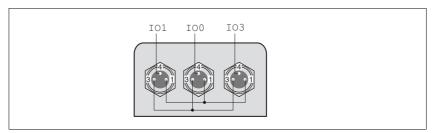


Figure 6.20 Pin assignment

Pin 1 is internally connected to CN4.1 (+24VDC_OUT).

Pin 3 is internally connected to CN4.4 (OVDC).

6.4.2 Accessory "Insert kit, 2x I/O, 1x STO in"

The accessory makes the signals IO0, IO1 and the signals of the STO safety function available outside of the device via industrial connectors.

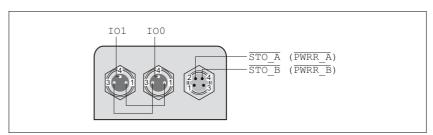


Figure 6.21 Pin assignment

Pin 1 is internally connected to CN4.1 (+24VDC_OUT).

Pin 3 is internally connected to CN4.4 (0VDC).

6.4.3 Accessory "Insert kit, 1x STO in, 1x STO out"

The accessory makes the signals of the STO safety function available outside of the device via industrial connectors.

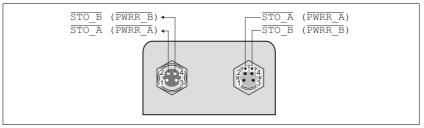


Figure 6.22 Pin assignment

6.4.4 Accessory "Insert kit, 4x I/O, 1x STO in, 1x STO out"

The accessory makes the signals 100, 101, 102 and 103 and the signals of the STO safety function available outside of the device via industrial connectors.

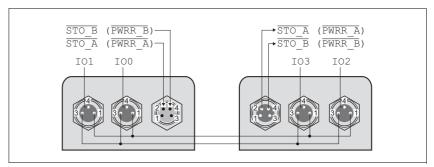


Figure 6.23 Pin assignment

Pin 1 is internally connected to CN4.1 (+24VDC_OUT).

Pin 3 is internally connected to CN4.4 (0VDC).

6.5 Checking wiring

Check the following:

- ▶ Did you properly install and connect all cables and connectors?
- ► Are there any live, exposed cables?
- ▶ Did you properly connect the signal wires?
- ▶ Did you properly install all seals (degree of protection IP54)?

7 Commissioning

A WARNING

UNEXPECTED MOVEMENT

When the drive is operated for the first time, there is a risk of unexpected movements caused by possible wiring errors or unsuitable parameters.

- · Perform the first test run without coupled loads.
- Verify that a functioning button for EMERGENCY STOP is within reach.
- Anticipate movements in the incorrect direction or oscillation of the drive.
- Only start the system if there are no persons or obstructions in the hazardous area.

Failure to follow these instructions can result in death, serious injury or equipment damage.

A WARNING

UNINTENDED BEHAVIOR

The behavior of the drive system is governed by numerous stored data or settings. Unsuitable settings or data may trigger unexpected movements or responses to signals and disable monitoring functions.

- Do NOT operate the drive system with unknown settings or data.
- Verify that the stored data and settings are correct.
- When commissioning, carefully run tests for all operating states and potential fault situations.
- Verify the functions after replacing the product and also after making changes to the settings or data.
- Only start the system if there are no persons or obstructions in the hazardous area.

Failure to follow these instructions can result in death, serious injury or equipment damage.

A WARNING

ROTATING PARTS

Rotating parts may cause injuries and may catch clothing or hair. Loose parts or parts that are unbalanced may be flung.

- Verify correct mounting and installation of all rotating parts.
- Use a cover to help protect against rotating parts.

Failure to follow these instructions can result in death, serious injury or equipment damage.

▲ WARNING

MOTOR WITHOUT BRAKING EFFECT

If power outage and faults cause the power stage to be switched off, the motor is no longer stopped by the brake and may increase its speed even more until it reaches a mechanical stop.

- · Verify the mechanical situation.
- If necessary, use a cushioned mechanical stop or a suitable brake.

Failure to follow these instructions can result in death, serious injury or equipment damage.

WARNING

FALLING PARTS

The motor may move as a result of the reaction torque; it may yyyyy tip and fall.

 Mount the motor securely so it will not break loose during strong acceleration.

Failure to follow these instructions can result in death, serious injury or equipment damage.

▲ CAUTION

HOT SURFACES

Depending on the operation, the surface may heat up to more than 100°C (212°F).

- Do not allow contact with the hot surfaces.
- Do not allow flammable or heat-sensitive parts in the immediate vicinity.
- Consider the measures for heat dissipation described.
- · Check the temperature during test runs.

Failure to follow these instructions can result in injury or equipment damage.

7.1 Preparing for commissioning

The following tests are required before commissioning:

- ▶ Wiring and connection of all cables and system components
- ► Function of the limit switch, if installed

One of the following must be available:

- Fieldbus master (e.g. PLC) or industrial PC
- Commissioning software

7.2 Running commissioning

7.2.1 First setup



Prepare a list with the parameters required for the functions used.

Direction of rotation

Rotation of the motor shaft in a clockwise or counterclockwise direction of rotation. Clockwise rotation is when the motor shaft rotates clockwise as you look at the end of the protruding motor shaft.

The direction of rotation can be reversed with the parameter Motion.invertDir 28:6.

The new value is only activated when the drive is switched on.

- ► Save the parameter to the EEPROM
- Switch the supply voltage off and on.



If you invert the direction of rotation, verify once again that the limit switches are properly wired.

- Connect the positive limit switch to IO0
- Connect the negative limit switch to IO1



The positive limit switch is the switch that is tripped by the mechanical system if the motor shaft rotates as follows:

- Without inversion of the direction of rotation: Clockwise
- Without inversion of the direction of rotation: Counter-clockwise

Reference speed

The reference speed for the motor depends on the application requirements.

► Set the reference speed with the parameter Motion.v_target0 29:23.

Acceleration/deceleration

Note that when the drive decelerates, it recovers energy from the system and the voltage may increase depending on the external torque and the deceleration value set.

The drive has two acceleration settings:

- Acceleration/deceleration
 Parameter Motion.acc, 29:26
- Deceleration for "Quick Stop" Parameter Motion.dec_Stop, 28:21

Homing the drive

As long as the drive has not yet been referenced, absolute positioning is not possible in the operating mode Profile Position. However, all other operating modes can be used even if the drive has not been referenced. You can use the function Position Setting or run a reference movement to home the drive, see chapter 8.2.4 "Operating mode Homing".

Setting the current limitation

The motor controller limits the maximum current and, by implication, the maximum torque of the drive to an adjustable configurable value. The maximum possible value depends on the combination of drive power stage, motor and gearbox.

Parameter:

- Read value: Nominal current of drive Config.I_nomDrv, 15:1
- Read value: Maximum current of drive Config.I_maxDrv, 15:2
- User-defined maximum current for normal operation Settings.I_max, 15:3
- User-defined maximum current for Stop via torque ramp Settings.I_maxStop, 15:4

Current limitation is also controlled by I²t monitoring; this type of monitoring is described in chapter 8.1.4 "Internal monitoring signals".

Tuning the controllers

The drive has an encoder and operates as a "closed loop" system. The controller is a classic cascade controller with current, speed and positioning loops.

The controller parameters are factory-set and do not need to be modified for most applications.

- Speed controller P term Control.KPn, 15:8
- Speed controller integral action time Control.TNn, 15:9
- Position controller P term Control.KPp, 15:10
- Speed feed-forward control position controller Control.KFPp, 15:11

7.2.2 Starting 24V signal interface

7.2.2.1 Setting the functions of the 24V signals

You can configure the 24V signals as input or output with the parameters $IO.IOO_def~34:1$ to $IO.IO3_def~34:4$ and assign specific functions to the 24V signals.

For more information see chapter 6 "Installation".

7.2.2.2 Testing 24V signals

The following table shows the readable and writable status of the 24V signals and the possible parameter settings.

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
I/O.IO_act	Status of digital inputs and outputs	UINT16 015	-	R/W
33:1 (21:01 _h)	Assignment of bits: Bit 0: IO0 Bit 1: IO1 Bit 2: IO2 Bit 3: IO3 Bit 4: STO_A (PWRR_A) Bit 5: STO_B (PWRR_B) Reading returns the status of the inputs and outputs. Writing only changes the status of outputs.	015	0	
I/O.IO0_def 34:1 (22:01 _h)	Configuration of IO0 Value 0: Input freely usable Value 1: Input LIMP (only with IO0) Value 2: Input LIMN (only with IO1) Value 3: Input STOP Value 4: Input REF Value 5: Input programmable Value 128: Output freely usable Value 130: Output programmable	UINT16 0255	- 1	R/W per.
I/O.IO1_def	Configuration of IO1	UINT16	-	R/W
34:2 (22:02 _h)	See parameter IO0_def	0255	2	per.
I/O.IO2_def	Configuration of IO2	UINT16	-	R/W
34:3 (22:03 _h)	See parameter IO0_def	0255	3	per.
I/O.IO3_def	Configuration of IO3	UINT16	-	R/W
34:4 (22:04 _h)	See parameter IO0_def	0255	4	per.

Testing the signal inputs and limit switches

Proceed as follows for testing:

► Trigger the limit switch or the sensor manually.

The corresponding bit in parameter IO.IO_act 33:1 must be 1 as long as the input is logic 1.

Checking the freely usable signal outputs

Proceed as follows for testing:

- ► Write the value required to set the associated output to logic 1 to parameter IO.IO_act 33:1.
- ► Measure the voltage at the output or check the response of the connected actuator.

7.2.2.3 Testing the function of limit switches



Monitoring of the $\overline{\text{LIMP}}/\overline{\text{LIMN}}$ limit switches is activated in the factory settings. In all drives without limit switches, monitoring must be disabled with the parameter Settings.SignEnabl, 23:13, value = 0. The factory setting for the STOP input is "disabled".

Condition: The limit switch signals are monitored.

For more information see chapter 7.2.2.2 "Testing 24V signals".

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
Settings.SignEnabl 28:13 (1C:0D _h)	Activation of monitoring inputs	UINT16	-	R/W
	Bit value 0: Monitoring is not active Bit value 1: Monitoring is active	015	3	per.
	Assignment of bits: Bit 0: LIMP (positive limit switch) Bit 1: LIMN (negative limit switch) Bit 2: STOP (STOP switch) Bit 3: REF (reference switch)			
	NOTE: Monitoring is only active if the I/O port is configured as the corresponding function (parameter I/O.IOO_def to IO3_def).			
Settings.SignLevel 28:14 (1C:0E _h)	Signal level for monitoring inputs	UINT16	-	R/W
	Used to define whether errors are triggered at 0 or 1 level.	015	0	per.
	Bit value 0: Response at 0 level Bit value 1: Response at 1 level			
	Assignment of bits: Bit 0: LIMP Bit 1: LIMN Bit 2: STOP Bit 3: REF			
Status.Sign_SR	Stored signal status of external monitoring signals	UINT16 015	-	R/-
28:15 (1C:0F _h)	Bit value 0: not activated Bit value 1: activated			
	Assignment of bits: Bit 0: LIMP Bit 1: LIMN Bit 2: STOP Bit 3: REF Bit 7: SW stop			
	Stored signal status of released external monitoring signals			

You can change enabling of the external monitoring signals $\overline{\text{LIMP}}$, $\overline{\text{LIMN}}$ and STOP with the parameter Settings. SignEnabl 28:13; use the parameter Settings. SignLevel 28:14 to change evaluation for active LOW or HIGH.

- ► Connect the limit switch that limits the working range for clockwise rotation to LIMP.
- ► Connect the limit switch that limits the working range for counterclockwise rotation to LIMN.
- ► Verify the function of the limit switches with the parameter Status.Sign_SR 28:15.
- ► Enable the power stage.
- ► Run a "Fault Reset".

After that, no bit may be set in parameter Status.Sign_SR 28:15.

- ▶ Briefly actuate the limit switch manually.
 - After that, the corresponding bit must be set in parameter Status.Sign_SR 28:15.
- ► Run a "Fault Reset".

After that, no bit may be set in parameter Status.Sign_SR 28:15.

7.2.3 Testing safety functions

Operation with STO

If you wish to use the STO safety function, carry out the following steps. Perform the steps exactly in the sequence described.

- Supply voltage switched off.
- ▶ Verify that the inputs STO_A (PWRR_A) and STO_B (PWRR_B) are electrically isolated from each other. The two signals must not be electrically connected.
- Supply voltage switched on.
- ► Enable the power stage.

(Parameter Commands.driveCtrl, 28:1 bit 1)

- ► Trigger the safety function. STO_A (PWRR_A) and STO_B (PWRR_B) must be switched off simultaneously (time offset <1s).
- □ The power stage is disabled and error message 0119_h is generated. (NOTE: Error message 011A_h indicates a wiring error.)

 (Parameter Status.StopFault, 32:7)
- ► Check the behavior of the drive during fault conditions.
- Document all tests of the safety function in your acceptance certificate

Operation without STO

If you do not want to use the STO safety function:

▶ Verify that jumper CN6 is connected.

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
Commands.driveCtrl 28:1 (1C:01 _h)	Control word Assignment of bits: Bit 0: Disable power stage Bit 1: Enable power stage Bit 2: Quicktop Bit 3: FaultReset Bit 4: QuickStop-Release Bits 515: Reserved Default bits 0 4: 0 A write access automatically triggers processing of the oper ating states.	UINT16 031	- 0	R/W

7.2.4 Testing with relative positioning

Positioning can be tested by means of relative positioning in "Profile Position" operating mode.

A WARNING

UNINTENDED OPERATION

- Note that any changes to the values of these parameters are executed by the drive controller immediately on receipt of the data set.
- Verify that the system is free and ready for movement before changing these parameters.

Failure to follow these instructions can result in death, serious injury or equipment damage.



All speed and position values listed below relate to the motor drive shaft (without gearbox).

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
Commands.driveCtrl 28:1 (1C:01 _h)	Control word Assignment of bits: Bit 0: Disable power stage Bit 1: Enable power stage Bit 2: Quicktop Bit 3: FaultReset Bit 4: QuickStop-Release Bits 515: Reserved Default bits 0 4: 0 A write access automatically triggers processing of the operating states.	UINT16 031	- 0	R/W
PTP.p_relPTP 35:3 (23:03 _h)	Target position for relative positioning and start of positioning Action object: write access triggers relative positioning in increments	INT32	Inc -	R/W
PTP.v_tarPTP 35:5 (23:05 _h)	Target speed of rotation for positioning Positioning can be temporarily stopped with value 0. The default value is the value of parameter Motion.v_target0. The minimum speed of rotation is 300 min ⁻¹ .	UINT16 05000	min ⁻¹ 1000	R/W

Performing the test run

To perform the test run, proceed as described below.

- ► Enable the power stage.
 - (Parameter Commands.driveCtrl 28:1 Bit 1)
- ► Set the target speed, e.g. 600 min⁻¹.

(Parameter PTP.v_tarPTP 35:5)

► Start relative positioning, e.g. by 1000 increments.

(Parameter PTP.v_relPTP 35:3)

▶ Verify the function of the limit switches at a low speed.

7.2.5 Optimizing the motor behavior

Setting the slope of the ramps

► Enter the slopes of the ramp function in the parameter Motion.acc, 29:26. The following formulas can be used to estimate the values for input:

Moment of acceleration
$$\leq \frac{30 \alpha}{\pi}$$

$$\alpha = \frac{M_{M} - M_{L}}{J_{total}}$$

Physical value/ nominal value	Meaning	Unit
M_{M}	Available torque of motor	Nm
M _L	Load torque	Nm
J _{total}	Mass moment of inertia	kgm ²
α	Angular acceleration	rad/sec ²
Motion.acc	Acceleration parameters	min ⁻¹ /s

Reference speed

The reference speed for the motor depends on the application requirements.

► Set the reference speed with the parameter Motion.v_target0 29:23.

Torque characteristic of the motor

The available torque of the motor depends on the following factors:

- Size
- Speed
- Supply voltage (the dependency starts at a specific speed of rotation at which the torque decreases drastically)

See the characteristic curve of the motor in the catalog for the dependency of the torque on the speed.

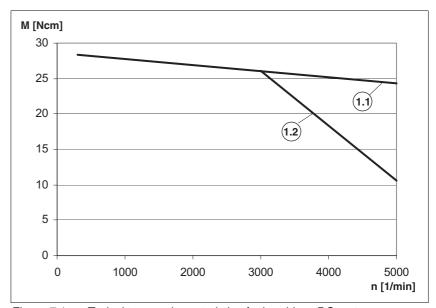


Figure 7.1 Typical torque characteristic of a brushless DC motor

- (1.1) 36V
- (1.2) 24V

At a specific speed of rotation the available torque decreases drastically with increasing speeds. The available acceleration is reduced correspondingly.

7.3 Lexium CT commissioning software

The commissioning software has a graphic user interface and is used for commissioning, diagnostics and testing settings.

Source commissioning software

The latest version of the commissioning software is available for download from the internet:

http://www.schneider-electric.com

Functions of the commissioning software

The functions of the commissioning software include:

- Scan various fieldbuses for devices
- Extensive information on connected devices
- Display and enter device parameters
- · Archive and duplicate device parameters
- · Manual positioning of the motor
- · Test input and output signals
- Record, evaluate and archive motion and signals
- · Error diagnostics
- Optimize control behavior (servo motors only)

System requirements

The minimum hardware requirements for installation and operation of the software are:

- IBM-compatible PC
- Approx. 200 MB of hard disk space
- 512 MB RAM
- Graphics card and monitor with a resolution of at least 1024x768 pixels
- · Free serial interface (RS232) or free USB interface
- Operating system Windows 2000, Windows XP Professional or Windows Vista
- · Acrobat Reader 5.0 or newer
- Internet connection (for initial installation and updates)

Online help

The commissioning software offers comprehensive help functions, which can be accessed via "? - Help Topics" or by pressing the F1 key.

Interface	PC interface	Required fieldbus converter	Source
RS485	USB	NuDAM ND-6530	http://www.acceed.com
RS485	RS232	NuDAM ND-6520	http://www.acceed.com
CAN	USB	PCAN-USB, Peak	http://www.peak-system.com
CAN	parallel	PCAN-Dongle, Peak	http://www.peak-system.com
PROFIBUS DP	USB	PROFlusb PB-USB	http://www.softing.com
Profibus-DP	PCMCIA	Siemens CP5511/12	http://www.ad.siemens.com
Profibus-DP	PCI	Siemens CP5611/13	http://www.ad.siemens.com

7.3.1 Firmware update via fieldbus

CAUTION

DAMAGE TO THE PRODUCT CAUSED BY POWER OUTAGE

If the supply voltage becomes unavailable during an update, the product will be damaged and must be sent in for repair.

- · Do not switch off the supply voltage during the update.
- Update the firmware only with a reliable supply voltage.

Failure to follow these instructions can result in equipment damage.

Flashkit

The Flashkitallows you to update the firmware via the relevant fieldbus. The Flashkit supports the same fieldbus converters as the commissioning software.



Please contact your local sales office to obtain the Flashkit and for support.

Determining the firmware version

You can determine the firmware number and the firmware version with the commissioning software by opening the device information window.

Information on the following parameters can be determined via the field-bus:

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
Config.PrgNo 1:1 (01:01 _h)	Firmware number	UINT32	-	R/-
	High word: Program number Low word: Program version		-	
	Example: PR802.10 High word: 802 Low word: 10			
Config.PrgVer	Firmware version	UINT32	-	R/-
1:2 (01:02 _h)	High word: Program version Low word: Program revision		-	
	Example: V1.003 High word: 1 Low word: 3			
Config.OptPrgNo	Firmware number in option module	UINT32	-	R/-
13:11 (0D:0B _h)	Identifies the program number of the internal Profibus interface of drives with Profibus		-	
Config.OptPrgVer 13:12 (0D:0C _h)	Firmware version in option module	UINT32	-	R/-
	Identifies the program version of the internal Profibus interface of drives with Profibus		-	

8 Operation

The chapter "Operation" describes the basic operating states, operating modes and functions of the drive.



An alphabetically sorted overview of **all** parameters can be found in the chapter "Parameters". The use and the function of some parameters are explained in more detail in this chapter.

8.1 Basics



All speed and position values listed below relate to the motor drive shaft (without gearbox).

8.1.1 Default parameter values

The following default parameter values can be adapted to meet the requirements of the application.

- Accelerations
 - Acceleration and deceleration in general (parameter Motion.acc, 29:26)
 - Deceleration for "Quick Stop"
 (parameter Motion.dec_Stop, 28:21)
- Definition of the direction of rotation (parameter Motion.invertDir, 28:6)
- Controller settings
- · Signal interface
 - Definition of I/O signals
 (Parameter group I/O)
 - Enabling limit switches
 (Parameter group I/O)
- User device name

(Parameters Settings.name1, 11:1 and Settings.name2, 11:2)

8.1.2 External monitoring signals

You can enable, set and monitor the external monitoring signals.

Available external monitoring signals:

- Axis signals
 - Positive limit switch LIMP
 - Negative limit switch LIMN
 - Stop switch STOP
 - Reference switch REF
- Software stop "SW STOP"

8.1.2.1 Axis signals

Configuring the axis signals

Before the external monitoring signals can be used, the signal inputs must be configured for this function (parameter group I/O).

Setting the signal levels

After you have configured the signal inputs, adjust the signal levels for the individual signal inputs.

(parameter Settings.SignLevel, 28:14)

- Value 0: Response at 0 level (failsafe)
- Value 1: Response at 1 level

Activating the axis signals

In the last step you enable the external signal inputs so the incoming signals will be evaluated

(parameter Settings.SignEnable, 28:13).

Reading the axis signals

The saved signal status of the enabled external signal inputs can read out at any time.

(parameter Status_SignSR, 28:15).

Monitoring the axis signals

During operation the two limit switches $\overline{\text{LIMN}}$ and $\overline{\text{LIMP}}$ are monitored. If a limit switch is tripped, the motor stops with the set "Quick Stop" deceleration (parameter Motion.dec_Stop, 28:21) and the event is saved (parameter Status.Sign_SR, 28:15).

Set up the limit switches in such a way as to keep the motor from over-traveling the limit switches.

Moving away from switch

The drive can be moved away from the limit switch range at any time by a reference movement or a jog movement.

For more information see chapter 8.2.4 "Operating mode Homing" or 8.2.1 "Operating mode Jog".

External monitoring signal REF

The external monitoring signal $\overline{\text{REF}}$ does not have to be enabled for the reference movement. If the external monitoring signal $\overline{\text{REF}}$ is enabled, the reference switch also takes the function of an additional stop switch.

External monitoring signal STOP

The external monitoring signal STOP stops the motor with a "Quick Stop". The signal is stored in the parameter $Status.Sign_SR$, 28:15, bit 2.

To resume processing:

- ▶ Reset the external monitoring signal STOP at the signal input.
- ► Run a "Fault Reset".

 (parameter Commands.driveCtrl, 28:1, Bit 3)
- Start a new motion command.

The external monitoring signal STOP is enabled with the parameter Settings.SignEnabl, 28:13, Bit 2.

The signal level of the external monitoring signal STOP is set with the parameter Settings.SignLevel, 28:14, Bit 2.

8.1.2.2 Software stop "SW STOP"

The software "STOP" is a fieldbus command (parameter Commands.driveCtrl, 28:1, bit 2) which brings the drive to an immediate standstill with the specified "Quick Stop" deceleration (parameter Motion. dec_Stop, 28:21).

After an "SW STOP" the drive switches to the operating state "Quick Stop". The power stage remains enabled.

Carry out one of the following steps to continue processing:

Run a "Fault Reset".

```
(parameter Commands.driveCtrl, 28:1, Bit 3)
```

Note that in the event of a "Fault Reset" any other errors that may have occurred are also reset!

▶ Run a "Quick Stop Release".

```
(parameter Commands.driveCtrl, 28:1, Bit 4)
```

After acknowledgement, the drive switches to the operating state "Operation Enable".

8.1.3 Positioning limits

The motor can move to any point within the positioning range once an absolute position has been specified.

The positioning range is -2^{31} to $+2^{31}$ increments (inc).

The positioning resolution is 12 increments per revolution measured at the motor output shaft (without gearbox).

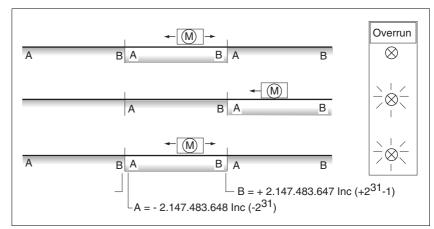


Figure 8.1 Positioning range and range overrun

If the motor exceeds the positioning limits, the internal monitoring signal for position overrun (parameter <code>Status.WarnSig</code>, 28:10, bit 0) is set and the working range is shifted by 2^{32} increments.

If the drive was previously referenced, the bit ref_ok (parameter Status.xMode_act, 28:3, Bit 5) is also reset.

The internal monitoring signal remains set when the motor moves back into the valid range.

Use the parameter Settings.WarnOvrun, 28:11 to parameterize whether the overrun of the positioning limits is signaled as a warning in the parameter Status.driveStat, 28:2 bit 7.



"Absolute positioning" is no longer possible after a position overrun.

Resetting the signal

A reference movement or position setting resets the internal monitoring signal for position overrun.

Operating modes with position overrun

Modes in which the positioning limits can be overtraveled:

- Jog (as of software version 1.101 and later)
- Profile Velocity
- Relative positioning in Profile Position

8.1.4 Internal monitoring signals

The internal monitoring signals are used to monitor the drive itself.

Available internal monitoring signals (parameters Status.WarnSig, 28:10 and Status.FltSig, 28:17):

- Positional deviation with disabled power stage (warning)
- Blocking error
- Position overrun profile generator (warning)
- Safety function STO "Safe Torque Off" (IEC/EN 61800-5-2)
- Hardware error
- Internal system error
- Nodeguard error fieldbus
- Protocol error fieldbus
- Position deviation of position controller
- I2t Limit (warning)
- · Overvoltage or undervoltage error
- Motor overload
- Overtemperature error

Reading stored internal monitoring signals

The signal status of the enabled internal monitoring signals is saved.

If an internal monitoring error occurs, the corresponding bit is set in the parameters Status.FltSig, 28:17 and Status.FltSig_SR, 28:18.

After the cause of the error has been corrected, the bit in parameter Status.FltSig, 28:17 is automatically reset.

The bit in parameter Status.FltSig_SR, 28:18 is not automatically reset. The bis is only reset by a "Fault Reset" (parameter Commands.driveCtrl, 28:1, bit 3). This way it is possible to even detect errors that occur for a very short period of time only.

Blocking error

Blocking monitoring

If, in spite of maximum current, the motor shaft does not move for a parameterized time, the monitoring system signals a blocking error.

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
Settings.T_block	Response time of blocking monitoring If, in spite of maximum current, the motor shaft does not move for the time set with this parameter, the monitoring system signals a blocking error. A value of 0 deactivates blocking monitoring.	UINT16	ms	R/W
15:12 (0F:0C _h)		010000	100	per.

Position deviation with power stage disabled

The drive system has a high holding torque even when the power stage is disabled; in combination with a gearbox this is sufficient for many applications. When the power stage is disabled, the drive continuously compares the actual motor position to the last approached reference position and generates a warning (bit 9) if the position deviation is greater than ± 1 increment.

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
Status.WarnSig 28:10 (1C:0A _h)	Warnings	UINT16	-	R/-
	Monitoring signals with error class 0.		-	
	Assignment of bits: Bit 0: Position overrun profile generator Bit 1: Temperature of power stage >100°C Bit 5: I ² t limitation active Bit 9: Position deviation with power stage disabled			
	The remaining bits are reserved for later extensions. The remaining bits are reserved for future extensions.			

Tracking error monitoring

▲ WARNING

UNEXPECTED MOVEMENT

If the error response to tracking errors is set to error class 1, the motor does not stop in the case of a tracking error unless the position deviation has been cleared.

This may cause motor to restart after correction of an overload condition.

 Only use error class 1 as an error response to tracking errors if a restart does not involve any hazard.

Failure to follow these instructions can result in death, serious injury or equipment damage.

Tracking error monitoring monitors the position deviation between the reference position and the actual position of the motor. If the difference exceeds a limit value, the drive signals a tracking error. The limit value for the tracking error deviation can be parameterized. In addition, it is possible to change the error response to a tracking error.

If "error class 2" is selected, the motor is stopped. As soon as the motor has come to a standstill, the power stage is disabled, even if the position deviation has not yet been cleared.

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
Settings.Flt_pDif 28:24 (1C:18 _h)	Error response to tracking error Value 1: Error class 1 Value 2: Error class 2 Value 3: Error class 3	UINT16 03	3	R/W per.


Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
Status.p_difPeak	Maximum position deviation reached	UINT32	Inc	R/-
15:13 (0F:0D _h)	The value is updated an ongoing basis. The parameter value is set to the current position deviation value by writing 0.	0 0 2147483647		
Status.p_dif 31:7 (1F:07 _h)	Position deviation of position controller	INT32	Inc -	R/-
	If the drive is operating with high pea with sensors may too slow. With I ² t			

anticipates a rise in temperature in time and if the I²t threshold is exceeded, it reduces the motor and power amplifier current to the specified nominal value. If the temperature drops below the threshold, the component can again be operated at the performance limit.

Bit 5 is set in the warning word as long as the monitoring is reducing the current.

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
Status.WarnSig 28:10 (1C:0A _h)	Warnings	UINT16	-	R/-
	Monitoring signals with error class 0.		-	
	Assignment of bits: Bit 0: Position overrun profile generator Bit 1: Temperature of power stage >100°C Bit 5: I ² t limitation active Bit 9: Position deviation with power stage disabled			
	The remaining bits are reserved for later extensions. The remaining bits are reserved for future extensions.			

8.1.5 Operating states and state transitions

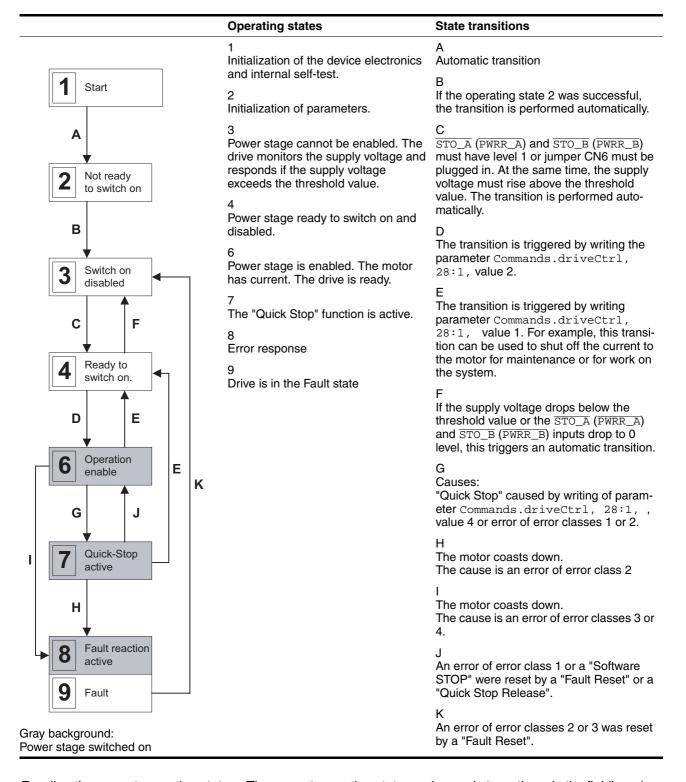

Reading the current operating state

The current operating state can be read at any time via the fieldbus. (parameter Status.driveStat, 28:2).

Bit	Meaning
03	Operating state of the drive
	For more information see 8.1.5 "Operating states and state transitions"
5	Error message by internal monitoring
	The bit is set if at least one bit is set in the parameter Status.FltSig_SR, 28:18.
	The cause of the error can be read with the parameter Status.FltSig_SR, 28:18.
6	Error message by external monitoring
	The bit is set if at least one bit is set in the parameter Status.Sign_SR, 28:15.
	The cause of the error can be read with the parameter Status.Sign_SR, 28:18.
7	Warning message
	The bit is set if at least one bit is set in the parameter Status.WarnSig, 28:10.
	The cause can be read with the parameter $\texttt{Status.WarnSig}$, 28:10.
1215	Monitoring the operating state
	The bits are identical to: Manual.stateMan, 41:2, bits 1215 VEL.stateVel, 36:2, bits 1215 PTP.statePTP, 35:2, bits 1215 Homing.stateHome, 40:2, bits 1215 Gear.stateGear, 38:2, bits 1215 For more information see chapter 8.2 "Operating modes"

8.1.6 Operating-mode-specific status information

Each operating mode has an acknowledgement parameter:

- Jog (as of software version 1.101 and later)
 (parameter Manual.stateMan, 41:2)
- Profile Velocity (parameter VEL.stateVel, 36:2)
- Profile Position
 (parameter PTP.statePTP, 35:2)
- Homing
 (parameter Homing.stateHome, 40:2)

Information stored in every acknowledgement parameter:

- Bit 0: Error LIMP
 Error message caused by positive limit switch
- Bit 1: Error LIMN
 Error message caused by negative limit switch
- Bit 2: Error STOP
 Error response with "Quick Stop"
- Bit 3: Error REF

 Error message caused by reference switch
- Bit 7: "SW Stop"
- · Bit 12: Operating-mode-specific
- · Bit 13: Operating-mode-specific
- Bit 14: "xxx_end"
 Operating mode terminated
- Bit 15: "xxx_err"
 Fault occurred

Operating-mode-specific status information can be found in chapter 8.2 "Operating modes".

If an error occurs during operation, only bit 15 "xxx_err" is set immediately.

In the event of an error of error class 1 or 2 the motor is ultimately brought to a standstill by "Quick Stop" and then bit 14 "xxx_end" is set.

In the case of an error of error class 3 the power amplifier is immediately switched off and bit 14 and 15 are set before the motor is released.

8.1.7 Other status information

In addition to the external and internal monitoring signals, there is status information that contains general information on the drive.

Other available status information:

- Operating mode
 - Current operating mode Status.action_st, 28:19 and Status.xMode_act, 28:3
- Speed of rotation per minute (min⁻¹)
 - Actual speed of motor Status.n_act, 31:9
 - Reference speed
 Status.n_ref, 31:8
 - Actual speed of profile generator Status.n_profile, 31:35
 - Target speed of profile generator
 Status.n_target, 31:38
- Speed in increments per second (Inc/s)
 - Actual speed of motor
 Status.v_act, 31:2
 - Reference speed
 Status.v_ref, 31:1
- Position
 - Actual position of motor Status.p_act, 31:6
 - Reference position Status.p_ref, 31:5
 - Actual position of profile generator Status.p_profile, 31:31
 - Target position of profile generator
 Status.p_target, 31:30
- Voltage
 - Voltage at DC bus Status.UDC_act, 31:20
- Current
 - Current of motor Status.I_act, 31:12
- Temperature
 - Power stage temperature Status.TPA_act, 31:25

8.2 Operating modes

The following operating modes have been implemented:

- Jog
- Profile Velocity
- Profile Position
- Homing

The operating modes represent different options for positioning. You can parameterize the operating modes to meet the requirements of your application.

Changing the operating mode

A new operating mode can only be started after the old one has been terminated.

Termination of an operating mode can be read out with the following parameters:

- Operating-mode-independent
 - Parameter Status.driveStat, 28:2, bit 14
- · Operating-mode-dependent
 - Jog

```
(Parameter Manual.stateMan, 41:2, bit 14)
```

Profile Velocity

```
(Parameter Vel.stateVel, 36:2, bit 14)
```

Profile Position

```
(Parameter PTP.statePTP, 35:2, bit 14)
```

Homing

```
(Parameter Homing.stateHome, 40:2, bit 14)
```

An operating mode is considered to be terminated under the following conditions:

- · Jog: Drive at standstill
- Profile Velocity: Drive at standstill
- · Profile Position: Drive at standstill
- Reference Movement: Drive at standstill
- · Position setting: Immediately after position setting

Parameters for starting a new operating mode:

Jog

```
(parameter Manual.startMan, 41:1)
```

Profile Velocity

```
(parameter VEL. velocity, 36:1)
```

- Profile Positioning: Absolute positioning (parameter PTP.p_absPTP, 35:1)
- Profile Positioning: Relative positioning (parameter PTP.p_relPTP, 35:3)
- Homing: Reference movement (parameter Homing.startHome, 40:1)
- Homing: Position setting (parameter Homing.startSetP, 40:3)

Operating-mode-independent settings

Setting options that apply in all operating modes:

- Acceleration and deceleration behavior with the function "Ramp Setting" function
- Deceleration behavior with the function "Quick Stop"

8.2.1 Operating mode Jog

A WARNING

UNINTENDED OPERATION

- Note that any changes to the values of these parameters are executed by the drive controller immediately on receipt of the data set.
- Verify that the system is free and ready for movement before changing these parameters.

Failure to follow these instructions can result in death, serious injury or equipment damage.

Availability

The operating mode is available as of firmware version 1.100 and later.

Description

Jog movements represent "classical jogging". The motor is moved over a selected distance by start signals. If the start signal is applied for a longer period of time, the motor switches to continuous movement.

The operating mode can be started via:

- · Commissioning software
- Fieldbus
- Inputs of the signal interface if the signal interface is configured with the "programmable inputs" function.

Operation with commissioning software

The commissioning software supports this operating mode with special dialog boxes and menus.

Starting the operating mode

The motor can be moved in both directions at two speeds. Jog movements are started with the Manual.startMan parameter. The current axis position is the start position for jog movements. The values for position and speed are specified via the corresponding parameters.

Jog is finished when the motor has come to a standstill

- · the direction signal is inactive,
- the operating mode was interrupted by an error response.

The Manual.statusMan parameter provides information on the processing status.

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
Manual.startMan 41:1 (29:01 _h)	Starting a jog	UINT16 - 015 0	-	R/W
	Assignment of bits: Bit 0: Clockwise direction of rotation Bit 1: Counterclockwise direction of rotation Bit 2: 0 = slow 1 = fast Bit 3: Automatic processing of power stage		0	
	If bit 3 is set to 1, a jog movement can be started even if the power stage is switched off: If the drive is in state 4 (Ready-ToSwitchOn), the power stage is automatically switched on when the jog movement is started and switched off when the movement is finished.			
Manual.stateMan	Acknowledgement: Jog	UINT16	-	R/-
41:2 (29:02 _h)	Assignment of bits: Bit 0: Error LIMP Bit 1: Error LIMN Bit 2: Error HW_STOP Bit 3: Error REF Bit 7: Error SW_STOP Bit 14: manu_end Bit 15: manu_err		-	

Classical jog

Triggered by the start signal for jog, the motor first moves over a defined distance Manual.step_Man. If the start signal is still available after a specific delay time Manual.time_Man, the controller switches to continuous movement.

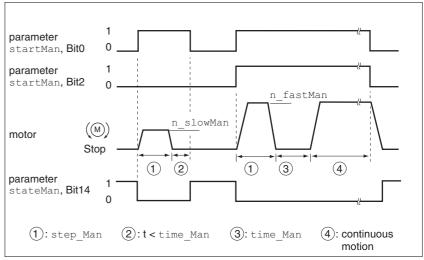


Figure 8.2 Classical jog, slow and fast

Jog distance, waiting time and jog speeds are adjustable. If the jog distance is zero, the jog movement starts directly as a continuous movement, irrespective of the waiting time.

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
Manual.n_slowMan	Speed for slow jog	UINT16	min ⁻¹	R/W
41:4 (29:04 _h)		3005000	300	per.
Manual.n_fastMan	Speed for fast jog	UINT16	min ⁻¹	R/W
41:5 (29:05 _h)		3005000	1000	per.
Manual.step_Man 41:7 (29:07 _h)	Jogging distance at jog start Value 0: Direct activation of continuous movement	UINT16	Inc 2	R/W per.
Manual.time_Man	Waiting time until continuous movement starts Only effective if jog distance is not set to equal 0.	UINT16	ms	R/W
41:8 (29:08 _h)		110000	500	per.

Moving away from limit switch range

The drive can be moved away out of the limit switch range to a valid movement range at any time by means of a jog movement.

If the positive limit switch signal $\overline{\texttt{LIMP}}$ was activated, the jog movement must be in negative direction; in the case of $\overline{\texttt{LIMN}}$, the movement must be in positive direction. If the motor does not move away, verify that you have selected the correct direction for the jog movement.

8.2.2 Operating mode Profile velocity

A WARNING

UNINTENDED OPERATION

- Note that any changes to the values of these parameters are executed by the drive controller immediately on receipt of the data set.
- Verify that the system is free and ready for movement before changing these parameters.

Failure to follow these instructions can result in death, serious injury or equipment damage.

In the operating mode Profile Velocity, the drive accelerates to an adjustable target speed of rotation. You can set a motion profile with values for acceleration and deceleration ramps.

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
VEL.velocity 36:1 (24:01 _h)	Start with target speed	INT16	min ⁻¹	R/W
	Action object: write access triggers a movement	-50005000	-	
	The minimum speed of rotation is 300 min ⁻¹ .			
VEL.stateVEL	Acknowledgement: Profile Velocity	UINT16	-	R/-
36:2 (24:02 _h)	Assignment of bits: Bit 0: Error LIMP Bit 1: Error LIMN Bit 2: Error STOP Bit 3: Error REF Bit 7: SW_STOP Bit 13: Target speed reached Bit 14: vel_end Bit 15: vel_err		-	

Starting the operating mode

As soon as a target speed of rotation is transmitted with the parameter VEL.velocity, 36:1, the drive switches to the operating mode Profile Velocity and accelerates to the target speed of rotation.

► Send the parameter VEL.velocity, 36:1 with a value not equal to 0 to start the operating mode.

Monitoring the operating mode

The target speed of rotation can be changed at any time during operation:

 Target speed of rotation (parameter VEL.velocity, 36:1)

The status of the operating mode can be read with the parameter VEL.stateVel, 36:2.

- Target speed of rotation reached (bit 13)
- Operating mode ended (bit 14: vel_end)
- Error (bit 15: vel_err)

Position overrun

In the Profile Velocity operating mode, the drive may exceed the position range (32 bit).

This is not an error, the operating mode continues to run. However, the following monitoring signals are set or reset; they can be read with status parameters:

- Parameter Status. WarnSig, 28:10, bit 0 is set
- Parameter Status.xMode_act, 28:3, bit 5 is reset
 This parameter indicates that the drive has been referenced.

For more information see chapter 8.1.3 "Positioning limits".

Terminating the operating mode

The following options are available for stopping the drive via the fieldbus:

- Set the target speed of rotation to 0 (parameter VEL.velocity, 36:1)
- "Quick Stop" via fieldbus

The drive comes to a stop via "Quick Stop".

(parameter Commands.driveCtrl, 28:1, setting of bit 2)

In the case of an error the drive is also stopped. This is indicated by parameter VEL.state, 36:2, bit 15.

The VEL.stateVel, 36:2 parameter provides information on the current processing status.

8.2.3 Operating mode Profile position

A WARNING

UNINTENDED OPERATION

- Note that any changes to the values of these parameters are executed by the drive controller immediately on receipt of the data set
- Verify that the system is free and ready for movement before changing these parameters.

Failure to follow these instructions can result in death, serious injury or equipment damage.

In Profile Position operating mode, a movement with an adjustable motion profile is performed from a start position to a target position. The value of the target position can be specified as either a relative or an absolute position.

You can set a motion profile with values for acceleration ramp, deceleration ramp and target speed.

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
PTP.p_absPTP 35:1 (23:01 _h)	Target position for absolute positioning and start of positioning	INT32	Inc	R/W
	Action object: write access triggers absolute positioning in increments		-	
PTP.StatePTP 35:2 (23:02 _h)	Acknowledgement: Profile Position Assignment of bits: Bit 0: Error LIMP Bit 1: Error LIMN Bit 2: Error STOP Bit 3: Error REF Bit 7: SW_STOP Bit 13: Target position reached Bit 14: ptp_end Bit 15: ptp_err	UINT16	-	R/-
PTP.p_relPTP 35:3 (23:03 _h)	Target position for relative positioning and start of positioning Action object: write access triggers relative positioning in incre-	INT32	Inc -	R/W
	ments	LUNITAG		
PTP.continue 35:4 (23:04 _h)	Continue interrupted positioning	UINT16 - 0		R/W
00.4 (20.04 _h)	The target position was specified with the previous positioning command. The value indicated here is not relevant for positioning.	0	Ü	
PTP.v_tarPTP	Target speed of rotation for positioning	UINT16 05000	min ⁻¹ 1000	R/W
35:5 (23:05 _h)	Positioning can be temporarily stopped with value 0. The default value is the value of parameter Motion.v_target0.			
	The minimum speed of rotation is 300 min ⁻¹ .			

Settings The positioning path can be entered in 2 ways:

- · Absolute positioning, reference point is the zero point.
- Relative positioning, reference point is the current reference position of the motor (parameter Status.p_ref, 31:5).

 


Figure 8.3 Absolute positioning (left) and relative positioning (right)

Starting the operating mode

As soon as a target position is transmitted in the parameters PTP.p_absPTP, 35:1 or PTP.p_relPTP, 35:3, the drive switches to the Profile Position operating mode and starts positioning at the target speed of rotation specified with parameter PTP.v_tarPTP, 35:5.

Start absolute positioning

Absolute positioning can only be started if the drive is homed (see chapter 8.2.4 "Operating mode Homing"). The parameter $\texttt{Status.xMode_act}$, 28:3, bit 5 (ref_ok) indicates whether or not the drive is homed.

Procedure for starting absolute positioning:

- ▶ Set the target speed of rotation with the parameter PTP.v_tarPTP, 35:5.
- ► Start absolute positioning by specifying the absolute target position in parameter PTP.p_absPTP, 35:1.

Absolute positioning cannot be started after a position overrun, because the absolute position reference is lost during the position overrun.

A position overrun is indicated in parameter Status.WarnSig, 28:10, bit 0. In addition, bit 5 (ref_ok) in parameter Status.xMode_act, 28:3 is reset.

Starting relative positioning

Procedure for starting relative positioning:

- ► Set the target speed of rotation with the parameter PTP.v_tarPTP, 35:5.
- ► Start relative positioning by specifying the relative target position in parameter PTP.p_relPTP, 35:3.

Continuing the operating mode

If a positioning process is interrupted by, for example, an external stop signal, the process can be continued via a write access to the parameter ${\tt PTP.continue}$, ${\tt 35:4}$ so it can be completed. Before you can continue, you must remedy the problem that caused the interruption and execute a "Fault-Reset". The value transmitted with ${\tt PTP.continue}$, ${\tt 35:4}$ is not evaluated.

Monitoring the operating mode

The parameter PTP.statePTP, 35:2 lets you get the processing status.

- Target position reached and operating mode ended. Not signalled if movement was interrupted. (Bit 13)
- Operating mode terminated (bit 14)
- Error (bit 15)

Terminating the operating mode

Conditions that terminate the operating mode:

- Target position reached, motor at standstill (Parameter PTP.statePTP, 35:2, bit 14)
- In the case of an error the drive is stopped. This is indicated by parameter PTP.statePTP, 35:2, bit 15.
- Fieldbus command "Quick Stop"
 (writing of value 4 to parameter Commands.driveCtrl, 28:1)
 The drive comes to a stop with "Quick Stop".

8.2.4 Operating mode Homing

A WARNING

UNINTENDED OPERATION

- Note that any changes to the values of these parameters are executed by the drive controller immediately on receipt of the data set.
- Verify that the system is free and ready for movement before changing these parameters.

Failure to follow these instructions can result in death, serious injury or equipment damage.

8.2.4.1 Overview

Overview of Homing

The operating mode Homing establishes an absolute position reference between the motor position and a defined axis position. Homing can be carried out by a means of a reference movement or by position setting.

A reference movement is a movement to a defined point, the reference point, on the axis; the objective is to establish the absolute position reference between the motor position and the axis position. The reference point also defines the zero point that is used for all subsequent absolute positionings as a reference point. It is possible to parameterize a shift of the zero point.

A reference movement must be completed for the new zero point to be valid. If the reference movement is interrupted, it must be. As opposed to the other operating modes, a reference movement must be completed before you can switch to a new operating mode.

The signals required for the reference movement must be wired. Monitoring signals that are not used must be deactivated.

 Position setting lets you set the current motor position to a desired position value to which the subsequent position specifications will relate.

There are 6 standard types of reference movements:

- Movement to negative limit switch LIMN
- Movement to positive limit switch LIMP
- Movement to reference switch REF with counterclockwise direction of rotation
- Movement to reference switch REF with clockwise direction of rotation
- Movement to block with counterclockwise direction of rotation
- · Movement to block with clockwise direction of rotation

Monitoring reference movements

The parameter Homing.stateHome, 40:2 lets you get information on the processing status.

The parameter Status.xMode_act, 28:3, bit 5, is set if the reference movement was successful.

Terminating a reference movement

Conditions that terminate the reference movement:

- The motor has reached the target position and is at a standstill.
- Error response
- "Quick Stop" via fieldbus command

When the power stage is disabled, the valid reference point is retained.

Special features reference position

The drive stores the position so that it remains referenced even if it is switched off. However, the drive loses the reference position in the following cases:

- If the drives moves beyond the positioning limits -2³¹ ... +2³¹-1.
- If a running reference movement is interrupted.
- If the drive is turned while it is switched off.

NOTE: Because of the encoder used, the drive only has a 50% chance of detecting that the motor was turned when it starts up.

 If the drive is switched off with the motor running and external consumers cause a fast voltage drop, the microprocessor does not have time enough to save the position after standstill.

The fieldbus process data and the parameter Status.xMode_act, 28:3, bit ref_ok, indicate whether or not the drive is homed.

Motor position after Homing

A special feature is that the controller cannot compensate for position deviations of ± 1 increments. This means that the reference position of the position controller ${\tt Status.p_ref}$, 31:5 and the actual motor position delivered by the encoder ${\tt Status.p_act}$, 31:6 can differ by ± 1 increment. Since position setting and reference movements use the reference position ${\tt Status.p_ref}$, 31:5, the actual motor position ${\tt Status.p_act}$, 31:6 may also differ by ± 1 increment after such position setting or reference movements.

After position setting to 0, the drive may deliver, e.g. Status.p_act, 31:6=-1,0 or +1.

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
Homing.startHome	Start operating mode Homing	UINT16	-	R/W
40:1 (28:01 _h)	Action object: Write access triggers reference movement.	18	-	
	Value 1: LIMP Value 2: LIMN Value 3: REF counterclockwise direction of rotation Value 4: REF clockwise direction of rotation Value 7: Movement to block counterclockwise direction of rotation Value 8: Movement to block clockwise direction of rotation			
Homing.stateHome 40:2 (28:02 _h)	Acknowledgement: Homing Assignment of bits: Bit 0: Error LIMP Bit 1: Error LIMN Bit 2: Error HW_STOP Bit 3: Error REF Bit 7: Error SW_STOP Bit 15: ref_err Bit 14: ref_end	UINT16	-	R/-

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
Homing.startSetp	Position setting to position setting position	INT32	Inc	R/W
40:3 (28:03 _h)	Action object: write access triggers position setting Only possible if the motor is at standstill.		-	
Homing.v_Home 40:4 (28:04 _h)	Speed of rotation for search of switch	UINT16 3005000	min ⁻¹ 1000	R/W per.
Homing.v_outHome 40:5 (28:05 _h)	Speed of rotation for moving away from switch	UINT16 3005000	min ⁻¹ 500	R/W per.
	Maximum distance for search for switching edge	INT32	Inc	R/W
40:6 (28:06 _h)	After detection of the switch, the drive starts to search for the defined switching edge. If it is not found within the distance defined here, the reference movement is canceled with an error.	1 2147483647	200000	per.
	Distance from switching edge to reference point	INT32	Inc	R/W
40:7 (28:07 _h)	After the drive moves away from the switch, it is positioned into the working range by a defined distance; this is defined as the reference point.	1 2147483647	200	per.
Homing.RefSwMod	Processing sequence during reference movement to REF	UINT16	-	R/W
40:9 (28:09 _h)	Bit value 0: In positive direction Bit value 1: In negative direction	03	0	per.
	Assignment of bits: Bit 0: Direction of movement to switching edge Bit 1: Direction of movement to distance from switching edge			
Homing.RefAppPos	Application position at reference point	INT32	Inc	R/W
40:11 (28:0B _h)	After a successful reference movement, this position is set at the reference point. This automatically defines the application zero point.		0	per.
Homing.refError	Cause of error during reference movement	UINT16	-	R/-
40:13 (28:0D _h)	Error code during reference movement processing		-	

8.2.4.2 Reference movement to limit switch

The following illustration shows a reference movement to the negative limit switch with distance from the switching edge (Homing.startHome, 40:1=2).

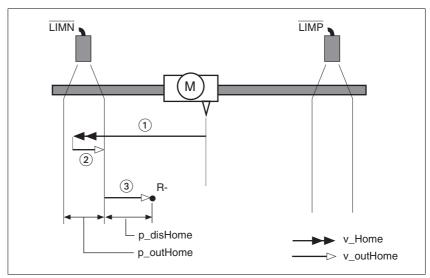


Figure 8.4 Reference movement to the negative limit switch

- (1) Movement to limit switch
- (2) Movement to switching edge
- (3) Movement to distance from switching edge

Starting the reference movement

Procedure:

- ► Set the speed of rotation for the search for the switch (parameter Homing.v_Home, 40:4)
- ► Set the speed of rotation for moving away from the switch. (parameter Homing.v_outHome, 40:5).
- ► Set the distance from the switching edge. (parameter Homing.p_disHome, 40:7).
- ► Start the reference movement to the desired limit switch. (parameter Homing.startHome, 40:1 = 1 or 2)

8.2.4.3 Reference movement to reference switch

A reference movement to the reference switch does not require the reference switch to be enabled. The signal level can be inverted with the parameter Settings.SignLevel, 28:14.

The following illustration shows reference movements to the reference switch with distance from the switching edge (Homing.startHome, 40:1=3).

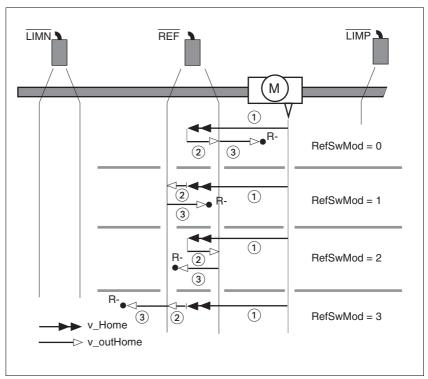


Figure 8.5 Reference movement to reference switch

- (1) Movement to limit switch
- (2) Movement to switching edge
- (3) Movement to distance from switching edge

If a reference movement was started with the wrong direction of rotation, the motor stops at the limit switch. The reference movement is interrupted and must be restarted with the correct direction of rotation.

Starting the reference movement

Procedure:

- ► Set the speed of rotation for the search for the switch (parameter Homing.v_Home, 40:4).
- ► Set the speed of rotation for moving away from the switch. (parameter Homing.v_outHome, 40:5)
- ► Set the directions.

 (parameter Homing.RefSwMod, 40:9)
- ► Set the distance from the switching edge. (parameter Homing.p_disHome, 40:7)
- ➤ Start the reference movement to the reference switch with movement at counterclockwise direction of rotation.

 (parameter Homing.startHome, 40:1 = 3 or 4)

8.2.4.4 Reference movement to block

The drive allows you to perform a reference movement to a mechanical stop.

Please note the following information:

- The mechanical stop must be sufficiently sturdy
- Set a low search speed to avoid damage to the gearbox and the mechanical components
- Reduce the max. current for the movement to block to a value as low as possible

During the reference movement to block, the current limitation for normal operation $\mathtt{Settings.I_max}$, 15:3 is initially active during the acceleration process. This is necessary to overcome the detent torque of the drive and to get the drive to move. When a constant speed is reached, the reference movement switches the current limitation to the reduced value $\mathtt{Settings.I_maxBlk}$, 15:5.

Starting the reference movement

Procedure:

- ► Set the speed of rotation to be used for searching the switch (parameter Homing.v_Home, 40:4).
- ► Set the maximum current for reference movement to block. (parameter Settings.I_maxBlk, 15:5)
- ► Start the reference movement to block with movement at the desired direction of rotation.

(parameter Homing.startHome, 40:1 = 7 or 8)

8.2.4.5 Position setting

Position setting defines an absolute position reference depending on the current motor position.

The position value is delivered in increments in the parameter-Homing.startSetP, 40:3.

Position setting is only possible when the motor is at a standstill.

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
Homing.startSetp 40:3 (28:03 _h)	Position setting to position setting position	INT32	Inc	R/W
	Action object: write access triggers position setting Only possible if the motor is at standstill.		-	

Example Position setting can be used to carry out a continuous motor movement without exceeding the positioning limits.

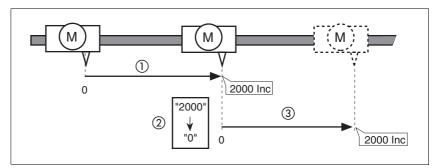


Figure 8.6 Positioning by 4000 increments with position setting

- (1) The motor is positioned by 2000 inc.
- (2) By means of position setting to 0, the current motor position is set to position value 0 which, at the same time, defines a new zero point.
- When a new motion command by 2000 inc is triggered, the new target position is 2000 inc.

This method avoids overtravel of the absolute position limits during a positioning operation because the zero point is continuously adjusted.

Starting position setting

Procedure:

► Write the new position setting position. (parameter Homing.startSetP, 40:3)

The command is executed immediately and the operating mode is ended.

Monitoring position setting

The parameter Homing.stateHome, 40:2 lets you get information on the processing status.

The parameter $\texttt{Status.xMode_act}$, 28:3, bit 5, is set if position setting was successful.

Terminating position setting

The operating mode is terminated immediately upon completion.

8.3 Functions

8.3.1 Definition of the direction of rotation

The direction of rotation can be inverted.

The direction of rotation should be defined only once when you commission the product. The definition of the direction of rotation is not intended to reverse the direction of rotation during operation.

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
Motion.invertDir	Definition of direction of rotation	UINT16	-	R/W
28:6 (1C:06 _h)	Value 0: Clockwise direction of rotation With positive reference values, the motor rotates clockwise (as you look at the end of the protruding motor shaft).	01	0	per.
	Value 1: Counterclockwise direction of rotation With positive reference values, the motor rotates counterclock- wise (as you look at the end of the protruding motor shaft).			
	NOTE: The new value is only activated when the drive is switched on.			

8.3.2 Motion profile

Profile generator

Target position and target speed of rotation are input values to be specified by the user. The profile generator uses these values to calculate a motion profile depending on the selected operating mode.

The following properties can be set for the motion profile:

- Symmetrical and linear acceleration ramp.
- · Change of speed of rotation and position during movements.
- Acceleration parameters min⁻¹/s.

Value range 1000 ... 100000 min⁻¹/s.

Internal resolution approx. 77 min⁻¹/s.

Speed values in min⁻¹.

Value range 300 ... 5000 min⁻¹.

Resolution 1 min⁻¹.

• Position values in increments (inc).

Value range -2³¹ ... +2³¹-1 inc.

With reference to the motor output shaft, the drive has a resolution of 12 inc/rev.

Group.Name Index:Subindex dec. (hex.)	x:Subindex Bit assgnment		Unit Default dec.	R/W per.
Motion.dec_Stop	Deceleration for "Quick Stop"	UINT32	min ⁻¹ /s	R/W
28:21 (1C:15 _h)	Deceleration that is used for every "Quick Stop": - "Quick Stop" via control word - "Quick Stop" via external monitoring signal - "Quick Stop" via error of classes 1 and 2	100010000	per.	
Motion.v_target0 29:23 (1D:17 _h)	Speed of rotation for parameter PTP.v_tarPTP	UINT16	min ⁻¹	R/W
	Speed of rotation for Profile Position operating mode if no value was written to ${\tt PTP.v_tarPTP}.$	3005000 1000		per.
	NOTE: This persistent value is only used as a default assignment for PTP.v_tarPTP during switching on.			
Motion.acc 29:26 (1D:1A _h)	Acceleration	UINT32	min ⁻¹ /s	R/W
	Value determines acceleration and deceleration. New values do not become effective until after standstill.	100010000 2500 0		per.

8.3.3 Quick Stop

"Quick Stop" is a quick brake function which stops the motor as a result of a fault of error classes 1 and 2 or as a result of a software stop.

In the event of an error response to an error of error class 1, the power stage remains enabled. In the case of error class 2, the power stage is disabled after the drive has come to a standstill.

Events that trigger a "Quick Stop":

- Input signal STOP
 (parameter Status.Sign_SR, bit 2)
- Limit switch overtraveled (parameter Status.Sign_SR, bit 0 and bit 1)
- Error of error classes 1 or 2
- "Quick Stop" triggered via a fieldbus command (parameter Commands.driveCtrl, 28:1, Bit 2)

Settings

In the following operating modes, motor deceleration is controlled via a profile. The deceleration can be set with the parameter Motion.dec_Stop, 28:21.

- Profile Velocity
- · Profile Position
- Homing
- Jog

The drive absorbs excess braking energy during a "Quick Stop". If the DC bus voltage exceeds the permissible limit value, the drive disables the power stage and signals an "overvoltage error". The motor then coasts down without any braking force.

Procedure if the drive repeatedly switches off with an "Overvoltage" error during "Quick Stop".

- ► Reduce the deceleration or the maximum current for stop via the torque ramp.
- ▶ Reduce the drive load

Acknowleding a Quick Stop

Procedure after an error or a "Quick Stop" executed by a fieldbus command:

► Reset the error.

```
(parameter Commands.driveCtrl, 28:1, Bit 3)
```

Procedure after a "STOP" signal:

- Reset the "STOP" signal at the signal input.
- ▶ Reset the error.

```
(parameter Commands.driveCtrl, 28:1, Bit 3)
```

Procedure after a "Quick Stop" via the limit switch signals $\overline{\tt LIMN}$ and $\overline{\tt LIMP}$:

▶ Move the motor out of the limit switch range.

(For more information see chapter 8.1.2 "External monitoring signals".)

More information

For more information see Chapter 8.1.5 "Operating states and state transitions" and Chapter 6 "Installation".

8.3.4 Programmable inputs and outputs

If a 24V signal is configured as a "programmable input or output", the drive automatically accesses this signal input or output.

This can be set for each of the 4 signals with the parameters IO.IO0_def to IO.IO3_def.

Programmable input

If a signal is configured as a programmable input, the drive monitors this signal continuously and accesses parameters independently whenever it a change of edge is detected. The parameter accesses can be parameterized as follows:

- · Evaluation of rising and falling edges
- Parameter to be influenced by specification of index and subindex
- Write value for parameter with rising edge
- · Write value for parameter with falling edge
- · Bit mask for writing the object

Structure of the parameter access:

- Rising or falling edge detected
- Parameter is read
- Result of AND operation with bit mask
- Result of OR operation with write value for parameter with rising and falling edge
- · Write result to parameter

Shown as pseudo code:

- Rising edge -> object_WriteValue = (object_ReadValue AND bitmask) OR WriteValue_pos
- Falling edge -> object_WriteValue = (object_ReadValue AND bitmask) OR WriteValue_neg

Special case if bit mask = 0:

- Rising edge -> object_WriteValue= WriteValue_pos
- Falling edge -> object_WriteValue= WriteValue_neg

Programmable output

If a signal is defined as a programmable output, the drive accesses (read) parameters cyclically and sets the signal level in accordance with the read value. The accesses can be parameterized with the following parameters:

- Selection of the parameter to be read by specification of index and sub-index
- Comparison value for 1 level at output
- Comparison operator: equal, not equal, less than, greater than
- Bit mask for the comparison

Structure of the parameter access:

- · Parameter is read
- · Result of AND operation with bit mask
- · Compare result with comparison value
- Depending on result, set output to HIGH or LOW

Shown as pseudo code:

IF (object_ReadValue AND bit mask) <comparison_operator> comparison_value THEN set output=1

ELSE set output=0

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
ProgIO0.Index 800:1 (320:01 _h)	Index of the control parameter If prog. input: index of parameter to be written	UINT16	-	R/W per.
	If prog. output: index of parameter to be read			
	If prog. input: write(Index,Subindex) = (read(Index,Subindex) BAND BitMask) BOR VALUEx			
	If prog. output: 1 level at output if (read(Index,Subindex) BAND BitMask) =<> VALUE1			
ProgIO0.Subindex	Subindex of control parameter	UINT16	-	R/W
800:2 (320:02 _h)	If prog. input: subindex of parameter to be written If prog. output: subindex of parameter to be read		-	per.
ProgIO0.BitMask 800:3 (320:03 _h)	Bitmask for the parameter value	UINT32	-	R/W
	If programmable input or programmable output: Bit mask used to link the read value (index, subindex) of the parameter with the operator AND before the value is processed.		-	per.

Group.Name Index:Subindex dec. (hex.)	dex:Subindex Bit assignment		Unit Default dec.	R/W per.
ProgIO0.Switch 800:4 (320:04 _h)	Edge detection and comparison operator	UINT16	-	R/W
	If programmable input: Selection of the edges to be detected Value 0: No response to level change Value 1: Response to rising edge Value 2: Response to falling edge Value 3: Response to both edges		-	per.
	If programmable output: Selection of condition for comparison: Value 0: (parameter read value = comparison value) Value 1: (parameter read value <> comparison value) Value 2: (parameter read value < comparison value) Value 0: (parameter read value > comparison value)			
ProgIO0.Value1 800:5 (320:05 _h)	Write Write value at rising edge and comparison value If programmable input: Parameter write value at rising edge	INT32 0 4294967295	-	R/W per.
	If programmable output: Comparison value for condition			
ProgIO0.Value2 800:6 (320:06 _h)	Write value at falling edge	INT32	-	R/W
	If programmable input: Parameter write value at falling edge	0 4294967295	-	per.
	If programmable output: no meaning			

Example Parameterization for a simple manual control

IO0 as input,	Rising edge = enable power stage	Falling edge = disable power stage + reset error
IO1 as input,	Rising edge = movement in positive direction	Falling edge = stop
IO2 as input,	Rising edge = movement in negative direction	Falling edge = stop
IO3 as output,	Output = 1 if drive ready	

Input IO0

Input	L -> H	Commands.driveCtrl 2	(Enable)
	H -> L	Commands.driveCtrl 9	(Disable + FaultReset)

Parameter name	ldx:Six	Value	Remarks
I/O.IO0_def	34:1	5	Input programmable
ProglO0.Index	800:1	28	Index 28
ProgIO0.Subindex	800:2	1	Subindex 1
ProgIO0.Bitmask	800:3	0	Mask
ProgIO0.Switch	800:4	3	Detect both edges
ProgIO0.Value1	800:5	2	Value at pos. edge: Enable
ProgIO0.Value2	800:6	9	Value at neg. edge: Disable+Fault- Reset

input IO1

Input	L -> H	VEL.velocity 600	(positive movement)
	H -> L	VEL.velocity 0	(stop)

Parameter name	ldx:Six	Value	Remarks
I/O.IO1_def	34:2	5	input programmable
ProgIO1.Index	801:1	36	Index 36
ProgIO1.Subindex	801:2	1	Subindex 1
ProgIO1.Bitmask	801:3	0	Mask
ProgIO1.Switch	801:4	3	detect both edges
ProgIO1.Value1	801:5	600	speed value with rising edge
ProgIO1.Value2	801:6	0	speed value with falling edge

input IO2

Input	L -> H	VEL.start -600	(neg. movement)
	H -> L	VEL.start 0	(stop)

Parameter name	ldx:Six	Value	Remarks
I/O.IO2_def	34:3	5	input programmable
ProgIO2.Index	802:1	36	Index 36
ProgIO2.Subindex	802:2	1	Subindex 1
ProgIO2.Bitmask	802:3	0	Mask
ProgIO2.Switch	802:4	3	detect both edges
ProgIO2.Value1	802:5	-600	speed value with rising edge
ProgIO2.Value2	802:6	0	speed value with falling edge

Output IO3

Output	High	if status 6	(Status.driveStat AND 15) = 6

Parameter name	ldx:Six	Value	Remarks
I/O.IO3_def	34:4	130	Output programmable
ProglO3.Index	803:1	28	Index 28
ProgIO3.Subindex	803:2	2	Subindex 2
ProgIO3.Bitmask	803:3	15	Mask: Bit 03
ProgIO3.Switch	803:4	0	condition: "="
ProgIO3.Value1	803:5	6	Comparison value: 6 = Operation Enable

8.3.5 Standstill window

The standstill window can be used to check whether the drive has reached the reference position.

If the control deviation $Status.p_dif$ of the position controller remains in the standstill window after the end of the positioning for the period $Settings.p_winTime$, the device signals the end of processing $(x_end = 0->1)$.

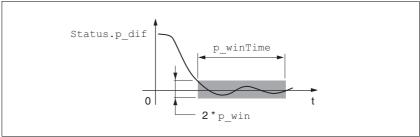


Figure 8.7 Standstill window

The parameters Settings.p_win and Settings.p_winTime define the size of the window.

The standstill window primarily affects the x_end bit of the operating mode: The corresponding operating mode does not signal x_end=1 unless the is in the standstill window after the end of the movement.

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
Settings.p_win	Standstill window, permissible control deviation			R/W
15:15 (0F:0F _h)	See parameter Settings.p_winTime			per.
	Standstill window, time	UINT16	0	R/W
15:16 (0F:10 _h)	The control deviation p_dif must be within the position window for this period of time for the movement to be detected as finished. This is signalled by the x_end bit in the status word. Value 0: Standstill window deactivated	032767		per.

9 Diagnostics and troubleshooting

9.1 Error indication and troubleshooting

9.1.1 Diagnostics via commissioning software

The commissioning software can be used to display the following diagnostics information

- Indication of current operating state
 Lets you draw conclusions concerning the reasons for the drive not being ready for operation.
- Status word Indicates which of the 3 following signals is active:
 - External monitoring signal
 - Internal monitoring signal
 - Warning
- Parameter Status.StopFault, 32:7
 Cause of last interruption, error number
- · Error memory

The error memory contains the last 7 errors. The error memory is not volatile, i.e. it is not cleared when the drive is switched off.

The following information is output for every error:

- Age
- Description of error as text
- Error class
- Error number
- Frequency
- Additional information

9.1.2 Diagnostics via fieldbus

Asynchronous errors

In fieldbus mode, device errors are signaled as asynchronous errors by the monitoring system of the controller. An asynchronous error is indicated by the status word "fb_statusword". Signal status 1 indicates an error message or a warning message. The parameters allow you to determine details concerning the cause of the error.

 


Figure 9.1 Evaluation of asynchronous errors

Description of the bits:

• Bit 5, "FltSig"

Message from internal monitoring signal (e.g. power amplifier overtemperature)

Parameter Status.FltSig_SR, 28:18

• Bit 6, "Sign_SR"

Message from external monitoring signal (e.g. movement interruption by limit switch)

Parameter Status.Sign_SR, 28:15

• Bit 7, "warning"

Warning message (e.g. temperature warning)

Parameter Parameter Status. WarnSig, 28:10

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
Status.p_difPeak 15:13 (0F:0D _h)	Maximum position deviation reached The value is updated an ongoing basis. The parameter value is set to the current position deviation value by writing 0.	UINT32 0 214748364 7	Inc 0	R/-
Status.driveStat 28:2 (1C:02 _h)	Status word for the operating state LOW-UINT16: Assignment of bits: Bits 0 3: Current operating state Bit 4: reserved Bit 5: Error detected by internal monitoring Bit 6: Error detected by external monitoring Bit 7: Warning active Bits 8 11: Reserved Bits 12 15: Operating-mode specific coding Corresponds to the assignment of bits 12 15 in the operating mode-specific acknowledgement data. HIGH-UINT16: Assignment see parameter Status.xMode_act.	UINT32	-	R/-

0198441113568, V2.00, 09.2008

Group.Name Index:Subindex dec. (hex.)	ndex:Subindex Bit assignment		Unit Default dec.	R/W per.
Status.FltSig_SR	Stored monitoring signals	UINT32	-	R/-
28:18 (1C:12 _h)	Error bits remain set until a FaultReset is executed.		-	
	Assignment of bits: Bit 0: Undervoltage 1 power supply Bit 1: Undervoltage 2 power supply Bit 2: Overvoltage power supply Bit 5: Motor overload Bit 12: Overtemperature power stage (≥105°C) Bit 16: Blocking error Bit 17: Tracking error Bit 18: Encoder inoperative Bit 21: Protocol error fieldbus Bit 22: Nodeguard error Bit 23: Pulse/directing input timing Bit 25: STO safety function triggered Bit 26: Signals of the STO safety function have different levels Bit 29: Start-up error Bit 30: Internal system error Bit 31: Watchdog			
Status.action_st	Action word	UINT16	-	R/-
28:19 (1C:13 _h)	Assignment of bits: Bit 0: Bit latched error class 0 Bit 1: Bit latched error class 1 Bit 2: Bit latched error class 2 Bit 3: Bit latched error class 3 Bit 4: Bit latched error class 4 Bit 5: reserved Bit 6: Motor at standstill: actual speed of rotation is zero Bit 7: Motor rotates clockwise Bit 8: Motor rotates counterclockwise Bit 9: reserved Bit 10: reserved Bit 11: Motor at standstill: reference speed of rotation is 0 Bit 12: Motor decelerates Bit 13: Motor accelerates Bit 14: Motor moves at constant speed Bit 15: reserved		-	
Status.v_ref 31:1 (1F:01 _h)	Reference speed Reference value of speed controller	INT32	Inc/s -	R/-
Status.v_act	Actual speed of motor	INT32	Inc/s	R/-
31:2 (1F:02 _h)	The speed captured by the encoder.	11102	-	
Status.p_ref	Reference position	INT32	Inc	R/-
31:5 (1F:05 _h)	Reference value of position controller.			
Status.p_act	Actual position of motor	INT32	Inc	R/-
31:6 (1F:06 _h)	The motor position captured by the encoder.		-	
Status.p_dif 31:7 (1F:07 _h)	Position deviation of position controller	INT32	Inc -	R/-
Status.n_ref	Reference speed	INT16	min ⁻¹	R/-
31:8 (1F:08 _h)	Reference value of speed controller			

Group.Name Index:Subindex dec. (hex.)	ıbindex Bit assgnment		Unit Default dec.	R/W per.
Status.n_act	Actual speed of motor	INT16	min ⁻¹	R/-
31:9 (1F:09 _h)	Corresponds to parameter ${\tt Status.v_act},$ but converted to revolutions per minute.		-	
Status.I_act	Current motor current	INT16	Α	R/-
31:12 (1F:0C _h)	Unit: [0.1A]		-	
Status.UDC_act	Voltage power supply	UINT16	V	R/-
31:20 (1F:14 _h)	Unit [0.1V]		-	
Status.TPA_act 31:25 (1F:19 _h)	Power stage temperature	UINT16 20110	°C	R/-
Status.v_pref Speed of reference position Status.p_ref 31:28 (1F:1Ch)		INT32	Inc/s	R/-
Status.p_target	Target position of profile generator	INT32	Inc	R/-
31:30 (1F:1E _h)	Absolute position value of the profile generator, calculated on the basis of the relative and absolute position values specified.		-	
Status.p_profile	Actual position of profile generator	INT32	Inc	R/-
31:31 (1F:1F _h)	Corresponds to the reference position Status.p_ref.		-	
Status.p_actusr	Motor position	INT32	Inc	R/-
31:34 (1F:22 _h)	Parameter for improving compatibility with TwinLine. Corresponds to the actual position Status.p_act.		-	
Status.n_profile	Actual speed of profile generator	INT16	min ⁻¹	R/-
31:35 (1F:23 _h)	Corresponds to parameter Status.n_pref.		-	
Status.n_target 31:38 (1F:26 _h)	Target speed of profile generator	INT16	min ⁻¹ -	R/-
Status.n_pref	Speed of rotation of reference position Status.p_ref	INT16	min ⁻¹	R/-
31:45 (1F:2D _h)	Corresponds to parameter ${\tt Status.v_pref},$ but converted to revolutions per minute.		-	
Status.StopFault 32:7 (20:07 _h)	Cause of last interruption, error number	UINT16	0	R/-

Synchronous errors

In addition to asynchronous errors, synchronous errors are also signaled in fieldbus operation; they are caused by communication problems (e.g. unauthorized access or incorrect command).

Both types of errors are described in the fieldbus manual.

Error memory

The last 7 error messages are saved in a separate error memory. The error messages are sorted in chronological order and can be read via index and subindex. The last error that caused an interruption is also saved to the parameter Status.StopFault, 32:7.


Index:Subindex	Meaning
900:1, 900:2, 900:3	1st entry, oldest error message
901:1, 901:2, 901:3	2nd entry
906:1, 906:2, 906:3	7th entry, latest error message

More information on each error message can be obtained via subindices 1 \dots 5:

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
ErrMem0.ErrNum	Coded error number	UINT16	-	R/-
900:1 (384:01 _h)	Index 900: First error entry (oldest) Index 901: Next error entry		-	
	NOTE: Reading this parameter copies the entire error entry (9xx.1 - 9xx.5) to an intermediate memory from which all elements are then loaded.			
ErrMem0.Class	Error class	UINT16	-	R/-
900:2 (384:02 _h)	The error class determines the error response of the controller.	04	-	
ErrMem0.Age	Age of the error in device switch-on cycles	UINT32	-	R/-
900:3 (384:03 _h)	Value 0: Error occurred since the last switch-on of the device Value 1: Error occurred during last operation Value 2: Error occurred during last but one operation etc.		-	
ErrMem0.Repeat	Error repetitions	UINT16	-	R/-
900:4 (384:04 _h)	Number of consecutive errors with this error number:	0255	-	
	Value 0: Error occurred only once Value 1: 1 repetition Value 2: 2 repetitions etc.			
	When the maximum number of 255 is reached, the repetition counter is no longer incremented.			
ErrMem0.ErrQual	Error identifier	UINT16	-	R/-
900:5 (384:05 _h)	This entry contains additional information on the error.		-	
	The meaning depends on the error numer.			

9.1.3 Operation state and error indication

Status indication The LED shows error messages and warnings. It indicates the operating states in coded form.

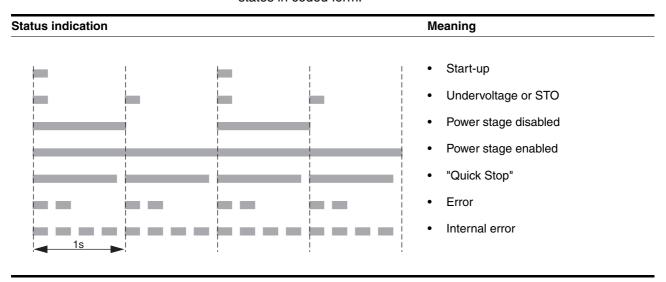

9.1.4 Reset error message

To reset the error message are correcting the fault, send a "Fault Reset" command via the fieldbus by writing the value 8 to the control word, parameter Commands.driveCtrl, 28:1. An error message can also be reset with the commissioning software.

9.1.5 Error classes and error response

Error class

The product triggers an error response in the event of a fault. Depending upon the severity of the fault, the device responds in accordance with one of the following error classes:

Error class	Reaction	Meaning
0	Warning	Message only, no interruption.
1	"Quick Stop"	Motor stops with "Quick Stop", power stage and controller remain switched on and enabled.
2	"Quick Stop" with switch-off	Motor stops with "Quick Stop", power stage and controller are disabled after standstill has been achieved.
3	Fatal error	Power stage and controller switch off immediately without stopping the motor first.
4	Uncontrolled operation	Power stage and controller switch off immediately without stopping the motor first. Error response can only be reset by switching off the device.

9.1.6 Causes of errors and troubleshooting

If communication via the fieldbus is impossible, proceed as follows:

- ▶ Open the connector housing cover
- Compare the behavior of LED with the information in the table below.

Error	Error class	Cause of error	Troubleshooting
Communication impossible	-	Incorrect communication parameters	Set the parameter switches correctly Set the parameters correctly
Communication unreliable	-	Missing terminating resistors Poor shielding of lines	Connect terminating resistors correctly Connect the shield correctly (see chapter 6 "Installation")
LED off	-	No supply voltage	Check supply voltage and fuses
LED flashes at 6 Hz	4	Incorrect flash checksum	Reinstall firmware or replace product
LED flashes at 10 Hz	4	Hardware error Internal system error Watchdog	Switch drive off and on Drive requires service

Error messages and warnings can be read out via the fieldbus.

Errors detected by internal monitoring are signaled by the corresponding bits in the parameter Status.FltSig_SR, 28:18.

The bits remain set even if the monitored limit values are no longer exceeded.

The bits can be cleared by a "Fault Reset".

Moni- toring bit	Error	Error class	Cause of error	Troubleshooting
0	Undervoltage 1	2	Supply voltage below threshold value for switching off the drive	Check voltage, check connections at the drive
1	Undervoltage 2	3	Supply voltage below threshold value for switching off the drive	Check voltage, check connections at the drive
2	Overvoltage	3	Overvoltage, regeneration condition	See chapter 5.1 "External power supply units"
5	Motor overload		Load torque too high Motor phase current set too high	Reduce load torque Reduce motor phase current
12	Power stage over- temperature	3	The power stage overheated Ambient temperature too high Poor heat dissipation	Improved heat dissipation via the motor flange
16	Blocking error	3	Drive blocked or stalled Movement frequency too high Acceleration too high	Reduce load torque or motor torque; check settings for motor phase cur- rent; Reduce movement frequency Reduce acceleration
17	Tracking error		Load torque too high Ramp too steep	Reduce load torque or motor torque; check settings for motor phase cur- rent; reduce speed; reduce accelera- tion
18	Encoderinoperative	4	Defective encoder	Drive requires service

O
č
ξ
č
٦
c
č
C
Č
ς
2
O
ĕ
ū
2
÷
٠
÷
÷
_
2
č
C
č
C

Moni- toring bit	Error	Error class	Cause of error	Troubleshooting
21	CAN/RS485 proto- col error			Check shield at serial cable Avoid ground loops
22	Nodeguard error	2	Serial connection or fieldbus connection interrupted	Check serial connection
25	Inputs of the STO safety function have 0 level	, 55		Check guard door, cabling
26	Inputs of the STO 4 safety function have different levels		Interruption of the signal wires	Check signal cable, check signal connection, replace
28	Hardware error EEPROM		Hardware error	Drive requires service
29	Start-up error		Hardware error	Drive requires service
	Drive remains in operating state 2		Start-up error caused by of improper parameterization; Incorrect EEPROM checksum	Initialization of the parameters with default values (parameter Commands.default 11:8). If this does not correct the problem, the drive must be serviced

The cause of the error can also be read out in the form of the error number in the parameter "Last cause of interruption" (parameter Status.StopFault, 32:7):

Error number	Error type	Cause of error/troubleshooting
013F _h	EEPROM not initialized	Hardware error / send product for service
0140 _h	EEPROM not compatible with current software	Hardware error / send product for service
0141 _h	EEPROM read error	Hardware error / send product for service
0142 _h	EEPROM write error	Hardware error / send product for service
0143 _h	Checksum error in EEPROM	Hardware error / send product for service
0148 _h	Serial interface: Overrun error	Check shield at serial cable, avoid ground loops
0149 _h	Serial interface: Framing error	Check shield at serial cable, avoid ground loops
014A _h	Serial interface: Parity error	Check shield at serial cable, avoid ground loops
014B _h	Serial interface: Receive error	Check shield at serial cable, avoid ground loops
014C _h	Serial interface: Buffer overflow	Check shield at serial cable, avoid ground loops
014D _h	Serial interface: Protocol error	Check shield at serial cable, avoid ground loops
014E _h	Nodeguarding	Serial connection interrupted.
0150 _h	Impermissible limit switch is active	Reference movement started in wrong direction? Limit switch incorrectly wired?
0151 _h	Switch was overtraveled	Parameter value for search speed for reference movement too high?
0152 _h	Switching edge not found	Parameter value for distance for moving away from switch for reference movement too low?

Error number	Error type	Cause of error/troubleshooting
0153 _h	Index pulse not found	Encoder/Hall sensor defective?
0154 _h	Reference movement to index pulse cannot be reproduced. Index pulse is too close to switch	Move switch or slightly turn motor shaft and re-mount motor
0155 _h	Switch still active after movement away from switch	Switch may bounce Set longer distance for moving away from switch
0157 _h	Interruption/QuickStopActive by LIMP	Limit switch was activated
0158 _h	Interruption or QuickStopActive by LIMN	Limit switch was activated
0159 _h	Interruption or QuickStop Active by REF	Reference switch was activated and is parameterized as interruption input
015A _h	Interruption or QuickStopActive by STOP	Stop input was activated and is parameterized as interrupt input

0198441113568, V2.00, 09.2008

9.2 Overview of error numbers

hex	dec	Error class	Description
0100 _h	256	2	Undervoltage 1 power supply
0101 _h	257	3	Undervoltage 2 power supply
0102 _h	258	3	Overvoltage power supply
0105 _h	261	3	Motor overload
010C _h	268	2	Power stage overtemperature
0110 _h	272	3	Motor blocked or stalled
0111 _h	273	3	Tracking error
0112 _h	274	4	Encoder defective
0115 _h	277	1	Protocol error fieldbus
0116 _h	278	2	Fieldbus: Nodeguarding/Watchdog or Clear
0117 _h	279	3	Frequency at pulse/direction input too high
0118 _h	280	3	Short circuit digital outputs
0119 _h	281	3	STO safety function triggered
011A _h	282	4	Inputs of the STO safety function have different levels (>1s)
011C _h	284	4	EEPROM hardware error
011D _h	285	4	Start-up error
011E _h	286	4	Internal system error
011F _h	287	4	Watchdog
0120 _h	288	0	Warning position overrun profile generator
0121 _h	289	0	Warning overtemperature IGBTs
0128 _h	296	0	Warning I/O timing
0130 _h	304	0	Parameter does not exist, invalid index
0131 _h	305	0	Parameter does not exist, invalid subindex
0132 _h	306	0	Communication protocol: Unknown service
0133 _h	307	0	Writing of parameter not permissible
0134 _h	308	0	Parameter value out of permissible range
0135 _h	309	0	Segment service not initialized
0136 _h	310	0	Error during recording function
0137 _h	311	0	State is not Operation Enable
0138 _h	312	0	Processing in current operating state not possible
0139 _h	313	0	Generation of reference position interrupted
013A _h	314	0	Switching impossible while operating mode is active
013B _h	315	0	Command not allowed during processing (xxxx_end=0)
013C _h	316	0	Error in selection parameter
013D _h	317	0	Position overrun
013E _h	318	0	Actual position is not yet defined
013F _h	319	4	EEPROM not initialized
0140 _h	320	4	EEPROM not compatible with current software

hex	dec	Error class	Description
0142 _h	322	4	EEPROM write error
0143 _h	323	4	Checksum error in EEPROM
0144 _h	324	0	Value cannot be calculated
0145 _h	325	0	Function only allowed at standstill
0146 _h	326	0	Reference movement is active
0147 _h	327	0	Command not allowed during processing (xxx_end=0)
0148 _h	328	1	RS485 interface: Overrun error
0149 _h	329	1	RS485 interface: Framing error
014A _h	330	1	RS485 interface: Parity error
014B _h	331	1	RS485 interface: Receive error
014C _h	332	1	RS485 interface: Buffer overflow
014D _h	333	1	RS485 interface: Protocol error
014E _h	334	1	Nodeguarding, interface no longer serviced
014F _h	335	0	"Quick Stop" state activated
0150 _h	336	1	Impermissible limit switch is active
0151 _h	337	1	Switch was overtraveled, moving away from switch impossible
0152 _h	338	1	Switching edge not found in distance for search for switching edge during movement away from switch
0153 _h	339	1	Index pulse not found
0154 _h	340	1	Unreliable reproducibility of the index pulse movement, index pulse too close to the switch
0155 _h	341	1	Switch still active after movement away from switch
0156 _h	342	1	Input not parameterized as LIMP/LIMN/REF
0157 _h	343	1	Interruption / "Quick Stop" by LIMP
0158 _h	344	1	Interruption / "Quick Stop" by LIMN
0159 _h	345	1	Interruption / "Quick Stop" by REF
015A _h	346	1	Interruption / "Quick Stop" by STOP
015B _h	347	1	Limit switch not released
015C _h	348	0	Processing not allowed in current operating mode
015D _h	349	0	Parameter not available with this device
015E _h	350	0	Function not available with this device
015F _h	351	0	Access denied
0160 _h	352	4	Production data in EEPROM not compatible with current software
0161 _h	353	4	Index pulse sensor not compensated
0162 _h	354	0	Drive is not referenced
0163 _h	355	0	CAN interface: COB-ID incorrect
0164 _h	356	0	CAN interface: Incorrect request
0165 _h	357	0	CAN interface: Overrun error
0166 _h	358	0	CAN interface: Telegram could not be saved
0167 _h	359	0	CAN interface: General error CAN stack
0168 _h	360	0	Fieldbus: Data type and parameter length do not match

hex	dec	Error class	Description	
0169 _h	361	0	Blocking detection is switched off	
016A _h	362	0	Connection to DSP boot loader not successful	
016B _h	363	0	Error in communication with DSP boot loader	
016C _h	364	0	Error initializing SPC3 memory	
016D _h	365	0	Error in calculation of the length of input/output data	
016E _h	366	0	Specified Profibus address is outside permissible range	
016F _h	367	0	Impermissible use of parameter switch S1.1	
0170 _h	368	0	OSP software not compatible with Profibus software	
0171 _h	369	0	hecksum of Profibus DP interface software incorrect	
0172 _h	370	0	Oscilloscope function: No other data available	
0173 _h	371	0	Oscilloscope function: Trigger variable was not defined	
0174 _h	372	0	Parameterization of oscilloscope function incomplete	
0175 _h	373	1	Internal communication	
0177 _h	375	1	Interruption / "Quick Stop" by software limit switch clockwise rotation	
0178 _h	376	1	Interruption / "Quick Stop" by software limit switch counterclockwise rotation	

10 Parameters

10.1 Representation of parameters

The way parameters are shown provides information required for unique identification of a parameter. In addition, information is provided on possible settings, defaults and parameter properties.

Parameters are represented as shown below:

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
Example.Name	Example	UINT16	-	R/W
12:34 (C:22 _h)		1127	127	per.

Group.Name

Parameter name consisting of the name of the parameter group (="Group") and the name of the specific parameter (="Name").

Default value

Factory setting.

Data type

The data type determines the valid range of values, especially if minimum and maximum values are not explicitly indicated for a parameter.

Data type	Byte	Min value	Max value
INT8	1 Byte / 8 Bit	-128	127
UINT8	1 Byte / 8 Bit	0	255
INT16	2 Byte / 16 Bit	-32768	32767
UINT16	2 Byte / 16 Bit	0	65535
INT32	4 Byte / 32 Bit	-2147483648	2147483647
UINT32	4 Byte / 32 Bit	0	4294967295

Unit The unit of the value.

R/W Indicates read and/or write values

"R/" values can only be read

"R/W" values can be read and written.

Persistent

"per." indicates whether the value of the parameter is persistent, i.e. whether it remains in the memory after the device is switched off. When changing a value via commissioning software or fieldbus, the user must explicitly store the changed value in the persistent memory.

10.2 Overview Parameters

CAN Settings CAN bus

Commands State change

Save parameters to EEPROM Initialize default parameters

Config Drive configurationControlController settings

ErrMem0 Error memory

Homing Operating mode "Homing"

I/O Status and definition of inputs and outputs

Manual Operating mode "Jog"

Motion Function "Definition of the direction of rotation"

Function "Quick Stop"
Default reference speed
Acceleration and deceleration

Profibus Settings Profibus

ProgIO0..3 Function "Programmable inputs/outputs"

PTP Operating mode "Profile Position"

RS485 Setting RS485 bus

Settings User-defined device name

Phase currents Monitoring inputs

Status Status information and read values

VEL Operating mode "Profile Velocity"

10.3 Parameter groups

10.3.1 Parameter group "CAN"

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
CAN.canAddr	Address CAN Bus	UINT16	-	R/W
23:2 (17:02 _h)	Permissible values 1127	1127	127	per.
CAN.canBaud	Baud rate CAN bus	UINT16	-	R/W
23:3 (17:03 _h)	The following values are permitted: Value 50: 50 kBaud Value 100: 100 kBaud Value 125 = 125 kBaud Value 250: 250 kBaud Value 500: 500 kBaud Value 800: 800 kBaud Value 1000: 1 MBaud	501000	125	per.
CAN.pdo4msk1	32 bit mask for process data change part 1	UINT32	- 4294967 295	R/W
30:9 (1E:09 _h)	32 bit mask for event-controlled PDO4:			
	This value allows you to mask bytes 14. In the case of event-controlled transmission, a message is sent whenever the T-PDO data changes. This mask lets you specify the transmission of messages in more detail or limit it. Changes for event-controlled transmission are ignored at all bits at which the mask contains a 0.			
	Assignment of bits: Bits 0 7: ioSignals Bits 815: modeStat Bits 16 23: warn Sig_SR FltSig cos Bits 24 31: x_end x_err x_info			
	The default value 4294967295 corresponds to FFFFFFFh.			
CAN.pdo4msk2	32 nit mask for process data change part 2	UINT32	-	R/W
30:10 (1E:0A _h)	32 bit mask for event-controlled PDO4: Mask for bytes 58. For a description see parameter CAN.pdo4msk1.		0	

10.3.2 Parameter group "Commands"

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
Com-	Save parameter values to EEPROM	UINT16	-	R/W
mands.eeprSave 11:6 (0B:06 _h)	Value 1: Save user-defined parameters		-	
	The currently set parameters are saved to the EEPROM The saving process is completed when the parameter Commands.stateSave, 11:7 returns 1.			
	NOTE: Saving is only possible when the drive is at standstill.			
Commands.state-	Save processing state of parameter to EEPROM	UINT16	-	R/-
Save 11:7 (0B:07 _h)	Saving process active Saving process completed		-	

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
Commands.default	Reset user-defined parameters	UINT16	-	R/W
11:8 (0B:08 _h)	Value 1: All user-defined parameters are initialized with their default values and saved to the EEPROM.		-	
	The default state only becomes active at the next start-up.			
	NOTE: Only possible if the drive is at standstill.			
Commands.state-	Processing state of parameter Commands.default	UINT16	-	R/-
Def 11:9 (0B:09 _h)	Basic initialization active Basic initialization completed		-	
Commands.driveC-	Control word	UINT16	-	R/W
trl 28:1 (1C:01 _h)	Assignment of bits: Bit 0: Disable power stage Bit 1: Enable power stage Bit 2: Quicktop Bit 3: FaultReset Bit 4: QuickStop-Release Bits 515: Reserved	031	0	
	Default bits 0 4: 0 A write access automatically triggers processing of the operating states.			
Commands.del_err 32:2 (20:02 _h)	Delete error memory	UINT16 -	-	R/W
	Write value 1: Delete all entries in error memory	11	1	

10.3.3 Parameter group "Config"

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
Config.PrgNo 1:1 (01:01 _h)	Firmware number	UINT32	-	R/-
	High word: Program number Low word: Program version		-	
	Example: PR802.10 High word: 802 Low word: 10			
Config.PrgVer	Firmware version	UINT32	-	R/-
1:2 (01:02 _h)	High word: Program version Low word: Program revision		-	
	Example: V1.003 High word: 1 Low word: 3			
Config.SerialNo1 1:20 (01:14 _h)	Serial number of the drive art 1	UINT16	-	R/-
	Digits 10-13 of the serial number To be represented as a decimal number.		-	
Config.SerialNo2 1:21 (01:15 _h)	Serial number of the drive art 2	UINT32	-	R/-
	Digits 1-9 of the serial number To be represented as a decimal number.		-	

10.3.4 Parameter group "Control"

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
Control.KPn 15:8 (0F:08 _h)	Speed controller P term	UINT16	A/min ⁻¹	R/W
	Unit: [0.0001 A/min ⁻¹]	032767		per.
Control.TNn 15:9 (0F:09 _h)	Speed controller integral action time	UINT16	ms	R/W
	Unit: [0.01 ms]	100032767		per.
Control.KPp 15:10 (0F:0A _h)	Position controller P term	UINT16	1/s	R/W
	Unit: [0.1 1/s]	032767		per.
Control.KFPp 15:11 (0F:0B _h)	Speed feed-forward control position controller	UINT16	-	R/W
	Value 32767: 100% compensation	032767	32767	per.

10.3.5 Parameter group "ErrMem0"

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
ErrMem0.ErrNum 900:1 (384:01 _h)	Coded error number	UINT16	-	R/-
	Index 900: First error entry (oldest) Index 901: Next error entry		-	
	NOTE: Reading this parameter copies the entire error entry (9xx.1 - 9xx.5) to an intermediate memory from which all elements are then loaded.			
ErrMem0.Class	Error class	UINT16	-	R/-
900:2 (384:02 _h)	The error class determines the error response of the controller.	04	-	
ErrMem0.Age	Age of the error in device switch-on cycles	UINT32	-	R/-
900:3 (384:03 _h)	Value 0: Error occurred since the last switch-on of the device Value 1: Error occurred during last operation Value 2: Error occurred during last but one operation etc.		-	
ErrMem0.Repeat	Error repetitions	UINT16	-	R/-
900:4 (384:04 _h)	Number of consecutive errors with this error number:	0255	-	
	Value 0: Error occurred only once Value 1: 1 repetition Value 2: 2 repetitions etc.			
	When the maximum number of 255 is reached, the repetition counter is no longer incremented.			
ErrMem0.ErrQual 900:5 (384:05 _h)	Error identifier	UINT16	-	R/-
	This entry contains additional information on the error.		-	
	The meaning depends on the error numer.			

10.3.6 Parameter group "Homing"

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
Homing.startHome	Start operating mode Homing	UINT16	-	R/W
40:1 (28:01 _h)	Action object: Write access triggers reference movement.	18	-	
	Value 1: LIMP Value 2: LIMN Value 3: REF counterclockwise direction of rotation Value 4: REF clockwise direction of rotation Value 7: Movement to block counterclockwise direction of rotation Value 8: Movement to block clockwise direction of rotation			

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
Homing.stateHome 40:2 (28:02 _h)	Acknowledgement: Homing	UINT16	-	R/-
	Assignment of bits: Bit 0: Error LIMP Bit 1: Error LIMN Bit 2: Error HW_STOP Bit 3: Error REF Bit 7: Error SW_STOP Bit 15: ref_err Bit 14: ref_end		-	
Homing.startSetp	Position setting to position setting position	INT32	Inc	R/W
40:3 (28:03 _h)	Action object: write access triggers position setting Only possible if the motor is at standstill.		-	
Homing.v_Home 40:4 (28:04 _h)	Speed of rotation for search of switch	UINT16 3005000	min ⁻¹ 1000	R/W per.
Homing.v_outHome 40:5 (28:05 _h)	Speed of rotation for moving away from switch	UINT16 3005000	min ⁻¹ 500	R/W per.
	Maximum distance for search for switching edge	INT32	Inc	R/W
40:6 (28:06 _h)	After detection of the switch, the drive starts to search for the defined switching edge. If it is not found within the distance defined here, the reference movement is canceled with an error.	1 2147483647	200000	per.
Homing.p_disHome	Distance from switching edge to reference point	INT32	Inc	R/W
40:7 (28:07 _h)	After the drive moves away from the switch, it is positioned into the working range by a defined distance; this is defined as the reference point.	1 2147483647	200	per.
Homing.RefSwMod	Processing sequence during reference movement to REF	UINT16	-	R/W
40:9 (28:09 _h)	Bit value 0: In positive direction Bit value 1: In negative direction	03 0	U	per.
	Assignment of bits: Bit 0: Direction of movement to switching edge Bit 1: Direction of movement to distance from switching edge			
Homing.RefAppPos	Application position at reference point	INT32	Inc	R/W
40:11 (28:0B _h)	After a successful reference movement, this position is set at the reference point. This automatically defines the application zero point.		0	per.
Homing.refError	Cause of error during reference movement	UINT16	-	R/-
40:13 (28:0D _h)	Error code during reference movement processing		-	

10.3.7 Parameter group "I/O"

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
I/O.IO_act	Status of digital inputs and outputs	UINT16	-	R/W
33:1 (21:01 _h)	Assignment of bits: Bit 0: IO0 Bit 1: IO1 Bit 2: IO2 Bit 3: IO3 Bit 4: STO_A (PWRR_A) Bit 5: STO_B (PWRR_B)	015 0	0	
	Reading returns the status of the inputs and outputs. Writing only changes the status of outputs.			
I/O.IO0_def	Configuration of IO0	UINT16	-	R/W
34:1 (22:01 _h)	Value 0: Input freely usable Value 1: Input LIMP (only with IO0) Value 2: Input LIMN (only with IO1) Value 3: Input STOP Value 4: Input REF Value 5: Input programmable Value 128: Output freely usable Value 130: Output programmable	0255	1	per.
I/O.IO1_def	Configuration of IO1	UINT16 - 0255 2		R/W
34:2 (22:02 _h)	See parameter IO0_def		2	per.
I/O.IO2_def	Configuration of IO2	UINT16	UINT16 -	R/W
34:3 (22:03 _h)	See parameter IO0_def	0255 3	per.	
I/O.IO3_def	Configuration of IO3	UINT16	T16 -	R/W
34:4 (22:04 _h)	See parameter IO0_def	0255 4	per.	
I/O.progDelay 34:7 (22:07 _h)	Delay time for programmed I/O processing	UINT16 Sec 060 0	R/W	
	After the drive is switched on, the function "programmable inputs and outputs" is only activated after the delay time set here.		per.	
	This allows you to lock manual operation of a system for a certain period during start-up until a fieldbus controller takes over.			

10.3.8 Parameter group "Manual"

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
Manual.startMan	Starting a jog	UINT16	-	R/W
41:1 (29:01 _h)	Assignment of bits: Bit 0: Clockwise direction of rotation Bit 1: Counterclockwise direction of rotation Bit 2: 0 = slow 1 = fast Bit 3: Automatic processing of power stage	015 0		
	If bit 3 is set to 1, a jog movement can be started even if the power stage is switched off: If the drive is in state 4 (Ready-ToSwitchOn), the power stage is automatically switched on when the jog movement is started and switched off when the movement is finished.			
Manual.stateMan	Acknowledgement: Jog	UINT16	UINT16 -	R/-
41:2 (29:02 _h)	Assignment of bits: Bit 0: Error LIMP Bit 1: Error LIMN Bit 2: Error HW_STOP Bit 3: Error REF Bit 7: Error SW_STOP Bit 14: manu_end Bit 15: manu_err			
Manual.n_slowMan 41:4 (29:04 _h)	Speed for slow jog	UINT16 3005000	min ⁻¹ 300	R/W per.
Manual.n_fastMan 41:5 (29:05 _h)	Speed for fast jog	UINT16 3005000	min ⁻¹ 1000	R/W per.
Manual.step_Man	Jogging distance at jog start	UINT16	Inc	R/W
41:7 (29:07 _h)	Value 0: Direct activation of continuous movement		2	per.
Manual.time_Man	Waiting time until continuous movement starts	UINT16	ms	R/W
41:8 (29:08 _h)	Only effective if jog distance is not set to equal 0.	110000	500	per.

10.3.9 Parameter group "Motion"

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
Motion.invertDir 28:6 (1C:06 _h)	Definition of direction of rotation	UINT16	-	R/W
	Value 0: Clockwise direction of rotation With positive reference values, the motor rotates clockwise (as you look at the end of the protruding motor shaft).	01	0	per.
	Value 1: Counterclockwise direction of rotation With positive reference values, the motor rotates counterclock- wise (as you look at the end of the protruding motor shaft).			
	NOTE: The new value is only activated when the drive is switched on.			
Motion.dec_Stop	Deceleration for "Quick Stop"	UINT32 min ⁻¹ /s 100010000 5000 0		R/W
28:21 (1C:15 _h)	Deceleration that is used for every "Quick Stop": - "Quick Stop" via control word - "Quick Stop" via external monitoring signal - "Quick Stop" via error of classes 1 and 2		per.	

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
Motion.v_target0 29:23 (1D:17 _h)	Speed of rotation for parameter PTP.v_tarPTP	UINT16 3005000	min ⁻¹ 1000	R/W
	Speed of rotation for Profile Position operating mode if no value was written to ${\tt PTP.v_tarPTP.}$			per.
	NOTE: This persistent value is only used as a default assignment for ${\tt PTP.v_tarPTP}$ during switching on.			
Motion.acc 29:26 (1D:1A _h)	Acceleration	UINT32 min ⁻¹ /s 100010000 2500 0		R/W
	Value determines acceleration and deceleration. New values do not become effective until after standstill.		2500	per.

10.3.10 Parameter group "Profibus"

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
Profibus.MapOut 24:2 (18:02 _h)	Value in PZD5+6 to product	UINT32	-	R/W
	Index and subindex of the object that is mapped to the PPO2 during data transfer from the master to the vproduct. By default, the reference acceleration is mapped.	See text left	per.	
	Possible values: 00000000 _h : Mapping not active 001A001D _h : reference acceleration (29:26) 00010021 _h : digital outputs (33:1)			
	Low word: index mapped object High word: subindex mapped object			
Profibus.MapIn	Value in PZD5+6 to master	UINT32	-	R/W
24:3 (18:03 _h)	Index and subindex of the object that is mapped during data transfer from the product to the master to the PPO2. By default, mapping is not active.		0	per.
	Possible values: 0000000_h : Mapping not active 00070020_h : Error number (32:7) $0009001F_h$: Actual speed of rotation (31:9) $0019001F_h$: Temperature power stage (31:25) $0014001F_h$: Supply voltage (31:20) $000C001F_h$: Current motor current (31:12)			
	Low word: index mapped object High word: subindex mapped object			
Profibus.PkInhibit	Update cycle for static read requests	UINT32	ms	R/W
24:4 (18:04 _h)	In the case of a static read request, the read value is cyclically updated according to the time defined with this parameter.	160000	1000	per.
Profibus.SafeState	Response to 'Clear' and watchdog	UINT32	-	R/W
24:5 (18:05 _h)	Response of the drive in state 'Clear' of the ProfibusDP master and response to termination of the watchdog.	01	1	per.
	Value 0: No response Value 1: Error of class 2, drive switches to FAULT if the power stage was active.			

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
Profibus.profiAddr 24:13 (18:00D _h)	Profibus address	UINT32	-	R/-
	Address set with the parameter switches		-	

10.3.11 Parameter group "ProgIO0"



The meanings for parameter groups "ProgIO0" (Index 800), "ProgIO1" (Index 801), "ProgIO2" (Index 802), "ProgIO3" (Index 803) are identical.

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
ProgIO0.Index 800:1 (320:01 _h)	Index of the control parameter	UINT16	-	R/W
	If prog. input: index of parameter to be written		-	per.
	If prog. output: index of parameter to be read			
	If prog. input: write(Index,Subindex) = (read(Index,Subindex) BAND BitMask) BOR VALUEx			
	If prog. output: 1 level at output if (read(Index,Subindex) BAND BitMask) =<> VALUE1			
ProgIO0.Subindex	Subindex of control parameter	UINT16	-	R/W
800:2 (320:02 _h)	If prog. input: subindex of parameter to be written If prog. output: subindex of parameter to be read		-	per.
ProgIO0.BitMask	Bitmask for the parameter value	UINT32	-	R/W
800:3 (320:03 _h)	If programmable input or programmable output: Bit mask used to link the read value (index, subindex) of the parameter with the operator AND before the value is processed.		-	per.
ProgIO0.Switch	Edge detection and comparison operator	UINT16	-	R/W
800:4 (320:04 _h)	If programmable input: Selection of the edges to be detected Value 0: No response to level change Value 1: Response to rising edge Value 2: Response to falling edge Value 3: Response to both edges		-	per.
	If programmable output: Selection of condition for comparison: Value 0: (parameter read value = comparison value) Value 1: (parameter read value <> comparison value) Value 2: (parameter read value < comparison value) Value 0: (parameter read value > comparison value)			
ProglO0.Value1	Write Write value at rising edge and comparison value	INT32	-	R/W
800:5 (320:05 _h)	If programmable input: Parameter write value at rising edge	0 4294967295	-	per.
	If programmable output: Comparison value for condition			

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
ProglO0.Value2 800:6 (320:06 _h)	Write value at falling edge	INT32	-	R/W
	If programmable input: Parameter write value at falling edge	0 4294967295	-	per.
	If programmable output: no meaning			

10.3.12 Parameter group "PTP"

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
PTP.p_absPTP	Target position for absolute positioning and start of positioning	INT32	Inc	R/W
35:1 (23:01 _h)	Action object: write access triggers absolute positioning in increments		-	
PTP.StatePTP 35:2 (23:02 _h)	Acknowledgement: Profile Position Assignment of bits: Bit 0: Error LIMP Bit 1: Error LIMN Bit 2: Error STOP Bit 3: Error REF Bit 7: SW_STOP Bit 13: Target position reached Bit 14: ptp_end Bit 15: ptp_err	UINT16	-	R/-
PTP.p_relPTP 35:3 (23:03 _h)	Target position for relative positioning and start of positioning Action object: write access triggers relative positioning in increments	INT32	Inc -	R/W
PTP.continue 35:4 (23:04 _h)	Continue interrupted positioning The target position was specified with the previous positioning command. The value indicated here is not relevant for positioning.	UINT16	- 0	R/W
PTP.v_tarPTP 35:5 (23:05 _h)	Target speed of rotation for positioning Positioning can be temporarily stopped with value 0. The default value is the value of parameter Motion.v_target0. The minimum speed of rotation is 300 min ⁻¹ .	UINT16 min ⁻¹ 05000 1000	R/W	

10.3.13 Parameter group "RS485"

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
RS485.timeout 1:11 (01:00B _h)	Node Guard Timer Value 0: Connection monitoring active Value >0: Connection monitoring active, time in milliseconds	UINT16 010000	ms 0	R/W
	Value is automatically set to 0 after a nodeguard error.			

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
RS485.serBaud 22:1 (16:01 _h)	Baud rate	UINT16	-	R/W
	The following values are permitted: Value 9600: 9600 Baud Value 19200: 19200 Baud Value 38400: 38400 Baud	038400	9600	per.
RS485.serAdr	Address	UINT16	- 1	R/W
22:2 (16:02 _h)	Permissible values 131	131		per.
RS485.serFormat 22:3 (16:03 _h)	Data format Assignment of bits: Bit 0: 0 = no parity, 1 = parity on Bit 1: 0 = parity even, 1 = parity odd Bit 2: 0 = 7 data bits, 1 = 8 data bits Bit 3: 0 = 1 stop bit, 1 = 2 stop bits	UINT16 015	- 0	R/W per.
	Default is 0 = 7-E-1			

10.3.14 Parameter group "Settings"

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
Settings.name1 11:1 (0B:01 _h)	User device name part 1	UINT32	-	R/W
	Default = 538976288 = 20202020 _h = 4 spaces		5389762 88	per.
	User-programmable designation in the form of a text with a length of 8 characters			
Settings.name2	User device name part 2	UINT32	-	R/W
11:2 (ŏB:02 _h)	Default = 538976288 = 20202020 _h = 4 spaces		5389762 88	per.
	User-programmable designation in the form of a text with a length of 8 characters			
Settings.I_max	Maximum current for normal operation	UINT16	Α	R/W
15:3 (0F:03 _h)	The current limitation can be set as required by the system. The default value is the maximum current of the parameter Config.I_maxDrv. Unit: [0.1A]	0100	-	per.
Settings.I_maxBlk	Maximum current for reference movement to block	UINT16 A 0100 20		R/W
15:5 (0F:05 _h)	Currrent limitation for the operating mode Homing with the homing method "Reference movement to block". Unit: [0.1A]		20	per.
Settings.p_maxDiff 15:7 (0F:07 _h)	Maximum permissible position deviation of the position control- ler	UINT16 1600	Inc 24	R/W per.
Settings.T_block	Response time of blocking monitoring	UINT16	ms	R/W
15:12 (0F:0C _h)	If, in spite of maximum current, the motor shaft does not move for the time set with this parameter, the monitoring system signals a blocking error. A value of 0 deactivates blocking monitoring.	010000	100	per.
Settings.p_win	Standstill window, permissible control deviation	UINT16	16	R/W
15:15 (0F:0F _h)	See parameter Settings.p_winTime	032767		per.

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
Settings.p_winTime	Standstill window, time	UINT16	0	R/W
15:16 (0F:10 _h)	The control deviation p_dif must be within the position window for this period of time for the movement to be detected as finished. This is signalled by the x_end bit in the status word. Value 0: Standstill window deactivated	032767		per.
	Response to position overtravel	UINT16	-	R/W
28:11 (1C:0B _h)	Value 0: Set warning bit in status word Value 1: Do not set warning bit in status word	01	0	per.
Settings.SignEnabl	Activation of monitoring inputs	UINT16	-	R/W
28:13 (1C:0D _h)	Bit value 0: Monitoring is not active Bit value 1: Monitoring is active	015	3	per.
	Assignment of bits: Bit 0: LIMP (positive limit switch) Bit 1: LIMN (negative limit switch) Bit 2: STOP (STOP switch) Bit 3: REF (reference switch)			
	NOTE: Monitoring is only active if the I/O port is configured as the corresponding function (parameter I/O.IO0_def to IO3_def).			
Settings.SignLevel	Signal level for monitoring inputs	UINT16	-	R/W
28:14 (1C:0E _h)	Used to define whether errors are triggered at 0 or 1 level.	015	0	per.
	Bit value 0: Response at 0 level Bit value 1: Response at 1 level			
	Assignment of bits: Bit 0: LIMP Bit 1: LIMN Bit 2: STOP Bit 3: REF			
Settings.Flt_pDif	Error response to tracking error	UINT16	-	R/W
28:24 (1C:18 _h)	Value 1: Error class 1 Value 2: Error class 2 Value 3: Error class 3	03	3	per.

10.3.15 Parameter group "Status"

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
Status.p_difPeak	Maximum position deviation reached	UINT32	Inc	R/-
15:13 (0F:0D _h)	The value is updated an ongoing basis. The parameter value is set to the current position deviation value by writing 0.	0 2147483647	0	

~	
۳	
≻	
α C C	
g	١
Č	
5	
Ē	
9	۱
>	
2502	
u	
Ц	
ᠬ	
_	
_	
т	
$\overline{}$	
$\overline{}$	
α	
ά	į
Ξ	
c	

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
Status.driveStat 28:2 (1C:02 _h)	Status word for the operating state LOW-UINT16: Assignment of bits: Bits 0 3: Current operating state Bit 4: reserved Bit 5: Error detected by internal monitoring Bit 6: Error detected by external monitoring Bit 7: Warning active Bits 8 11: Reserved Bits 12 15: Operating-mode specific coding Corresponds to the assignment of bits 1215 in the operating mode-specific acknowledgement data. HIGH-UINT16: Assignment see parameter Status.xMode_act.	UINT32	-	R/-
Status.xMode_act 28:3 (1C:03 _h)	Current operating mode with additional information Assignment of bits: Bits 03: Current operating mode (see below) Bit 4: reserved Bit 5: Drive referenced (ref_ok) Bits 6 15: Reserved Values for bits 0 3: Value 1: Jog Value 2: Homing Value 3: Profile Position Value 4: Profile Velocity Other numbers are reserved for future extensions.	UINT16	-	R/-
Status.WarnSig 28:10 (1C:0A _h)	Warnings Monitoring signals with error class 0. Assignment of bits: Bit 0: Position overrun profile generator Bit 1: Temperature of power stage >100°C Bit 5: I²t limitation active Bit 9: Position deviation with power stage disabled The remaining bits are reserved for later extensions. The remaining bits are reserved for future extensions.	UINT16	-	R/-
Status.Sign_SR 28:15 (1C:0F _h)	Stored signal status of external monitoring signals Bit value 0: not activated Bit value 1: activated Assignment of bits: Bit 0: LIMP Bit 1: LIMN Bit 2: STOP Bit 3: REF Bit 7: SW stop Stored signal status of released external monitoring signals	UINT16 015	-	R/-
Status.FltSig 28:17 (1C:11 _h)	Active monitoring signals The error bits remain set as long as the error persists (i.e. as long as the limit value is exceeded). Assignment as parameter Status.FltSig_SR	UINT32	- -	R/-

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
Status.FltSig_SR	Stored monitoring signals	UINT32	-	R/-
28:18 (1C:12 _h)	Error bits remain set until a FaultReset is executed.		-	
	Assignment of bits: Bit 0: Undervoltage 1 power supply Bit 1: Undervoltage 2 power supply Bit 2: Overvoltage power supply Bit 5: Motor overload Bit 12: Overtemperature power stage (≥105°C) Bit 16: Blocking error Bit 17: Tracking error Bit 17: Tracking error Bit 18: Encoder inoperative Bit 21: Protocol error fieldbus Bit 22: Nodeguard error Bit 23: Pulse/directing input timing Bit 25: STO safety function triggered Bit 26: Signals of the STO safety function have different levels Bit 29: Start-up error Bit 30: Internal system error Bit 31: Watchdog			
Status.action_st	Action word	UINT16	-	R/-
28:19 (1C:13 _h)	Assignment of bits: Bit 0: Bit latched error class 0 Bit 1: Bit latched error class 1 Bit 2: Bit latched error class 2 Bit 3: Bit latched error class 3 Bit 4: Bit latched error class 4 Bit 5: reserved Bit 6: Motor at standstill: actual speed of rotation is zero Bit 7: Motor rotates clockwise Bit 8: Motor rotates counterclockwise Bit 9: reserved Bit 10: reserved Bit 11: Motor at standstill: reference speed of rotation is 0 Bit 12: Motor decelerates Bit 13: Motor accelerates Bit 14: Motor moves at constant speed Bit 15: reserved			
Settings.SwLimP 29:4 (1D:04 _h)	Positive position limit for software limit switch	INT32	Inc 0	R/W per.
Settings.SwLimN 29:5 (1D:05 _h)	Negative position limit for software limit switch	INT32	Inc 0	R/W per.
Status.SwLimEna	Monitoring of software limit switches	UINT16	-	R/W
29:6 (1D:06 _h)	Value 0: None Value 1: Enable software limit switch clockwise direction of rotation Value 2: Enable software limit switch counterclockwise direction of rotation Value 3: Enable software limit switches both directions of rotation	03	0	per.
	The software limit switches are only available for drives with multiturn encoders.			

С	С
	_
C	3
c	١
Č	-
۶	4
•	_
,	_
S	=
C	\
-	5
_	_
c	r
č	ř
ì	~
000	Ÿ
	_
7	_
÷	_
÷	
_	4
ċ	ř
0	200
Ì	_
ċ	_
•	_

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
Status.ModeError 30:11 (1E:0B _h)	Manufacturer-specific error code that caused the ModeError flag to be set.		- 0	R/-
	Usually, this is an error that was caused by the activation of an operating mode.			
Status.v_ref	Reference speed	INT32	Inc/s	R/-
31:1 (1F:01 _h)	Reference value of speed controller		-	
Status.v_act	Actual speed of motor		Inc/s	R/-
31:2 (1F:02 _h)	The speed captured by the encoder.		-	
Status.p_ref	Reference position	INT32	Inc	R/-
31:5 (1F:05 _h)	Reference value of position controller.		-	
Status.p_act	Actual position of motor	INT32	Inc	R/-
31:6 (1F:06 _h)	The motor position captured by the encoder.		-	
Status.p_dif 31:7 (1F:07 _h)	Position deviation of position controller	INT32	Inc -	R/-
Status.n_ref	Reference speed	INT16	min ⁻¹	R/-
31:8 (1F:08 _h)	Reference value of speed controller		-	
Status.n_act	Actual speed of motor	INT16	min ⁻¹	R/-
31:9 (1F:09 _h)	Corresponds to parameter ${\tt Status.v_act},$ but converted to revolutions per minute.		-	
Status.I_act	Current motor current	INT16	Α	R/-
31:12 (1F:0C _h)	Unit: [0.1A]		-	
Status.UDC_act	Voltage power supply	UINT16	V	R/-
31:20 (1F:14 _h)	Unit [0.1V]		-	
Status.TPA_act 31:25 (1F:19 _h)	Power stage temperature	UINT16 20110	°C	R/-
Status.v_pref 31:28 (1F:1C _h)	Speed of reference position Status.p_ref	INT32	Inc/s -	R/-
Status.p_target	Target position of profile generator	INT32	Inc	R/-
31:30 (1F:1E _h)	Absolute position value of the profile generator, calculated on the basis of the relative and absolute position values specified.		-	
Status.p_profile	Actual position of profile generator	INT32	Inc	R/-
31:31 (1F:1F _h)	Corresponds to the reference position Status.p_ref.		-	
Status.p_actusr	Motor position	INT32	Inc	R/-
31:34 (1F:22 _h)	Parameter for improving compatibility with TwinLine. Corresponds to the actual position Status.p_act.		-	
Status.n_profile	Actual speed of profile generator	INT16	min ⁻¹	R/-
31:35 (1F:23 _h)	Corresponds to parameter Status.n_pref.		-	
Status.n_target 31:38 (1F:26 _h)			min ⁻¹ -	R/-
Status.n_pref	Speed of rotation of reference position Status.p_ref	INT16	min ⁻¹	R/-
31:45 (1F:2D _h)	Corresponds to parameter ${\tt Status.v_pref}$, but converted to revolutions per minute.		-	

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
Status.StopFault 32:7 (20:07 _h)	Cause of last interruption, error number	UINT16	0	R/-

10.3.16 Parameter group "VEL"

Group.Name Index:Subindex dec. (hex.)	Description Bit assgnment	Data type range dec.	Unit Default dec.	R/W per.
VEL.velocity	Start with target speed	INT16	min ⁻¹	R/W
36:1 (24:01 _h)	Action object: write access triggers a movement	-50005000	-	
	The minimum speed of rotation is 300 min ⁻¹ .			
VEL.stateVEL	Acknowledgement: Profile Velocity	UINT16	-	R/-
Acknowledgement: Profile Velocity 36:2 (24:02 _h) Assignment of bits: Bit 0: Error LIMP Bit 1: Error LIMN Bit 2: Error STOP Bit 3: Error REF Bit 7: SW_STOP Bit 13: Target speed reached Bit 14: vel_end Bit 15: vel err			-	

11 Accessories and spare parts

11.1 Accessories

Source commissioning software The latest version of the commissioning software is available for down-

load from the internet:

http://www.schneider-electric.com

Source EPLAN Macros For easier engineering, macro files and product master data are availa-

ble for download from the Internet at:

http://www.schneider-electric.com

Designation	Order no.
Braking Resistor Controller UBC60	ACC3EA001
Installation kit	VW3L10111
Insert with cable entry (2 pcs)	VW3L10100N2
Insert with cable entry (10 pcs)	VW3L10100N10
Cable entry for commissioning	VW3L10222
Insert for sealing (10 pcs)	VW3L10000N10
Insert for sealing (20 pcs)	VW3L10000N20
Insert for sealing (50 pcs)	VW3L10000N50
Cable for commissioning interface, 3m	VW3L1R000R30
Insert kit for commissioning	VW3L1R000
Cable kit, power supply, CANopen, 3m	VW3L2F001R30
Cable kit, power supply, RS485, 3m	VW3L2R001R30
Cable kit, power supply, PROFIBUS DP, 3m	VW3L2B001R30
Cable kit, STO, 3m	VW3L20010R30
Cable kit, STO, 5m	VW3L20010R50
Cable kit, STO, 10m	VW3L20010R100
Cable kit, STO, 15m	VW3L20010R150
Cable kit, STO, 20m	VW3L20010R200
Cable, power supply, 3m	VW3L30001R30
Cable, power supply, 5m	VW3L30001R50
Cable, power supply, 10m	VW3L30001R100
Cable, power supply, 15m	VW3L30001R150
Cable, power supply, 20m	VW3L30001R200
Cable, STO, 3m	VW3L30010R30
Cable, STO, 5m	VW3L30010R50
Cable, STO, 10m	VW3L30010R100
Cable, STO, 15m	VW3L30010R150
Cable, STO, 20m	VW3L30010R200
Connector kit, PROFIBUS DP (2 pcs)	VW3L5B000
Connector kit, CANopen/RS485 (2 pcs)	VW3L5F000

Designation	Order no.
Connector kit, 2 x I/O	VW3L50200
Connector kit, 3 x I/O	VW3L50300
Connector, STO output	VW3L50010
Insert kit, 3 x I/O	VW3L40300
Insert kit, 2 x I/O, 1 x STO input	VW3L40210
Insert kit, 1 x STO input, 1 x STO output	VW3L40020
Insert kit, 4 x I/O, 1 x STO input, 1 x STO output	VW3L40420

Cable Supplier recommendations:

 Profibus cable, both ends pre-assembled, 5 poles, B-coded Male M12 to female M12

Vendor: Lumberg, www.lumberg.de Order no.: 0975 254 101 / ... M

 Profibus cable, both ends pre-assembled, 5 poles, B-coded Female M12 to SubD connector 9 poles with activatable terminating resistor

Vendor: Lumberg, www.lumberg.de Order no.: 0975 254 104 / ... M

 Profibus cable, both ends pre-assembled, 5 poles, B-coded Male M12 to SubD connector 9 poles with activatable terminating resistor

Vendor: Lumberg, www.lumberg.de Order no:: 0975 254 105 / ... M

Tool The tools required for cable assembly must be ordered directly from the manufacturer.

- Crimping tool for CN1: AMP 654174-1
- Crimping tool for CN2, CN4 and CN5: Molex 69008-0982
- Crimping tool for CN3: Molex 69008-0724
- Extraction tool for CN2, CN4 and CN5: Molex 11-03-0043
- Extraction tool for CN3: Molex 11-03-0044

Converter

An RS232/USB to RS485 converter is required for service and to upgrade the operating system.

- NuDAM converter RS232-RS485: Acceed ND-6520
- NuDAM converter USB-RS485: Acceed ND-6530

11.2 Gearboxes

Designation	Order no.
Planetary gear for Lexium Integrated Drive ILExx661, ratio 3/1	GBX040003E661L
Planetary gear for Lexium Integrated Drive ILExx661, ratio 5/1	GBX040005E661L
Planetary gear for Lexium Integrated Drive ILExx661, ratio 8/1	GBX040008E661L
Planetary gear for Lexium Integrated Drive ILExx661, ratio 16/1	GBX060016E661L
Planetary gear for Lexium Integrated Drive ILExx661, ratio 40/1	GBX060040E661L
Planetary gear for Lexium Integrated Drive ILExx662, ratio 3/1	GBX040003E662L
Planetary gear for Lexium Integrated Drive ILExx662, ratio 5/1	GBX040005E662L
Planetary gear for Lexium Integrated Drive ILExx662, ratio 8/1	GBX040008E662L
Planetary gear for Lexium Integrated Drive ILExx662, ratio 16/1	GBX060016E662L
Planetary gear for Lexium Integrated Drive ILExx662, ratio 40/1	GBX060040E662L

12 Service, maintenance and disposal

A CAUTION

DAMAGE TO SYSTEM COMPONENTS AND LOSS OF CONTROL

Interruptions of the negative connection of the controller supply voltage can cause excessively high voltages at the signal connections.

- Do not interrupt the negative connection between the power supply unit and load with a fuse or switch.
- Verify correct connection before switching on.
- Do not connect the controller supply voltage or change its wiring while the is supply voltage present.

Failure to follow these instructions can result in injury or equipment damage.

A CAUTION

RISK OF INJURY WHEN REMOVING CIRCUIT BOARD PLUGS

- · When removing them note that the connectors must be unlocked.
 - Supply voltage VDC:
 Unlock by pulling at the plug housing
 - Miscellaneous:
 Unlock by pressing the locking lever
- Always hold the plug to remove it (not the cable).

Failure to follow these instructions can result in injury or equipment damage.



The product may only be repaired by a certified customer service center. No warranty or liability is accepted for repairs made by unauthorized persons.

12.1 Service address

If you cannot resolve an error yourself please contact your sales office. Have the following details available:

- Nameplate (type, identification number, serial number, DOM, ...)
- Type of error (such as LED flash code or error number)
- Previous and concomitant circumstances
- · Your own assumptions concerning the cause of the error

Also include this information if you return the product for inspection or repair.



If you have any questions please contact your sales office. Your sales office staff will be happy to give you the name of a customer service office in your area.

http://www.schneider-electric.com

12.2 Maintenance

Check the product for pollution or damage at regular intervals, depending on the way you use it.

12.2.1 Lifetime STO safety function

The STO safety function is designed for a lifetime of 20 years. After this period, the data of the safety function are no longer valid. The expiry date is determined by adding 20 years to the DOM shown on the name-plate.

► This date must be included in the maintenance plan of the system.

Do not use the safety function after this date.

Example

The DOM on the nameplate of the device is shown in the format DD.MM.YY, e.g. 31.12.07. (December 31, 2007). This means: Do not use the safety function after December 31, 2027.

12.3 Replacing units

▲ WARNING

UNINTENDED BEHAVIOR

The behavior of the drive system is governed by numerous stored data or settings. Unsuitable settings or data may trigger unexpected movements or responses to signals and disable monitoring functions.

- Do NOT operate the drive system with unknown settings or data.
- · Verify that the stored data and settings are correct.
- When commissioning, carefully run tests for all operating states and potential fault situations.
- Verify the functions after replacing the product and also after making changes to the settings or data.
- Only start the system if there are no persons or obstructions in the hazardous area.

Failure to follow these instructions can result in death, serious injury or equipment damage.

Observe the following procedure when replacing devices.

- ► Save all parameter settings to your PC using the commissioning software, see chapter 7.3 "Lexium CT commissioning software".
- ► Switch off all supply voltages. Verify that no voltages are present (safety instructions).
- ▶ Label all connections and uninstall the product.
- ▶ Note the identification number and the serial number shown on the product nameplate for later identification.
- Install the new product as per chapter 6 "Installation"
- Commission the product as per chapter 7 "Commissioning".

12.4 Shipping, storage, disposal

Disposal

Removal procedure:

- Switch off the power supply.
- ▶ Disconnect the power supply.
- Pull out all plugs.
- ▶ Remove the product from the system.

Shipping The product must be protected against shocks during transportation. If possible, use the original packaging for shipping.

Storage The product may only be stored in spaces where the specified permissible ambient conditions for room temperature and humidity are met.

Protect the product from dust and dirt.

The product consists of various materials that can be recycled and must be disposed of separately. Dispose of the product in accordance with local regulations.

0198441113568, V2.00, 09.2008

13 Glossary

13.1 Units and conversion tables

The value in the specified unit (left column) is calculated for the desired unit (top row) with the formula (in the field).

Example: conversion of 5 meters [m] to yards [yd] 5 m / 0.9144 = 5.468 yd

13.1.1 Length

	in	ft	yd	m	cm	mm
in	-	/ 12	/ 36	* 0.0254	* 2.54	* 25.4
ft	* 12	-	/ 3	* 0.30479	* 30.479	* 304.79
yd	* 36	* 3	-	* 0.9144	* 91.44	* 914.4
m	/ 0.0254	/ 0.30479	/ 0.9144	-	* 100	* 1000
cm	/ 2.54	/ 30.479	/ 91.44	/ 100	-	* 10
mm	/ 25.4	/ 304.79	/ 914.4	/ 1000	/ 10	-

13.1.2 Mass

	lb	oz	slug	kg	g
lb	-	* 16	* 0.03108095	* 0.4535924	* 453.5924
oz	/ 16	-	* 1.942559*10 ⁻³	* 0.02834952	* 28.34952
slug	/ 0.03108095	/ 1.942559*10 ⁻³	-	* 14.5939	* 14593.9
kg	/ 0.453592370	/ 0.02834952	/ 14.5939	-	* 1000
g	/ 453.592370	/ 28.34952	/ 14593.9	/ 1000	-

13.1.3 Force

lb	oz	р	dyne	N
-	* 16	* 453.55358	* 444822.2	* 4.448222
/ 16	-	* 28.349524	* 27801	* 0.27801
/ 453.55358	/ 28.349524	-	* 980.7	* 9.807*10 ⁻³
/ 444822.2	/ 27801	/ 980.7	-	/ 100*10 ³
/ 4.448222	/ 0.27801	/ 9.807*10 ⁻³	* 100*10 ³	-
	- / 16 / 453.55358 / 444822.2	- * 16 / 16 - / 453.55358 / 28.349524 / 444822.2 / 27801	- * 16 * 453.55358 / 16 - * 28.349524 / 453.55358 / 28.349524 - / 444822.2 / 27801 / 980.7	- * 16

13.1.4 Power

	HP	W
HP	-	* 745.72218
W	/ 745.72218	-

13.1.5 Rotation

	min ⁻¹ (RPM)	rad/s	deg./s	
min ⁻¹ (RP	PM) -	* π / 30	* 6	
rad/s	* 30 / π	-	* 57.295	
deg./s	/ 6	/ 57.295	-	

13.1.6 Torque

	lb∙in	lb⋅ft	oz∙in	Nm	kp⋅m	kp⋅cm	dyne⋅cm
lb∙in	-	/ 12	* 16	* 0.112985	* 0.011521	* 1.1521	* 1.129*10 ⁶
lb·ft	* 12	-	* 192	* 1.355822	* 0.138255	* 13.8255	* 13.558*10 ⁶
oz∙in	/ 16	/ 192	-	* 7.0616*10 ⁻³	* 720.07*10 ⁻⁶	* 72.007*10 ⁻³	* 70615.5
Nm	/ 0.112985	/ 1.355822	/ 7.0616*10 ⁻³	-	* 0.101972	* 10.1972	* 10*10 ⁶
kp⋅m	/ 0.011521	/ 0.138255	/ 720.07*10 ⁻⁶	/ 0.101972	-	* 100	* 98.066*10 ⁶
kp⋅cm	/ 1.1521	/ 13.8255	/ 72.007*10 ⁻³	/ 10.1972	/ 100	-	* 0.9806*10 ⁶
dyne⋅cm	/ 1.129*10 ⁶	/ 13.558*10 ⁶	/ 70615.5	/ 10*10 ⁶	/ 98.066*10 ⁶	/ 0.9806*10 ⁶	-

13.1.7 Moment of inertia

•	lb⋅in ²	lb⋅ft²	kg⋅m²	kg⋅cm²	kp⋅cm⋅s²	oz∙in ²
lb⋅in ²	-	/ 144	/ 3417.16	/ 0.341716	/ 335.109	* 16
lb⋅ft ²	* 144	-	* 0.04214	* 421.4	* 0.429711	* 2304
kg⋅m²	* 3417.16	/ 0.04214	-	* 10*10 ³	* 10.1972	* 54674
kg⋅cm ²	* 0.341716	/ 421.4	/ 10*10 ³	-	/ 980.665	* 5.46
kp⋅cm⋅s²	* 335.109	/ 0.429711	/ 10.1972	* 980.665	-	* 5361.74
oz∙in²	/ 16	/ 2304	/ 54674	/ 5.46	/ 5361.74	-

13.1.8 Temperature

	°F	°C	К
°F	-	(°F - 32) * 5/9	(°F - 32) * 5/9 + 273.15
°C	°C * 9/5 + 32	-	°C + 273,15
K	(K - 273.15) * 9/5 + 32	K - 273.15	-

13.1.9 Conductor cross section

AWG	1	2	3	4	5	6	7	8	9	10	11	12	13
mm ²	42.4	33.6	26.7	21.2	16.8	13.3	10.5	8.4	6.6	5.3	4.2	3.3	2.6
AWG	14	15	16	17	18	19	20	21	22	23	24	25	26
mm ²	2.1	1.7	1.3	1.0	0.82	0.65	0.52	0.41	0.33	0.26	0.20	0.16	0.13

13.2 Terms and Abbreviations

AC Alternating current

ASCII American Standard Code for Information Interchange. Standard for cod-

ing of characters

Blocking detection Blocking detection monitors the max. current, the time and the rotation

of the motor shaft. If, in spite of maximum current, the motor shaft does not move for a parameterized time, the monitoring system signals a

blocking error.

CAN (Controller Area Network), standardized open fieldbus as per ISO

11898, allows drives and other devices from different manufacturers to

communicate.

DC Direct current

Default value Factory setting.

Direction of rotation Rotation of the motor shaft in a clockwise or counterclockwise direction

of rotation. Clockwise rotation is when the motor shaft rotates clockwise

as you look at the end of the protruding motor shaft.

DOM The Date of manufacturing on the nameplate of the device is shown in

the format DD.MM.YY,

e.g. 31.12.06 (December 31, 2006).

EMC Electromagnetic compatibility

Encoder Sensor for detection of the angular position of a rotating component. The

motor encoder shows the angular position of the rotor.

Error class Classification of errors into groups. The different error classes allow for

specific responses to faults, e.g. by severity.

Fatal error In the case of fatal error, the drive is not longer able to control the motor,

so that an immediate switch-off of the drive is necessary.

Fault Operating state of the drive caused as a result of a discrepancy between

a detected (computed, measured or signaled) value or condition and the $\,$

specified or theoretically correct value or condition.

Fault reset A function used to restore the drive to an operational state after a de-

tected fault is cleared by removing the cause of the fault so that the fault is no longer active (transition from state "Fault" to state "Operation En-

able").

Forcing Forcing switching states of inputs/outputs. Forcing switching states of in-

puts/outputs.

I/O Inputs/outputs

 l^2t monitoring Anticipatory temperature monitoring. The expected temperature rise of

components is calculated in advance on the basis of the motor current.

If a limit value is exceeded, the drive reduces the motor current.

Inc Increments

Index pulse Signal of an encoder to reference the rotor position in the motor. The en-

coder returns one index pulse per revolution.

Limit switch Switch that signals overtravel of the permissible range of travel.

Node guarding Monitoring of the connection with the slave at an interface for cyclic data

traffic.

Parameter Device data and values that can be set by the user.

Parameter switch Small switches adjacent to each other

Persistent Indicates whether the value of the parameter remains in the memory af-

ter the device is switched off.

PLC Programmable logic controller

Profibus Standardized open fieldbus as per EN 50254-2 which allows drives and

other devices from different manufacturers to communicate.

Power stage
The power stage controls the motor. The power stage generates cur-

rents for controlling the motor on the basis of the positioning signals from

the controller.

PWM Pulse width modulation

Quick Stop Function used to enable fast deceleration of the motor via a command

or in the event of a malfunction.

RS485 Fieldbus interface as per EIA-485 which enables serial data transmis-

sion with multiple devices.

Torque ramp Deceleration of the motor with the maximum possible deceleration,

which is only limited by the maximum permissible current. The higher the permissible braking current, the stronger the deceleration. Because energy is recovered up depending on the coupled load, the voltage may increase to excessively high values. In this case the maximum permis-

sible current must be reduced.

Warning If not used within the context of safety instructions, a warning alerts to a

potential problem detected by a monitoring function. A warning is not a fault and does not cause a transition of the operating state. Warnings be-

long to error class 0.

Watchdog Unit that monitors cyclic basic functions in the product. Power stage and

outputs are switched off in the event of faults.

Zero voltage window Voltage range that is interpreted as 0 V.

14 Index

Numerics

24V signal interface
Cable specifications and terminal 69
Connecting 69
Function 69
Setting functions 78
starting 78
testing function of limit switches 80
24V signals
testing 79

Α

Abbreviations 165 Accessories and spare parts 155 Address and baud rate Fieldbus interface CAN 64 Fieldbus interface Profibus 61 Fieldbus interface RS485 66 Air humidity 25 Ambient conditions 25 Air humidity operation 25 Operation 25 Relative air humidity operation 25 Transportation and storage 25 Axis signals Moving away from switch 90 REF 90 STOP 91 Axis signals, monitoring signals 90

В

Before you begin Safety information 19

C

Cable specifications Protected cable installation 42 Cable specifications and terminal 24V signal interface 69 Fieldbus interface CAN 63 Fieldbus interface PPROFIBUS DP 59 Fieldbus interface RS485 66 Safety function STO 71 Supply voltage 57 Cables, assembling 52 **CAN 139** Category 0 stop 40 Category 1 stop 40 Causes of errors 130 Certifications 25 Classical jog 103

Commands 139 Commissioning 75 24V signal interface 78 checking safety functions 82 Optimizing motion behavior 84 preparation 76 running 77 testing function of limit switches 80 testing positioning mode 83 Torque characteristic 85 Commissioning software 86, 155 Online help 86 Commissioning software Lexium CT 86 Components and interfaces 10 Config 140 Control 141 D Declaration of conformity 16 Definition STO 40 Definition of direction of rotation 115 Diagnostics 123 dimensional drawing, see dimensions Dimensions 29 Direction of rotation, definition of 115 Disposal 159, 161 Documentation and literature references 15 Ε Electrical installation 49 EMC 46 EPLAN Macros 15, 155 Equipotential bonding conductors 39, 47 ErrMem0 142 Error class 129 Error classes 129 Error indication 123 Error memory 124 Error numbers 133 Error response 129 Meaning 129 External axis signals 90 External power supply unit 37 F Fault reset 129 Fieldbus interface CAN Address and baud rate 64 Cable specifications and terminal 63 Connection 63 Function 63 Fieldbus interface Profibus

Address and baud rate 61

Terminating resistor 60, 63, 66

Cable specifications and terminal 59

Fieldbus interface PROFIBUS DP

Connection 59

M Macros EPLAN 15, 155 Maintenance 159 Manual 145 manuals 15 Max. humidity operation 25 Mechanical installation 47 Monitoring functions 44 Monitoring signals, external 90 Axis signals REF 90 STOP 91 Moving away from switch 90 Monitoring signals, internal 93 read 93 Motion 139, 145 Motion behavior optimization 84 Optimizing motion behavior 84 Ramp slope 84 Torque characteristic 85 Mounting position 28 Moving away from limit switch range 103 Moving away from switch 90 Ν Name plate 13 0 Operating mode Change 100 Homing 108 homing 108 jog 101 profile position 105 profile velocity 104 Operating modes 100 Operating state Read 96

P

```
Parameter
Representation 137
Parameter group
CAN 139
Commands 139
Config 140
Control 141
ErrMem0 142
Homing 142
```

Operating States 96

Operation ambient temperature 25 Optimizing the motor behavior 84

Operation 89

I/O 144 Manual 145 Motion 145 motion 139 Profibus 146 ProglO0 147 PTP 148 RS485 148 Settings 149 Status 150 VEL 154

Parameter values, default 89

overview 138
Position setting 114
Positioning limits 92
Positioning range 92
Positioning resolution 92
product manuals 15

Parameters 137

Profibus 146

PTP 148

Quick Stop 116

Ramp slope 84

Q

R

Profile generator 115 Profile position 105 Profile velocity 104 ProgIO0 147

Programmable inputs/outputs 118 Protected cable installation 42

Qualification of personnel 19

0198441113568, V2.00, 09.2008

```
Service 159
Service address 160
Settings 149
      Operating-mode-independent 101
Shipping 161
Software stop 91
software STOP 91
Source
      Commissioning software 86, 155
      EPLAN Macros 15, 155
      product manuals 15
Standstill window 122
State transitions 96
Status 150
Status information
      Operating-mode-specific 98
      Other 99
STO 40
      Application examples 43
      Definitions 40
      Requirements 41
STOP 91
Storage 161
Supply voltage
      Cable specifications and terminal 57
      Connecting 56
System requirements 86
T
Technical data 25
Temperature during operation 25
Terminating resistor
      Fieldbus interface Profibus 60, 63, 66
Terms 165
Testing
      positioning mode 83
Testing positioning mode 83
Testing safety functions 82
Travel profile 115
Troubleshooting 123, 130
Type code 14
U
Unit overview 9
Units and conversion tables 163
V
VEL 154
```