MOREK
Creating a better future for You

INSTALLATION GUIDE


www.morek.eu

Product information

Product code	Product name	$I_{n\ Al}$	$I_{n\ Cu}$	U_n	USA specific		
					$I_{max\ Al}$	$I_{max\ Cu}$	U_{max}
MAA1035A10	OTL-connector 1xAl/Cu 2,5-35mm² (Grey)	120 A	135 A	1000 V AC / 1500 V DC	90 A	115 A	1000 V
MAA1035B10	OTL-connector 1xAl/Cu 2,5-35mm² (Blue)	120 A	135 A	1000 V AC / 1500 V DC	90 A	115 A	1000 V
MAA1035Y10	OTL-connector 1xAl/Cu 2,5-35mm² (Yellow Green)	120 A	135 A	1000 V AC / 1500 V DC	90 A	115 A	1000 V
MAA1035R10	OTL-connector 1xAl/Cu 2,5-35mm² (Red)	120 A	135 A	1000 V AC / 1500 V DC	90 A	115 A	1000 V
MAA1035S10	OTL-connector 1xAl/Cu 2,5-35mm² (Black)	120 A	135 A	1000 V AC / 1500 V DC	90 A	115 A	1000 V
MAA2035A10	OTL-connector 2xAl/Cu 2,5-35mm² (Grey)	120 A	270 A	1000 V AC / 1500 V DC	90 A	2x115 A	1000 V
MAA2035B10	OTL-connector 2xAl/Cu 2,5-35mm² (Blue)	120 A	270 A	1000 V AC / 1500 V DC	90 A	2x115 A	1000 V
MAA2035Y10	OTL-connector 2xAl/Cu 2,5-35mm² (Yellow Green)	120 A	270 A	1000 V AC / 1500 V DC	90 A	2x115 A	1000 V
MAA2035R10	OTL-connector 2xAl/Cu 2,5-35mm² (Red)	120 A	270 A	1000 V AC / 1500 V DC	90 A	2x115 A	1000 V
MAA2035S10	OTL-connector 2xAl/Cu 2,5-35mm² (Black)	120 A	270 A	1000 V AC / 1500 V DC	90 A	2x115 A	1000 V

Mounting


Certification and approval

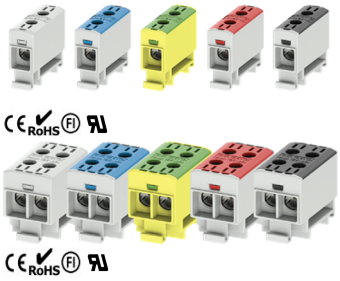

DIN-rail and screw (M5) mounting



DIN rail mounting
Set connector on DIN rail. Push until connector locks down.

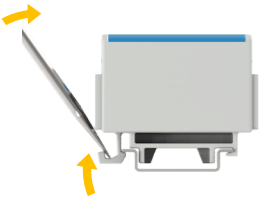

Removal
Release the slider and lift connector

Connection

Screw size		
	Screw	M8
	SW	4



Tightening torque M		
	2,5-16 mm² (6-14 AWG)	3 Nm
	25-35 mm² (2-4 AWG)	6 Nm

Stripping length L	15 mm



	1xAl/Cu 2,5-35 mm²	2xAl/Cu 2,5-35 mm²
Conductor range		
Max. wire cross section	35 mm²	35 mm²

Copper conductors

Max. 3 X CU / Conductor contact space



≤ 35 mm² total

Aluminium conductors

1 X AL / Conductor contact space



Anti-corrosion paste: e.g. Penetrox

Supported IEC 60228 -conductors



Class 5 & 6 (fine stranded) Using ferrule is recommended

Class 1 & 2 (solid and stranded)

Sector shaped cable



Pre-round the cable

Conductor installation


Remove any oxide layer by brushing with a brass or a steel brush.

Use protective grease (e.g. Penetrox) and brush grease on the contact surfaces of the conductor.




1-pole connector

Support connector during tightening the screws. Ensure the torque after tightening, tighten twice if necessary. Connector must be installed so that conductors are relieved from strain.

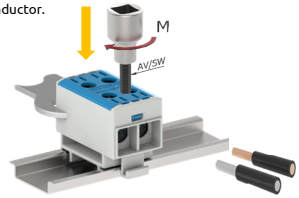

Marking

5 mm width (Eg. Partex TX)

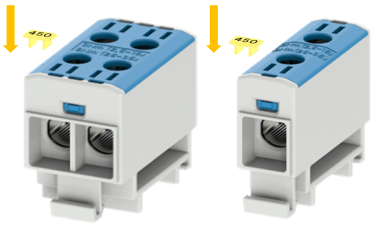

Attention!

The installation must always be done in accordance with the international standard in compliance with national legislation.



Each protective or neutral conductor must have their own conductor space. SFS 6000-7-729.

Cross section and max. number of Cu- conductors / contact space (Al- conductors in parenthesis)

1,5 mm²	2,5 mm²	6 mm²	10 mm²	16 mm²	25 mm²	35 mm²	50 mm²
-	3 (1)	3 (1)	3 (1)	2 (1)	1 (1)	1 (1)	-

The specified max. amount of conductors refers only to industrially installed terminals.

70 mm²	95 mm²	120 mm²	150 mm²	185 mm²	240 mm²	300 mm²	400 mm²
-	-	-	-	-	-	-	-